

AZTEK Safety Notice in regards to the Sterling Rope 8mm Edge Restraint

Sterling Rope has notified Rock Exotica that the 8mm Edge Restraint (SRER) with the sewn eye has been voluntarily recalled.

- In batch tests at Sterling, some cord was found to break below the published MBS of 17.5kN.
- We have provided a copy of the Sterling Rope Recall and lot numbers that are affected.
- 8mm cord with sewn eye termination made after May 2013 is being recalled. This includes the 8mm Edge Restraint in the AZTEK kit.

The AZTEK system:

- Safe Working Load (SWL) of the AZTEK system with a one-person load is 3kN, without a one-person load it is 5kN
- Published Minimum Breaking Strength (MBS) for 8mmEdge Restraint is 17.5kN
- In a 4:1 mechanical advantage system provided by the AZTEK, using the 6mm Ratchet or prusik, the maximum weight on the sewn eye attached to becket is 1/3 of the total force on the Aztek System
 - For example, if the maximum SWL of 3kN is applied on the Aztek that would be the equivalent of a resulting 1kN force on the Edge Restraint Sewn eye
- EN 795:1996 requires anchors to have an MBS of 10kN; Therefore, Edge Restraint must hold 3.33kN, that is far below the rope and sewn eye strength

Rock Exotica Break Test of the SR 8mm Edge Restraint

- Tested several samples of Sterling Rope Edge restraint in-house
- None broke below 12kN, therefore we do not believe the strength of the AZTEK system is affected and is within the specified MBS of the user manual.

Recommendation:

- Check the lot number on the 8mm Edge Restraint cord in your system against the lot numbers in Sterling's Recall notice. If your cord was purchased before May 2013, it is not in this recall.
- All US and non-CE customer should contact the dealer they purchased the ATEK from or Sterling Rope for replacement rope as soon as possible.
- European Customers within the CE countries need to contact the local distributor to replace your entire system.
- If you are adhering to the AZTEK manual and keeping under SWL, you can use the AZTEK system until you receive replacement rope.
- As always, do not use AZTEK or any other gear above the SWL

rock	exotica
------	---------

PRODUCT RECALL Sterling Rope 8mm Sewn Cord Products

Sewn cords can break at a lower weight than published weight values, posing a fall hazard to consumers.

Customers who purchased these types of products should check to see if their lot numbers are among those included in the voluntary recall (see instructions below). Please also see www.sterlingrope.com for the full list of lot numbers affected. Please immediately stop using these recalled products and return them to Sterling Rope.

Products Affected by the Recall



How to Check a Product's Lot Number

Sterling Rope products display the production lot number in two places. The lot number is printed on the barcode label affixed to our Care, Use and Retirement document (see photo A). The lot number is also printed on the shrink tube label on the sewn portion of the prusik (see photo B).



Photo A



Photo B

For a free replacement product call Sterling Rope at:



or contact us at www.sterlingrope.com