


Wide Format/Large Area Industrial Floor Marking Solutions

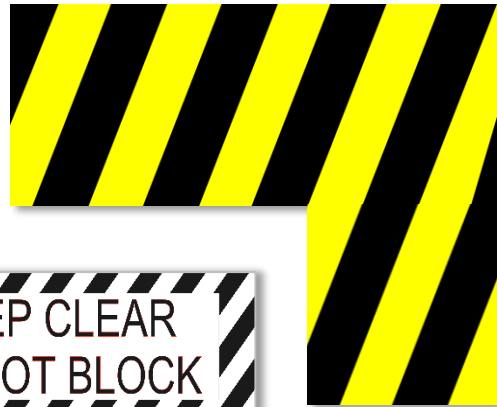




PIPRD.com
Sales@piprd.com
765-458-7463



PIPRD Large Area Industrial Floor Markings

Pedestrian Walkways - Cross Walks - Safety, Caution & Hazard Zones - Critical Clearance Area Marking


Large Area & Wide Industrial Floor Marking Install Instructions:

<p>1. Identify floor marking area and a reference line to align with the long edge of the floor marking. If there is no reference line create one use a chalk line or string.</p>	
<p>2. Clean floor with industrial floor scrubber or by hand with standard cleaning chemicals such as soap and water, rubbing alcohol. Do not use muriatic acids or mineral spirits. Ensure Floor is dry and above 55°F</p>	
<p>3. Unroll the material along the reference area and cut to length. Ensure material follows reference line as desired.</p>	

4. Flip the material so the adhesive liner is facing up. On the edge of the material to be aligned with your reference line, cut the backing of the material approximate 2" from the edge using a razor knife. Remove the thin section liner to expose the adhesive.



5. ** 3 or more people are recommended for step 5 thru 8** Careful not to touch the exposed adhesive to itself, flip the marking over so the exposed adhesive is along the reference line. Adjust the position of the marking as needed to align with the reference and remove any kinks or raised areas before applying pressure the exposed adhesive.

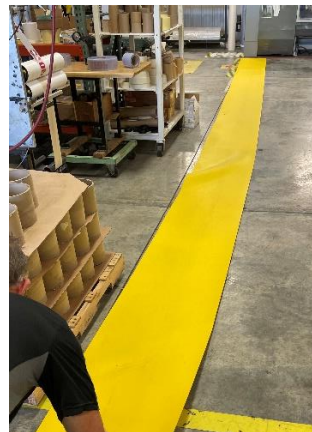


6. Once in place, apply pressure to adhere the small section to the floor. Flip material along adhered edge. Have two people hold the material in this position.



7. While the material is still flipped and held in position, remove the liner from one end and continue until all the adhesive liner is removed.



8. Gradually apply the adhesive from the previously adhered edge. While applying, use a swatch or hand to apply pressure across the material to eliminate air pockets.

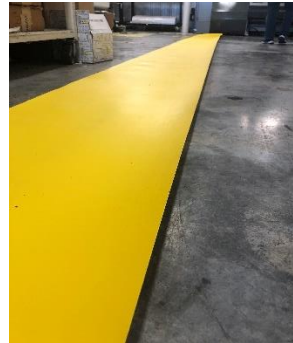

9. Once all adhesive is applied, apply pressure along edges and walk along marking to ensure good adhesion. Air pockets can be removed by penetrating the marking with a razor knife and funneling the air through the cut.



10. The slip resistant textured surface will collect dust. Clean by hand or with industrial floor scrubber as necessary. Floor markings are suitable foot and vehicle traffic.