

Star Epoxy Mount Installation Guide

<p>Required Tools</p>	<p>Drill Hole for hardware in approximate location of panel corners</p>	<p>Insert Star Hanger (for use with sheetrock) or Star Lock (for use with furring)</p>	<p>Use an electric drill to tighten the Star Hanger into place set drill for minimum torque.</p>	<p>Use shims as required</p>
<p>Place your Alignment Pin into the Star Hanger, Push the Alignment Pin down</p>	<p>The pin fits loosely so use tape to better hold the pin if needed</p>	<p>Carefully measure & number each solid surface panel and place panel order</p>	<p>Solid surface is too hard to indent, so place 1/8" foam board at each hanger location</p>	<p>The tape backed foam is used in every hanger location</p>
<p>Carefully position your panel over your Alignment Pins</p>	<p>Push them firmly enough to leave a location mark in the foam</p>	<p>Use a pencil to mark the exact location of the Alignment Pins</p>	<p>Use a square to mark a large "X" through the exact location of the Alignment Pins</p>	<p>Use a high-quality brand of epoxy to glue the Epoxy Mount to the solid surface (the Epoxy Mount has 4 small notches to align with the "X")</p>
<p>After about 10 minutes the panels are ready to hang</p>	<p>Remove Alignment Pin and tape</p>	<p>Lift the panel into place about 1/2" above marks, push in and down</p>	<p>Pull down firmly to lock the panels into their final position</p>	<p>Finished Wall</p>