
TOP ASSEMBLY LEAKS (ALUMINUM SKIN) TROUBLE SHOOTING GUIDE 1968 TO PRESENT MODEL YEAR FOLDING TRAILERS

SYMPTOM: WATER LEAKS AROUND LIGHT	REPAIR ACTION
FIXTURE FIXTURE	REFAIRACTION
EXTERIOR CENTER SEAM SEAL BROKEN	REMOVE CENTER SEAM. CLEAN AND SEAL TOP OUTER SKIN SPLICE. REPLACE CENTER SEAM (WITH NEW, IF NECESSARY).
SYMPTOM: Interior paneling swells in one area and is wrinkled	REPAIR ACTION
Exterior center seam seal broken	REMOVE CENTER SEAM. CLEAN AND SEAL TOP OUTER SKIN SPLICE. REPLACE CENTER SEAM (WITH NEW, IF NECESSARY).
Voided or cracked caulking around top corners and side rails	REMOVE OLD CAULKING; RECAULK DAMAGED AREAS
SYMPTOM: WATER STAINS	REPAIR ACTION
Exterior center seam seal broken	REMOVE CENTER SEAM. CLEAN AND SEAL TOP OUTER SKIN SPLICE. REPLACE CENTER SEAM (WITH NEW, IF NECESSARY).
Caulking voids	REMOVE OLD CAULKING; RECAULK DAMAGED AREAS
Broken seal around end trim	RESEAL.
SYMPTOM: WATER LEAKS ALONG INTERIOR COVES	REPAIR ACTION
EXTERIOR CENTER SEAM SEAL BROKEN	REMOVE CENTER SEAM. CLEAN AND SEAL TOP OUTER SKIN SPLICE. REPLACE CENTER SEAM (WITH NEW, IF NECESSARY).
IMPROPERLY INSTALLED ACCESSORIES	REMOVE ACCESSORY AND INSTALL SEALER ON GASKET UNDER BRACKETS AND SCREWS
LOOSE SCREWS ALONG CANOPY TRACK	Tighten as needed
SYMPTOM: DELAMINATION OF TOP SKIN FROM STYROFOAM BASE	REPAIR ACTION
EXTERIOR CENTER SEAM SEAL BROKEN	REPLACE TOP ASSEMBLY
SYMPTOM: ONLY LEAKS WHEN TOP ASSEMBLY IS CLOSED	REPAIR ACTION
TOP SEAL NOT MAKING CONTACT WITH BODY RAILS.	REPLACE SEAL. ADJUST TOP FOR PROPER SEAL.

NOTE: When locating water leaks, it is important to isolate problem area to determine what factors (screws, seams, accessories, etc.) would contribute to top assembly developing a leak.

TOP ASSEMBLY LEAKS (ALUMINUM SKIN) TROUBLE SHOOTING GUIDE 1968 TO PRESENT MODEL YEAR FOLDING TRAILERS Page 2

AMERICANA TOP ASSEMBLY POTENTIAL LEAK LOCATIONS

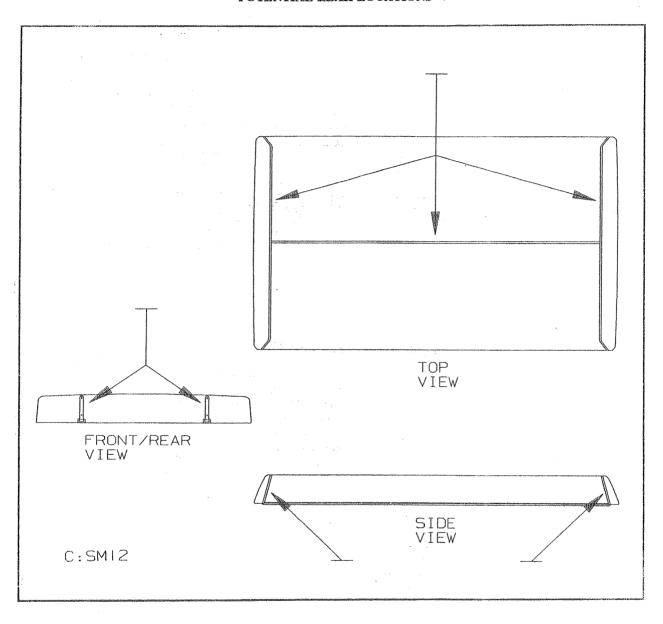

TOP ASSEMBLY LEAKS (ALUMINUM SKIN) TROUBLE SHOOTING GUIDE 1968 TO PRESENT MODEL YEAR FOLDING TRAILERS Page 3

FOUR SEASON, PLANTATION, DESTINY, AND PIONEER TOP ASSEMBLY POTENTIAL LEAK LOCATIONS

