


It has come to our attention that the iAMP-GM1 may reset when adjusting the power seats in the Camaro. Please follow the steps below to remedy the issue.


1. Locate the 5-pin plug at the amplifier and disconnect it.



2. Locate the black wire in Pin 1 of the 5-pin plug.

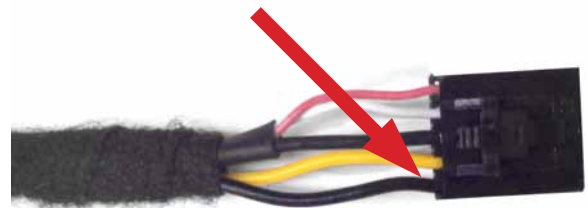

3. Flip the plug over and remove this wire by pressing on the release tab with a straight pick or similar tool.

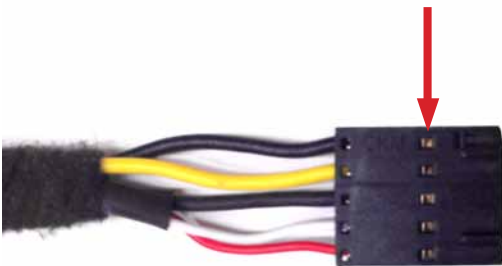

4. The plug should look like this when finished. Secure the wire with electrical tape and re-connect to the amplifier.



Please Note: If updating the firmware on the iAMP LCD touch screen display becomes necessary, you will either have to re-connect this wire or remove the radio to gain access to the display harness.