



DeatschWerks Technical Service Bulletin (TSB)

Bulletin No: TSB-22-10-14

Issue Date: October 10, 2022

Category: DW200, DW300 & Prefilter

Part Numbers Affected:

9-201-0766	9-301-0766
9-201-0847	9-301-0847
9-201-0883	9-301-0883
9-201-1000	9-301-1000
9-201s-1000	9-301s-1000
9-201s-1004	9-301s-1004

Subject: Prefilter does not fit tight on DW200 & DW300 fuel pumps

Description of Problem:

Certain pre-filter sock part numbers do not fit tightly on certain DW200 & DW300 fuel pump lot numbers. The DW200 and DW300 fuel pumps with specific lot numbers have a tapered inlet fitting on the fuel pump that will not allow the pre-filter to lock into place causing the pre-filter to be extremely loose on the fuel pump. Refer to the part number list above for the pump & fitment kits that are affected by the tapered inlet.

Corrective Action Suggested

Option A: Use of the included start-nut pump filter retainer will keep the loosely fitting fuel sock in place. There are no known issues of pre-filter sock failures when installed with the star-nut retainer.

Option B: A properly fitting fuel pump pre-filter sock has been obtained by DeatschWerks and will be shipped to the effected customer at no charge. Please contact DeatschWerks technical support at 405-217-0701 or techsupport@deatschwerks.com for service.

Affected Pump Lot Numbers:

The lot # format will be as follows: Lot# XXXX-221010, Please compare your lot number to the following list of lot numbers below. If your lot number is in the list below, compare your inlet fitting on the bottom of the fuel pump to verify you have a tapered inlet housing.

2326-210729	2326-210109
2326-210309	2326-210409
2326-210310	2326-210122



DeatschWerks, LLC
techsupport@deatschwerks.com
405-217-0701