

ULTRA THROTTLE CABLE INSTALLATION

1. The gas pedal should be installed first.
2. Measure the throw of both gas pedal and throttle plate and position clevis accordingly on gas pedal arm. (Make sure attachment point of swivel end is the same distance from throttle shaft as the stock hook-up was).
3. Mount the firewall fitting at the point indicated by the cable clevis. (Drill 5/16" hole)
4. Mount the cable adjuster bracket on the rear carburetor stud. Adjust the adjuster all the way in (toward carb).
5. Measure between the firewall fitting and the cable adjuster (note that the cable housing will set into each fitting .500 thousand or about 1/2"). Cut the cable housing to this length (allow a little extra length - about 1 1/2").



NOTE; Do not strip back the vinyl covering when installing black cable housing.


6. Mount the swivel end on the throttle arm and open the throttle all the way to check for binding and position.

7. Install clevis and tighten set screw lightly: check operation and tighten set screw if OK.

NOTE: Make sure that the gas pedal bottoms just BEFORE reaching full throttle at the carb.

IMPORTANT

USE A FACTORY TYPE THROTTLE RETURN SPRING or GENNIE SHIFTER THROTTLE SPRING KIT # 3021. CHECK FOR BINDING OR OVERCENTER CONDITION BEFORE STARTING ENGINE.

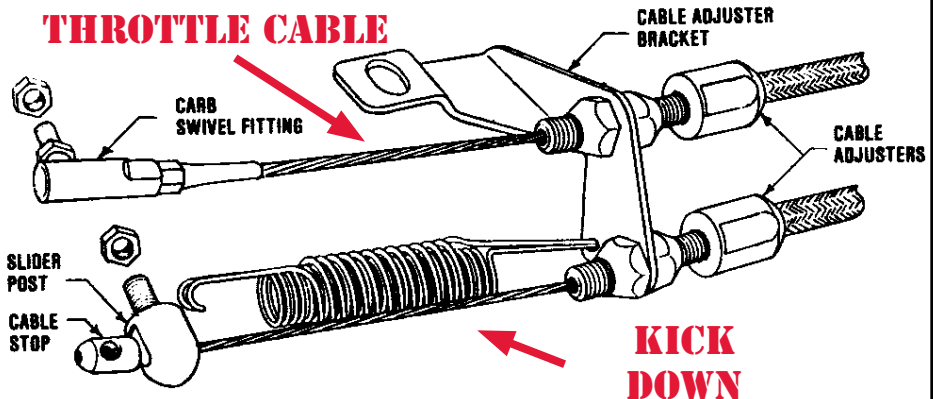

READ THIS NOTICE

This product will be replaced if defective in manufacture or packaging. Except for such replacement, the sale or any subsequent handling of this product is without warranty or liability even though defect, damage, or loss is caused by negligence or other fault.

GENNIE

SHIFTER™



GENNIESHIFTER.COM

INST10024



STILL THE BEST!

DENVER, COLORADO

1-866-623-1963

GENNIESHIFTER.COM

INST10024