

















1. Calibration & Gravity Compensation

1.1. Calibration

When the power is off, press  while pressing .

When 'G-CAL' is displayed, and then press .

Then this calibration mode is started.

No.	TITLE	DISPLAY	KEYBOARD & DESCRIPTION
1	How to enter	G-CAL	  
2	Program version	t= 100	Move to a next step in automatic
3	Maximum capacity	CAPA 5000	 Initialized value  numeric increase  scale increase /  save
4	Minimum division	d iw 2	 decrease /  increase  save
5	Setting weight	SEt-F 5000	 Initialized value  numeric increase  scale increase /  save
NB : Setting weight shall be within the range of 10 %~100 % of max. capacity			
6	Zero calibration	ZEro -----	Unload the tray and press 
7	Span calibration	LoAd -----	Load the weight which was set in step 5 and press 
8	Finish	End	Unload the tray and press 