724 Feeder Problem Solving Tips-n-Hints		
Problem	What to look for	What should you do
Signature rolling off crease	 a. Vacuum pump or pocket valve off. b. Bottom support at station too far back. c. Signatures too soft and/or flimsy. d. Signature not pulled down by suction cups. e. Plate not far enough into signature when released. 	 a. Turn vacuum pump/pocket valve on and/or verify that it is on. b. Move bottom support forward in station. c. Recheck all setup steps and setup to close tolerances. Consider using brushes on front of vacuum cover plates at station. d. See next problem and solution. e. Adjust vacuum release point cam.
Signatures not pulled down by vacuum cups	 a. Heavy weight signatures or vacuum too low. b. Unused vacuum cups not plugged, low vacuum. c. Signatures held too tight in pocket. d. Too many signatures in station. e. Backstop not against pile. 	 a. Adjust regulator to provide slight increase in vacuum level. b. Install plugs into unused (open) vacuum cups. c. Move station back slightly for about 1/32" clearance along width of signature and make sure you have some side-to-side play. d. Remove some signatures from station. e. Release and slide backstop onto pile.
Problem feeding signatures after jam is cleared	a. Signature plates are out of position, out-of-time.b. Picker fingers bent.	a. Reset clutch and/or retime feeder. b. Replace and/or adjust.
Signatures missed or torn, not opening for plates	 a. Signature upside down in pocket. b. Air not turned down to unused stations, air jet too low. c. Air tube clogged. d. Signature not folded correctly. e. Lip support too far out, lower leg catching on it. f. (Only with openers) fingers may not be returning home. g. (Only with openers) fingers are too far out. Possibly beyond leading edge of lip support. 	 a. Check all signatures in stack and reposition as needed, long leg up, crown facing front station. b. Turn down air to unused stations, reduce vacuum. c. Clean air tube exit port on pocket table. Do not to enlarge opening. d. Remove incorrectly folded signature from stock. e. Readjust as needed. Typically the lip support should extend about 1/16" less than the short leg of signature. f. Check and/or adjust as indicated in section 5., SERVICE, PICKER ASSEMBLY. g. Readjust picker assembly so fingers are about 1/16" from lip support.
Signatures not placed correctly on saddle.	a. Feeders too far away from saddle, out of time with stitcher or overload clutch not reset correctly.	a. Follow instructions in section 6, TROUBLESHOOTING and section 5., SERVICE.
Sneakers, additional signatures pulled off crown springs.	 a. Too much space between crown spring skis and signatures. b. Stock pile weight too heavy. c. Station bottom support springs out of position or more required. d. Paper porous, more than one signature sucked down. e. Crown springs weak or broken. 	 a. Readjust station back to reduce space. b. Excessive weight causes the signatures to push extras past crown springs. If this occurs, remove some signatures to reduce weight. c. Move station bottom supports upward or use additional springs. d. Replace standard vacuum cup S-1481 with smaller cup S-1482 or reduce vacuum. Maybe raise table slightly. e. Replace defective crown springs.