






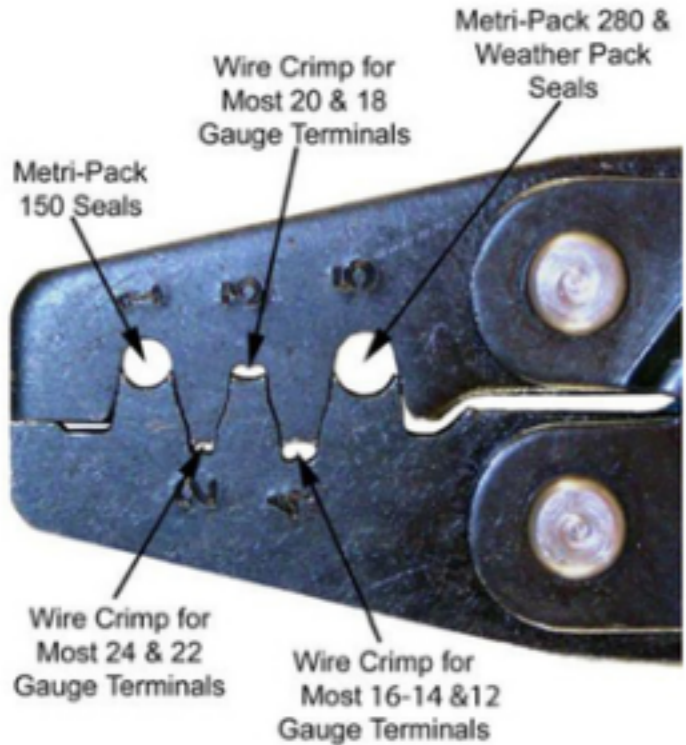


# Instructions for Crimping Weather Pack and Metri-Pack Terminals and Seals Using the CT-18 Tool

			
<p>The CT-18 tool has five dies for crimping a variety of terminals and seals 24-12 gauge. Use this chart to locate the correct dies for your intended use.</p>	<ol style="list-style-type: none"> <li>1. Thread the wire through the matching gauge seal.</li> <li>2. Strip 3/16" of wire insulation.</li> <li>3. Slide the seal up to the edge of the wire insulation.</li> </ol>	<ol style="list-style-type: none"> <li>4. Insert the terminal into the correct die on the crimper and gently close the jaws to hold the terminal in place.</li> </ol>	<ol style="list-style-type: none"> <li>5. Insert the stripped wire into terminal until the seal is flush with the end of the terminal.</li> </ol>
			
<ol style="list-style-type: none"> <li>6. Completely close the jaws to crimp the terminal to the wire.</li> </ol>	<ol style="list-style-type: none"> <li>7. Insert the terminal and seal into the seal die and crimp the terminal to the seal.</li> </ol>	<ol style="list-style-type: none"> <li>8. Pull test to ensure a complete crimp.</li> </ol>	<ol style="list-style-type: none"> <li>9. Insert the terminal into the connector until it clicks.</li> <li>10. Close the cover.</li> </ol>