

CCi-220 CALIBRATION

- A) Open indicator housing.
- B) Press and hold "ZERO" key and press "ON" key to enter the CAL mode.
- C) Offset value should display 16000 +/- counts. If it is not in this range, it can be adjusted by turning the VR1 trimpot located on the rear of the PC board.
- D) Press "A" button to get SPAN mode. ("A" is located on front of the PC board, under the ZERO key)
- E) Press "TARE" key to zero the scale.
- F) Add calibration weight (increments of 50, 100, 150 or 200 lb). Span value should be approximately 30000 at full capacity.
- G) Press "B" button (located on the front of the PC board, under the TARE key). Display will cycle through 50, 100, 150, 200. When the display reaches the calibration weight you are using, press "B" again.
- H) Calibration is now complete. Close the indicator housing.