Calibration

	Display shows:
1. Press and hold any key while powering ON.	
2. Press and hold F key first and then + key, then release F key first then + key.	[. 7,7,7.
3. Press * key for Capacity selection.	
4. Press and hold F key first and then key, then release F key first then key to make sure <i>Capacity</i> selected, and display shows <i>Offset value to be 2000 ~ 6000</i> . If it's not in this range <i>SW2</i> to be adjust.	47.7.7.
5. Press * key goes to Span mode.	7,7,7,7
6. Press +0+ key to zero display.	
7. Put on the calibrating weight in lb. (Span value to be 20000 ~ 30000 at full capacity)	27.7.7.
8. Press key to cycle through a list of permissible weights. When the weight on the scale is displayed, press key.	