ADVANCE FUNCTIONS

EXTERNAL WEIGHT CALIBRATION

(This function is NOT available on OIML and Brazil approved models or the none-approved model without external calibration function)

1.	After the indicator reset	s back to zero, press and hold t	he + "ENTER"	(ex: FST) keys
	together until the weigh	t display shows "", then re	elease them. The full capaci	ty of the scale is
	show on the Weight display and Lill. is shown on the Unit Weight display.			
		A D HE WILLIAM	OX (A NITEXTEX (

WEIGHT	UNIT WEIGHT	QUANTITY	
≥8000€	CAL.		
Full capacity value of the scale			

2. Based on the capacity value displayed, place full load capacity, on the scale. When the weight is stable, the indicator will calibrate automatically. When the indicator counts down remove the weights from the scale, before the count reaches zero.

NOTE:

- It is also possible to calibrate the scale with lass than full load. Key in the weight value to be used followed by placing that weight on the scale.
- The weight value can NOT be less than 10 % of full capacity and over 1/2 of full capacity is highly recommended.
- Refer to APPENDIX: CAPACITY SETTING VALUES TABLE for the detail calibration value and calibration weight.