# BobsCNC Evolution E3, E4, E5, and KL series CNC Router Engraver Bearing and Rail Dust Kit

Thank you for the purchase of the BobsCNC rod and bearing cleaner kit. The following is the instructions to put the product together. If you don't currently own a wiper kit, they are available from the Old Country Woodworker on Etsy: Rail and Bearing Wiper Kit and eBay: Rail and Bearing Wiper Kit.

### **Procedure:**

This is a kit for the top bearings and rods for the top X and Y-axis bearing and rods. Each bag is labeled on the bag for that axis kit.

### X-axis' Parts

First thing to do is to thoroughly clean both the rod and bearing on the X-axis of all dust.

Gather the X-axis bag containing the X-axis parts. The X-axis front bag (photo 1) will contain, 3 each plywood parts FRX1 FRX3, and FRX4 (Front Right) and FLX1, FLX3 and FLX4 (Front Left), 1 each FRX2 (Front Right) and FLX2 (Front Left) felt pads, and 4 each locking washer, flat washer and 4mm X 30mm screws.



Photo 1 Front X
Parts


The X-Axis Right Rear bag will contain (photo 2), 1 each plywood part RRX1 and RRX3 (Rear Right) and 1 each plywood part RLX2 and RLX2 (Rear Left), 1 each felt part RRX2 (Rear Right) and RLX2 (Rear Left), 2 cable ties, and 4 each 4mm x 30mm long screws.

## Front X-axis' Assembly

We will start on the front right X-Axis bearing and rod. First remove the 2 - 4mm X 16mm screws just above and just below to the left of the front bearing (see picture 3) and leave the nut in place using masking tape, so they don't fall out

(see photo 4). Keep these screws, since you will use them on the Y-axis

assembly.

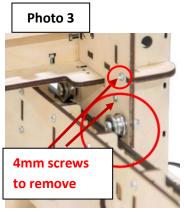

Get the 2 longer 4mm X 30mm screws from the rear X-axis kit bag. Place a locking washer and flat washer on the longer 4 mm X 30mm screws, then through part FRX1, with the

number facing the head of the screw, then through felt pad part FRX2, then part FRX3, and FRX4 then insert the screw back into the frame and into the existing nut. Don't tighten the screws yet until, the felt parts FRX2 is adjustable. Push the felt pad down until they are touching the bearing and the rails. When they are touching then tighten the screws. Photo 5 shows the front X parts mounting on the

Photo 4

Photo 2

Rear X


**Parts** 




assembly.

Now repeat the above step for the left side x-axis parts starting with the letters FLX. When completed with the front left

x-axis, the front x-axis is complete. Proceed to the rear x-axis assemble, next page.

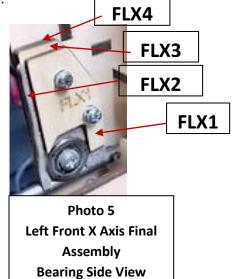

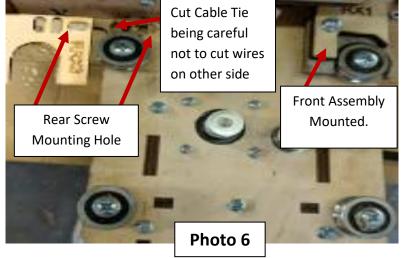


# Rear X-axis' Assembly

Now we will start the rear right of the X-axis (see Photo 6) for the top bearings and rods using Rear X parts, refer to photo 5. First cut and remove the

cable tie just above the bearing carefully, not to cut the wires on the back. Then remove the 4mm X 10mm screw just above and left of the bearing. For the rear parts assembly you will only use one (1) 4mm X 30mm screw with locking washer and flat washer through the top hole. Assemble the parts in this order: place the locking washer and flat washer on the screw, then through the top hole of RRX1, then through RRX2 felt pad, then RRX3, and then install assembly above the bearing and screw into the existing nut. Adjust the felt pad so that it touches the bearing and rail. Then lightly tighten the screw. Make sure the felt pad is touching the bearing and rails. Take a cable tie and route it through the top of the two holes through all parts and on the mainframe over the wires on the back and back through the bottom of the hole, then tighten the cable tie and then the screw. This now completes the right rear X axis assembly, repeat the above steps for the left rear axis using the parts starting with RLX. See Photo 7 for what the assembly should look like when installed as looking at the bearing.

Once installed, they will brush clean both the bearing and rails while the X axis moves, keeping both clean. **Once every few projects are completed on your CNC, best to blow air over the felt pads, so the dust will not clog them over time.** This completes the X-axis.

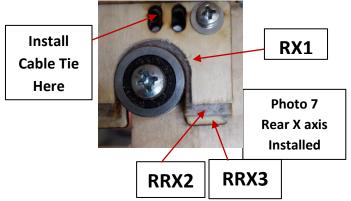

## **Y-Axis Installation**

The first thing to do is to thoroughly clean both the rod and bearing on the Y-axis of all dust.

The Y-axis bag contains the Y-axis parts, see photo 8. It will contain, 1 each part RY1 and LY1, 1 each part RY2 and LY2, 1 each part RY3 and LY3, 2 each 4mm nut, flat washer, and 4mm x 20mm long screws, see photo 6 showing each part in order as described. The third smaller screw, that is in the picture, is the one taken out of the X-axis previously.

Start by removing the 2 - 4mm X 16mm screw just above and just

below of the left bearing (see picture 9 red arrow for location) and leave the nut in place. It is best to place masking tape over the nuts to hold them in place before removing the screws as shown for the X-axis.

Then using the 2 - 4mm X 20mm screw from the Y-axis kit, mount part RY1 by inserting the 2 screws back through part RY1 into the frame and into the existing nuts and tightening the screws. Then using the 1 - 4mm 16mm screw that you took off previously from the x -axis, insert it through part RY1 from the back of RY1. Then through the felt parts RY2, then add plywood part RY3 and install 4 mm nut, as shown in Photo 10. Don't tighten the screw yet. Adjust the felt pad so that it is rubbing on the rail, then tighten the screw.

Then repeat the above steps on the other side using the LY parts. Lastly, remove the masking tape you put on to hold the nuts from all axes. Once installed, the pads will brush clean both of the rails while the Y-axis moves, keeping both clean.

This now completes the installation. You should no longer have a problem with the dust getting under your bearings and rails. Remember, after every few projects are completed on your CNC, best to blow air over the felt pads so the dust is removed off of the felt pads to stop them from clogging then over time.


I hope you enjoy having your bearing and rods clean while the CNC is running. Please let your friend, with the same Bob CNC, know where they may get a set for themselves or order another to give away as a gift to someone you know.

Thank you

Old Country Woodworker



Please contact us with any questions at oldcountrywoodworker@gmail.com

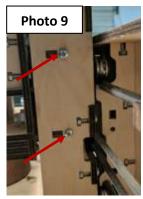

Left

Side

Right

Side

Photo 8
Y axis parts





