

# ILLUMINATED WRENCH INDICATOR LAMP

**Reference Number(s):**                    **SSM 47621**

**Date Announced:**

**Additional Info:**

**October 26th, 2018**

**FORD: 2018 EcoSport**

## SUMMARY:

Some 2018 EcoSport vehicles equipped with dealer or aftermarket remote start system may exhibit an intermittent wrench indicator lamp along with DTC P166A and a See Manual message on the information display in the instrument panel cluster (IPC). This may be due to the key takeover process being initiated during the remote start session.

Reprogram the body control module (BCM) using the Ford Diagnosis Repair System (FDRS). Make sure you are connected to the internet when entering module programming to obtain the latest updates. This message does not include vehicles in FSA 18B07 equipped with SYNC connect or Factory Invoiced Accessories (FIA) remote start. For claiming, use casual part 14G490 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

