





## PC-66L Quick Guide

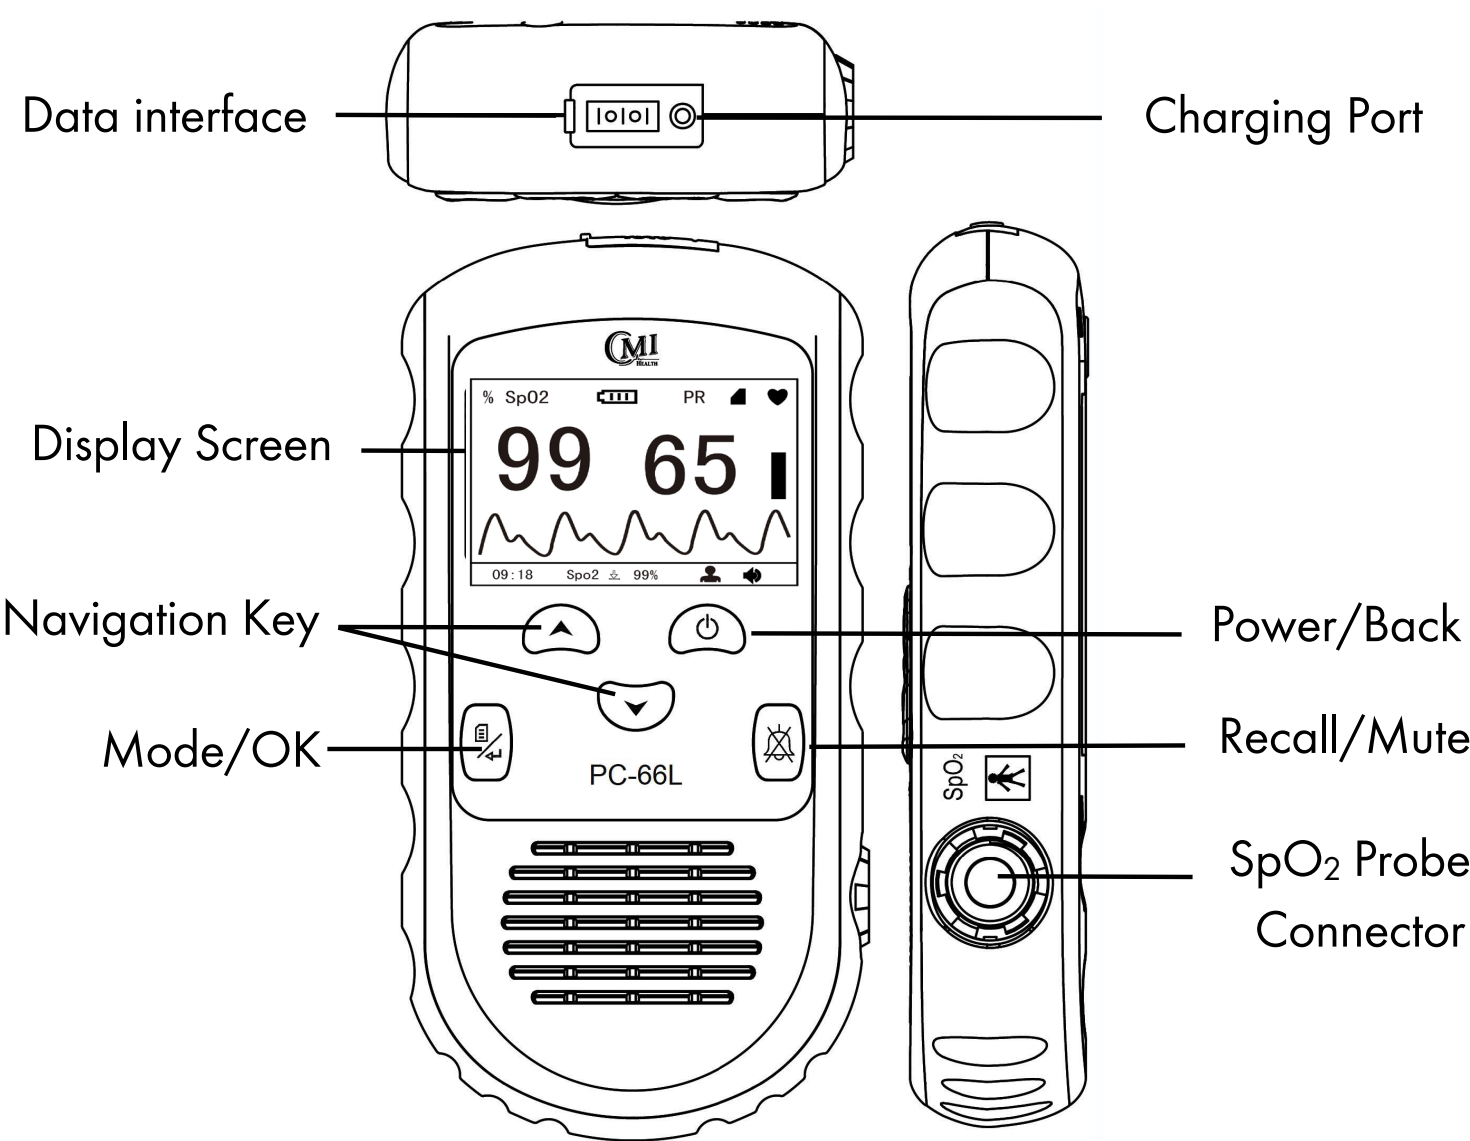


# 1. Product Overview



# 2. Screen Display

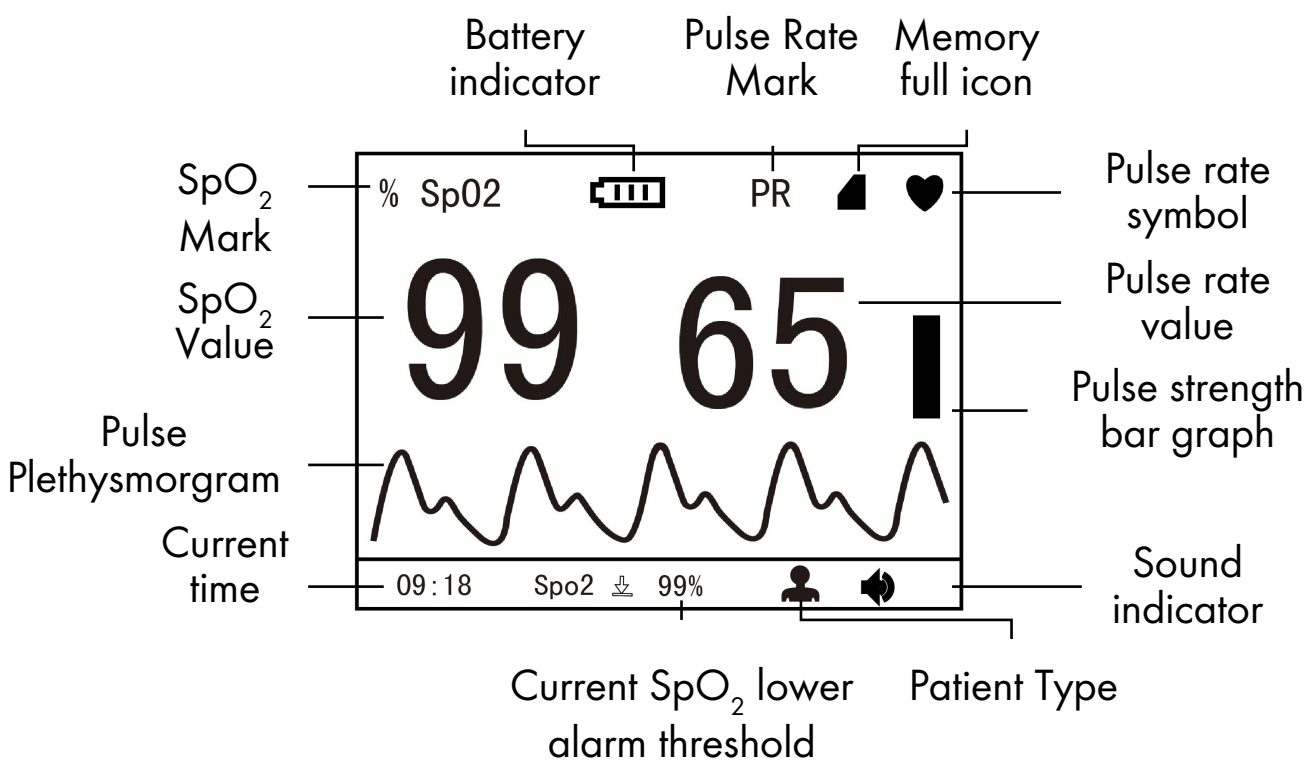

# 3. Charging

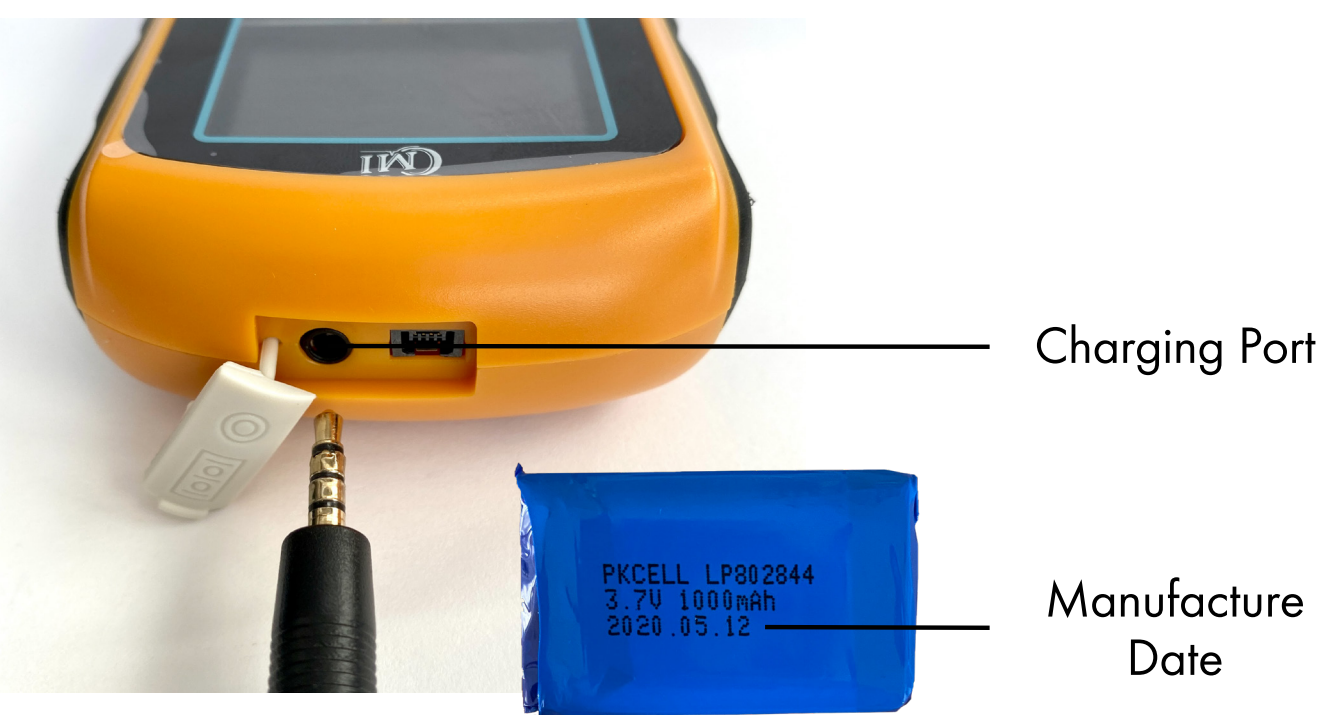


To charge the battery, connect the end of the charging cable to the device's top DC power input (round charging port), and connect the other end to the AC power adapter.

\*Date printed on the battery indicates the manufacture date.

# 4. How to Use and Take a Measurement



Line up arrow signs, then insert cord.

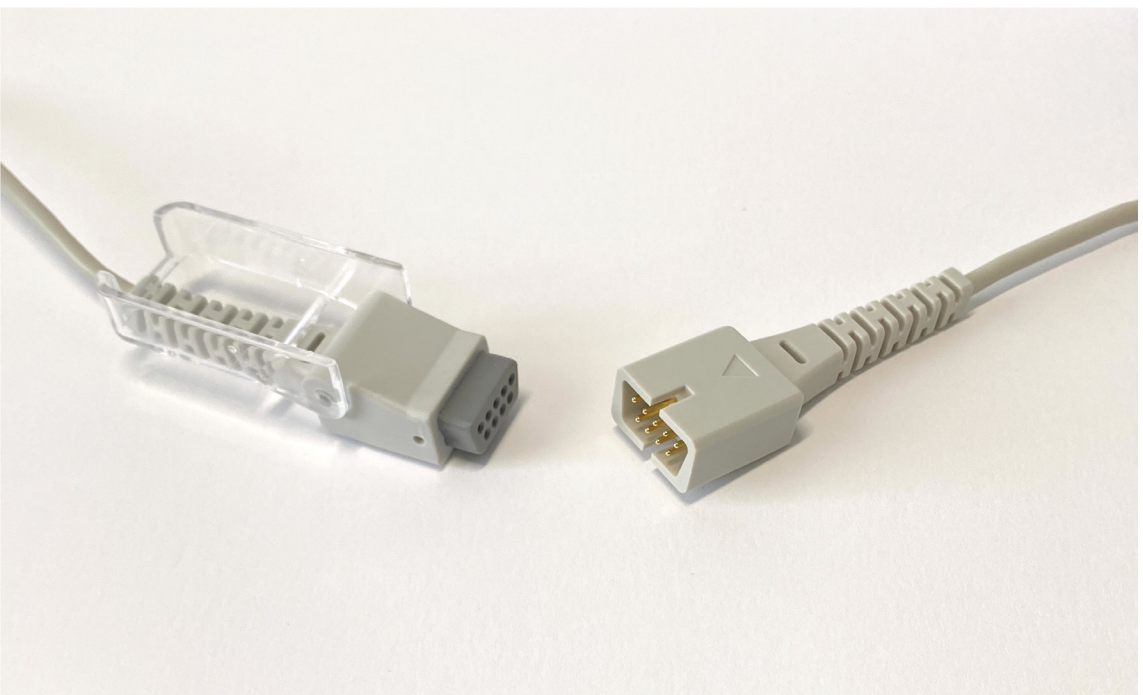


Open cap and connect converter cable with the other end of SpO<sub>2</sub> sensor.




Insert one finger into the sensor and start your measurements.




## 5. Alarm Set-up

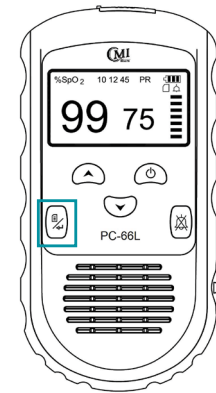


1. Press and hold "Mode/OK" for 2 seconds to go to the menu.

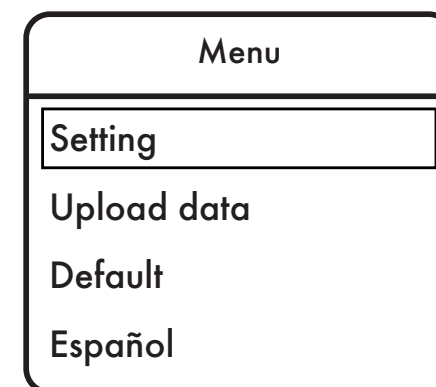


2. On the menu screen, select "Setting" and then press "Mode/OK."

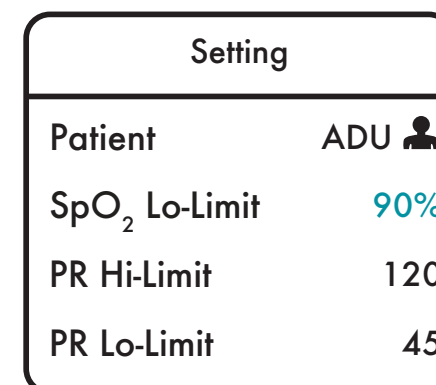

3. Use ↑/↓ to move cursor and select type of threshold for alarm. Example shows SpO<sub>2</sub> Lo-limit.

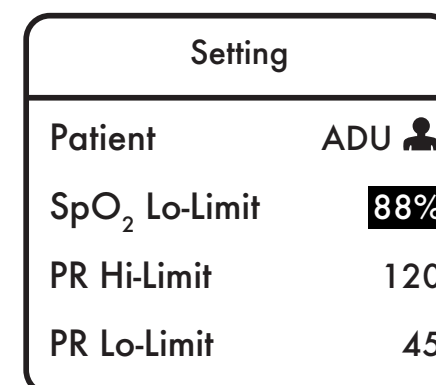


4. Press "Mode/OK" to change default value. A highlight will show on the screen, and use ↑/↓ to adjust to desired threshold value. (see pg. 13 in user manual for more details).

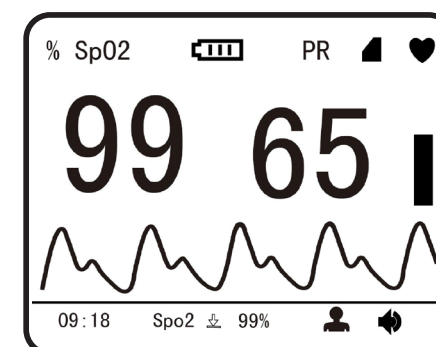

5. Once confirmed, press "Mode/OK" to save change and (power/back) to exit from alarm setting.

## 6. Mute Beeping Sound

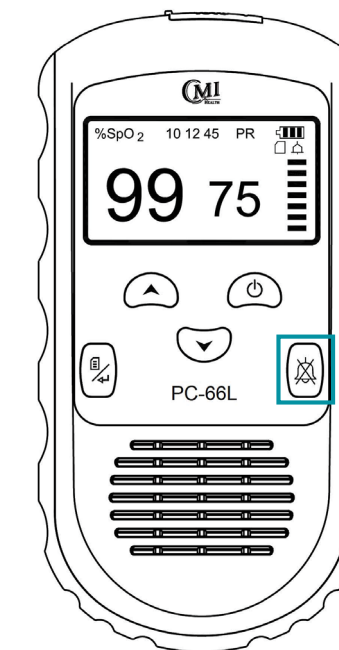

- Short press the mute button to mute the beeping sound.
- Alarm sound will go off if measurement is out of limit or sensor fell off. You can adjust the alarm thresholds based on your need.

\*Please be aware that the mute function would be overwritten by alarm onset or power off. Short press the mute button again if either situation occurs.