


**2014 - 2022 RAM 2500,  
2013 - 2022 RAM 3500,  
AND  
2014 - 2022 POWER WAGON**



**LEFT FRONT  
SPECIFIED RANGE**

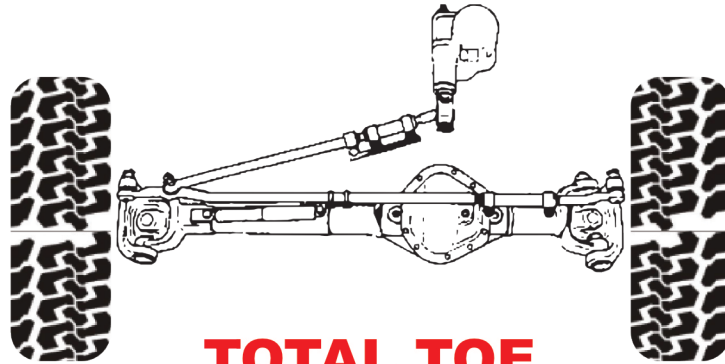

**CAMBER \*\***

**Read below**

**CASTER**

**2.40\* to 3.80\***

**TOE**

**-0.05\* to 0.05\***

**RIGHT FRONT  
SPECIFIED RANGE**



**CAMBER \*\***

**Read below**

**CASTER**

**3.40\* to 4.80\***

**TOE**

**-0.05\* to 0.05\***

**TOTAL TOE**

**0.00\* to 0.05\***

1. Front TOTAL-TOE must be in this range no questions, and not just "close." This is the most critical detail to get right.
2. IMPORTANT!! Caster cams must remain one mark or less mirrored/equal, when comparing driver and passenger side.
3. If the above important Cam note is not followed, the truck will have a heavy chassis lean, so closer to equal the better.
4. If you do need a bit of bias in the cams, be sure to loosen the upper radius arm to axle bolts, too, to help prevent lean.
5. Correct/high bolt torque to the axle is critical. The 4 radius arm to axle bolts must be 225ft/lbs or you will get popping.
6. Rear axle is not adjustable. Just make sure nothing indicates the rear axle is heavily out of alignment.
7. Front Caster not in the noted range is not a huge problem, as long as the truck drives good. Just get as close as possible.
8. If you have a lighter gas engine, stay to the higher end of the caster specs.
9. If you have a heavier Diesel engine, stay to the lower end of the caster specs.
10. If your wheel combo sticks out heavy past the fenders(less positive offset), stay to the lower end of the Caster specs.
11. If you are running stock or more tucked in wheels(high positive offset), stay to the higher end of the Caster specs.
12. \*\*Camber is not adjustable. If you have heavy visible Negative Camber(tops of tires leaned in), your axle is probably bent.
13. Extra positive Caster is welded into the right(passenger) side knuckle, and can not be adjusted out. This is intentional.
14. Do not use offset ball joints, as they are very weak, and are not needed.
15. Axial(Up and down) play in the ball joints, up to about 1/16" or .060", is totally normal.
16. Radial(side to side) play should be very very minimal. If there is easily detectable radial play, your ball joints are bad.