

NOTE: This installation is to be completed by an Authorized Dealer or Professional Service Technician. For questions regarding installation or warranty, call CDI Tech Support at 866-423-4832. **Do not return to the Dealer or Distributor where the part was purchased. Contact CDI Electronics Directly for Return Material Authorization.**



## CDI P/N: 133-3378 Timer Base 3 Cyl.

**Note: This unit replaces P/N's: 581949, 582724, 583060, 583131, 583378, 584269 and 584562.**

**WARNING!** This product is designed to be installed by a professional marine mechanic. CDI Electronics cannot be held liable for injury or damage resulting from improper installation, abuse, neglect or misuse of this product.

### Installation

1. Disconnect the Negative battery cable.
2. Disconnect the old Timer Base.
3. Remove the flywheel, stator and old Timer Base.
4. Lubricate the inside area of the new Timer Base where the White slip ring goes and the area where the inside of the new Timer Base contacts the upper bearing carrier.
5. Install the White slip ring on the new Timer Base.
6. Compress the White slip ring and seat the new Timer Base into the bearing carrier.
7. Make sure the Timer Base is fully seated and secure the slip ring using the retainers removed during disassembly.
8. If the 4 pin connectors pin out pattern matches the pattern of the old Timer Base, connect the timer Base to the CD Modules. If the old Timer Base has the semi-circle pattern, remove the 4 pin rubber connectors from the new Timer Base and insert the pins into the 4 pin connectors supplied with the new Timer Base as shown below, matching wires colors when possible:

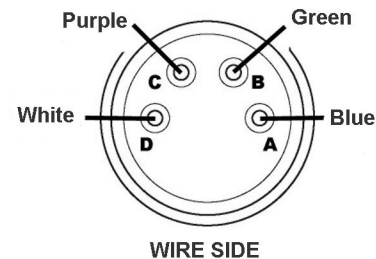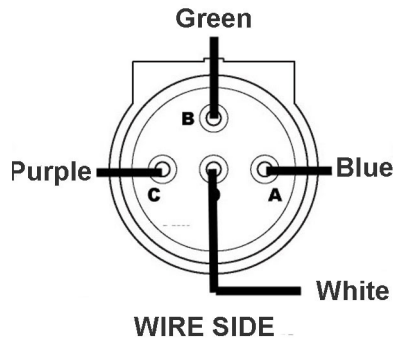

9. Remove the bushing link kit from the old Timer Base link arm and install it in the new Timer Base arm.
10. Connect the linkage to the new Timer Base.
11. Re-install the Stator and Flywheel according to the Service Manual.
12. Start and run the engine, adjusting the ignition timing according to the Service Manual.

### TROUBLESHOOTING THE TIMER BASE

#### NO FIRE ON 1 CYLINDER:

1. Disconnect the Timer Base connector and check the resistance from the White to the Green, Purple and Blue wires. The reading should be approximately 11 ohms to each wire.
2. Disconnect the Timer Base connector and check to see if the pins have gotten pushed back either in the pack connector or the new Timer Base.
3. Remove the pins from the connectors and see if a pin is broken on the pack or the new Timer Base.
4. Check the DVA voltage from the White to the Green, Purple and Blue wires. You should have at least 0.5 volts.
5. Check the DVA voltage from the Brown to the Brown/Yellow Stator wire. You should have at least 150 volts.
6. Swap the power packs side to side and verify the problem stays on the same side.