

Universal Panel Meter

Accepts 10 Different Thermocouple Inputs, RTD's and other Sensors

Alarm Relay Output Included

1/8 DIN Size

Panel Cut Out
3.63" W x 1.74" H
(92 mm x 44 mm)



Front Control/Display Panel
3.64" Wide x 1.78" High
Overall Unit Depth 3.58"
(92 mm x 45 mm x 91 mm)

Universal Power Supply
for Global Utilization
18-265V AC/DC


evolution
Sensors and Controls, LLC.



Quick Start Guide DPM-UNV1-18X-A1X


evosensors.com

1. Front view

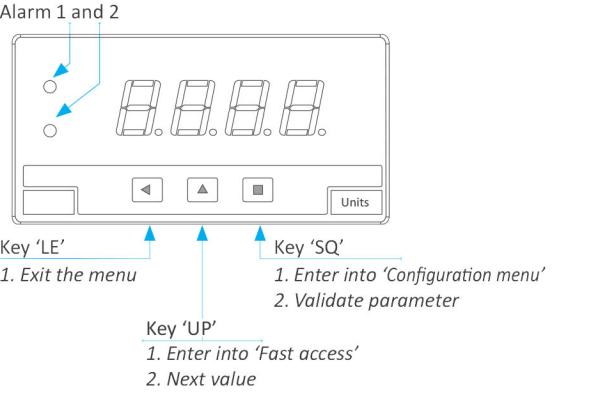

- Alarm 1 and 2
- Key 'LE'
- Key 'UP'
- Key 'SQ'
- Power: 18/265 Vac/dc (isolated)
- Vexc, Pt100 3 wires, pot+ external control
- neutral, 0 V, common
- ~5 Aac, ±5 Adc
- ~Vac, ±Vdc, resistance, mA, pot thermocouple+, Pt+, Ni+, PTC+, NTC+
- ~600 Vac, ~200 Vac ±600 Vdc, ±200 Vdc
- Protection fuse value:
250 mA time-lag for power voltage > 50 Vac/dc
400 mA time-lag for power voltage < 50 Vac/dc

2. Dimensions and panel cut-out (mm)

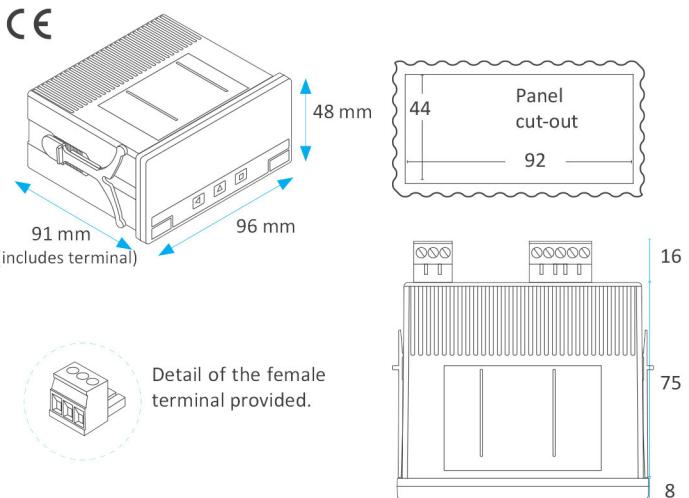

Detail of the female terminal provided.

3. Additional documentation


<https://evosensors.com/products/universal-panel-meter-for-thermocouples-rtds-and-sensors-with-a-voltage-current-or-resistance-signal-outputs>

5. Installation and start-up

- Open the instrument (see section 7).
- Select the jumpers for the desired signal range (see section 8).
- Close the instrument (see section 7).
- Connect the signal and the power (see section 6).
- Configure the instrument from the 'Configuration menu' (see section 9).
- If you need additional information see section 3



6. Connections

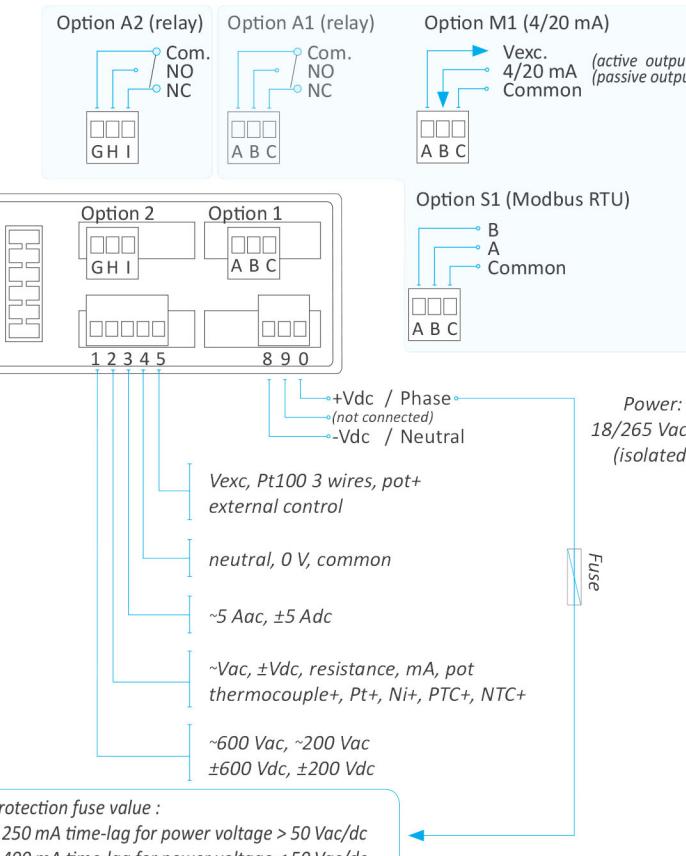


7. How to open the instrument

Use a flat screwdriver to unlock clips 'D', 'C', 'B' and 'A', in this order. Remove the front filter. Gently let the internal boards slide out of the instrument.

To reinsert the boards in the housing :

- make sure that the boards are correctly connected to the displays pins
- slide the boards into the housing guides
- place the front filter at corner X, and then insert clips 'A', 'B', 'C' and 'D' in this order.

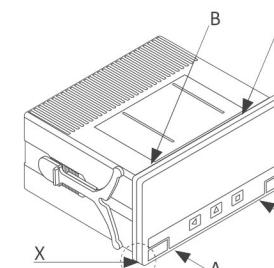

Risk of electric shock. Removing the front cover will grant access to internal circuits which may be at dangerous voltage. Disconnect the input signal and the power supply to prevent electric shock to the operator. Operation must be performed by qualified personnel only.

4. How to order


1. Visit the Evolution Sensors website evosensors.com

2. Search part number DPM-UNV1-18X-A1X

3. Email us at info@evosensors.com

4. Call us at 856 579-7490

8. Internal structure and jumpers for range selection

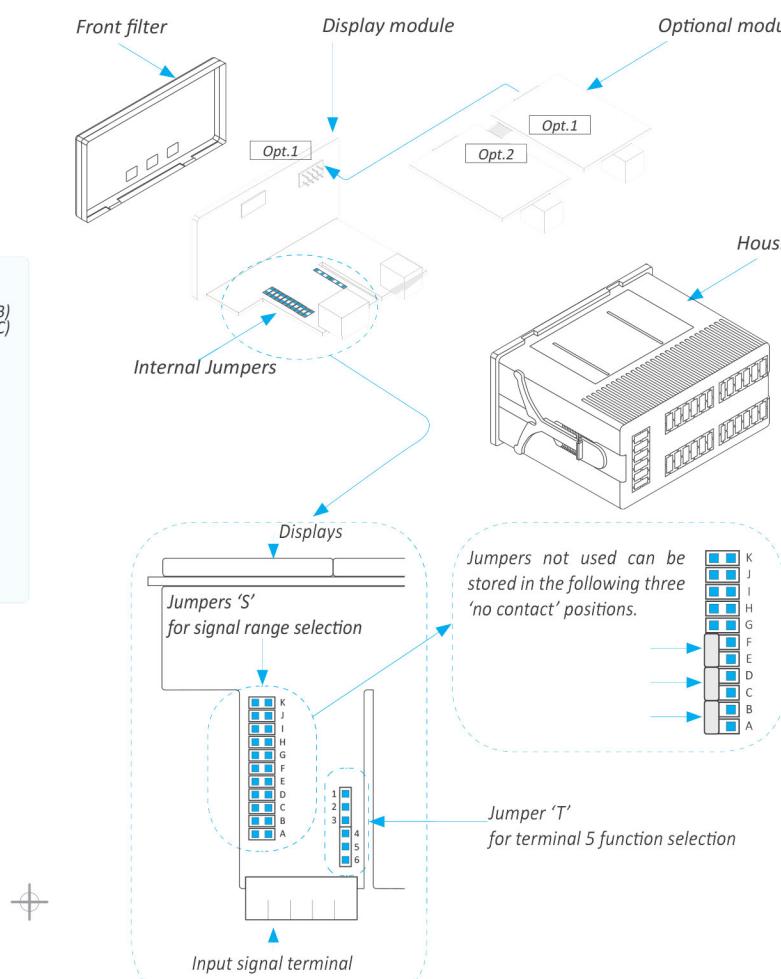

AC ranges	Scalable	Jumpers 'S'	Jumpers 'T'	Accuracy (% FS)
~600 Vac	from 9999 to -1999	G I	4-5	<0.30 % (up to 150 Hz)
~200 Vac		I		
~20 Vac		A I		
~2 Vac		B I		
~200 mVac		C I		
~60 mVac		E I		
~5 Aac		I		
~20 mAac		D I		

DC ranges	Scalable	Jumpers 'S'	Jumpers 'T'	Accuracy (% FS)
±600 Vdc	from 9999 to -1999	G	4-5	<0.20 %
±200 Vdc		---		
±20 Vdc		A		
±2 Vdc		B		
±200 mVdc		C		
±60 mVdc		E		
±5 Adc		---		
±20 mAdc		D		

Resistance ranges	Scalable	Jumpers 'S'	Jumpers 'T'	Accuracy (% reading)
0 to 5 K	from 9999 to -1999	F H K	4-5	<1.5 % of reading
0 to 50 K		F K		

Thermocouples	Jumpers 'S'	Jumper 'T'	Range in °C (in °F)	Total error (cold junction included)
tc. K	E	-100 / 1350 °C (-148 / 2462 °F)		
tc. J		-100 / 1200 °C (-148 / 2192 °F)		
tc. E		-100 / 1000 °C (-148 / 1832 °F)		
tc. N		-100 / 1300 °C (-148 / 2372 °F)		
tc. L		-100 / 900 °C (-148 / 1652 °F)		<3 °
tc. R	E J	0 / 1768 °C (32 / 3214 °F)		
tc. S		0 / 1768 °C (32 / 3214 °F)		
tc. T		-100 / 400 °C (-148 / 752 °F)		
tc. C	E	0 / 2300 °C (32 / 4172 °F)		<5 °
tc. B	E J	700 / 1820 °C (1292 / 3308 °F)		

Pt and Ni probes	Jumpers 'S'	Jumper 'T'	Range in °C (in °F)	Total error Current at sensor
Pt100 (3 wires)	F H J	4-5	-200 / 700 °C (-328 / 1292 °F)	<900 uA
Pt100 (2 wires)	F H		-200 / 700 °C (-328 / 1292 °F)	<900 uA
Pt500	F		-150 / 630 °C (-238 / 1166 °F)	<90 uA
Pt1000	F		-190 / 630 °C (-310 / 1166 °F)	<90 uA
Ni100	F H		-60 / 180 °C (-76 / 356 °F)	<900 uA
Ni200	F H		-60 / 120 °C (-76 / 248 °F)	<900 uA
Ni1000	F		-60 / 180 °C (-76 / 356 °F)	<90 uA

Process signals	Scalable	Jumpers 'S'	Jumper 'T'	Accuracy (% FS)
4/20 mA	from 9999 to -1999	D	1-2*	<0.15 %
0/10 Vdc		A		

* Place jumper 'T' at position 1-2 for +15 Vdc excitation voltage at terminal 5. Optionally, place jumper 'T' at position 4-5 to work with 'external contact' at terminal 5.

Potentiometers nominal value	Scalable	Jumpers 'S'	Jumper 'T'	Accuracy (% FS)
500 R to 20 K	from 9999 to -1999	A	2-3	<0.5 %

Frequency	Scalable	Jumpers 'S'	Jumper 'T'	Accuracy (% reading)
15 Hz to 100 Hz	from 9999 to -1999	select Vac or Aac range	4-5	<0.15% of reading



PTC probes Family	Jumpers 'S'	Jumper 'T'	Range in °C (in °F)	Total error
KTY-121	F	4-5	-55 / 150 °C (-67 / 302 °F)	<1 °
KTY-210	F H K			
KTY-220	F H K			

NTC probes 'R ₂₅ ' (configurable)*	Jumpers 'S'	Jumper 'T'	Range of measure	Accuracy (% of reading)	Beta (configurable)*
10K	F K	4-5	-60 °C to 150 °C	<1.5 % of reading	3500

*Beta configurable (20

9. Configuration menu

Press 'SQ' (■) for 1 second to access the 'Configuration menu'.

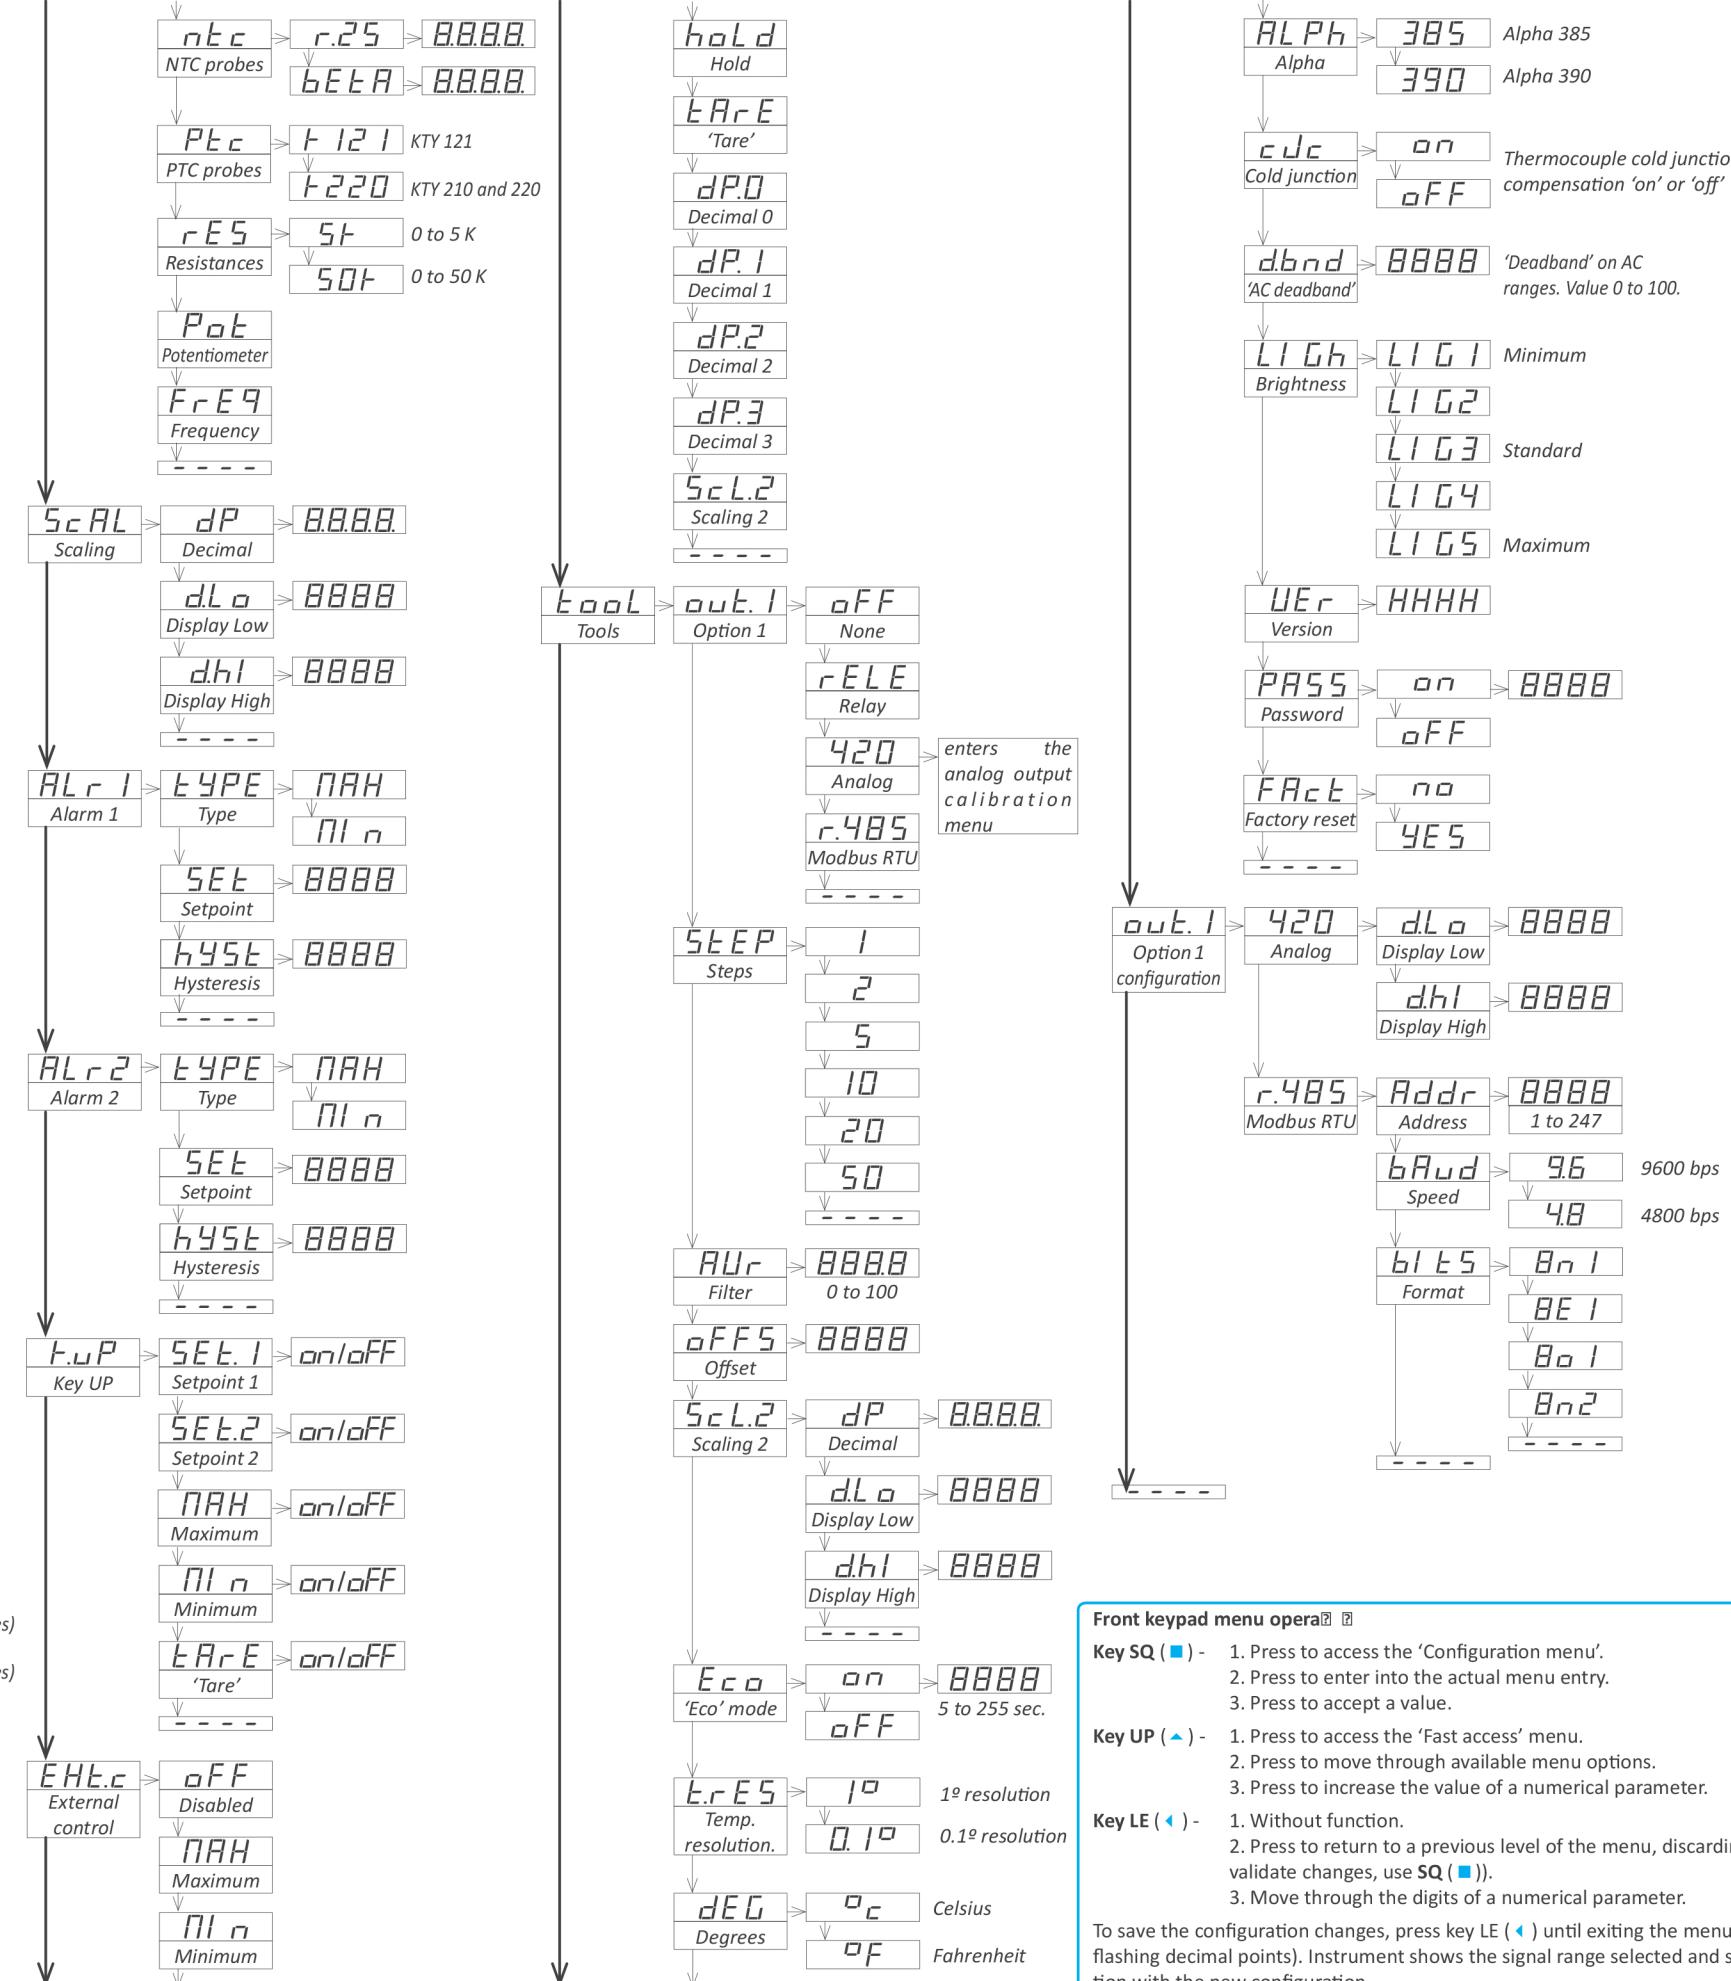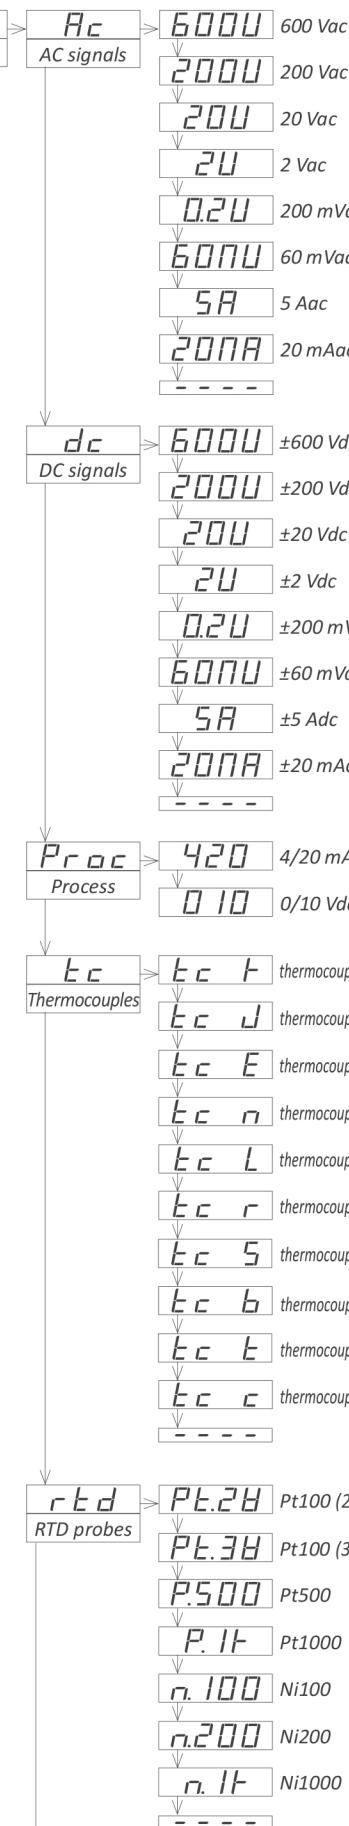

Front keypad menu opera

- Key SQ (■)** -
1. Press to access the 'Configuration menu'.
2. Press to enter into the actual menu entry.
3. Press to accept a value.
- Key UP (▲)** -
1. Press to access the 'Fast access' menu.
2. Press to move through available menu options.
3. Press to increase the value of a numerical parameter.
- Key LE (◀)** -
1. Without function.
2. Press to return to a previous level of the menu, discarding changes (to validate changes, use **SQ (■)**).
3. Move through the digits of a numerical parameter.
- To save the configuration changes, press key LE (◀) until exiting the menu (shown by flashing decimal points). Instrument shows the signal range selected and starts operation with the new configuration.

10. Regulations

This instrument conforms to the actual CE regulations. For a copy of the 'CE declaration of conformity' see section 3. Applicable regulations are:

Security regulation 'Ex' equipment, 'Permanently connected'. 'Double' isolation. Category of measure 600V CAT-II, 300V CAT-III)

Electromagnetic

This instrument does not provide a general mains switch and will start operation as soon as power is connected. The instrument does not provide protection fuse, and the fuse must be added during installation.



Risk of electrical shock. Instrument terminals can be connected to dangerous voltage.



Instrument protected with double isolation. No earth connection required.



Instrument conforms to CE rules and regulations.



According to directive 2012/19/EU, electronic equipment must be recycled in a selective and controlled way at the end of its useful life.

11. Factory configuration

Range, scaling and decimal point	0/600 Vac = 0/600 as maximum
Alarm 1	1000
Setpoint	0 counts
Hysteresis	as maximum
Alarm 2	1000
Setpoint	0 counts
Hysteresis	off
External control	all off
Fast access	off (retains last configuration value)
Tools	
Option 1	1
Step	0
Average	0
Manual offset	0/600
Second scaling	off
'Eco' mode	1°
Temperature resolution	1°
Degrees	°C
Alpha	385
cJC	on
AC 'deadband'	20
Luminosity	3
Password	off
Option	
Analog output	0/100.0=4/20 mA
Serial Modbus RTU	9600 bps, address 1, format 8n1
Jumpers 'S'	range for 600 Vac
Jumper 'T'	external contact 'EK' function

12. User's manual



<https://evosensors.com/products/universal-panel-meter-for-thermocouples-rtds-and-sensors-with-a-voltage-current-or-resistance-signal-outputs>