


® Chester, Ct. 06412-0684 Tel: 860-526-9504

www.whelen.com

#### **HS-30 Installation and Cable Package:**

- (1) 30' 50635 Cable, one end with Sockets 61117-1 & Connectors 1-480303-0 installed.
- (4) Pins 61118-1 & (1) Connector 1-480305-0 in Small Bag for Field Installation.
- (1) A421 & (1) A421-1 Pilot's Warning Placards.
- (1) A438 Lens Masking Strip.
- (1) A445 Switch Label.

To view information about our Products, Installation Guides. Installation and Service Manual, Trouble Shooting Procedure for Strobe Light Systems, Technical Support, System Recommendations, PMA Supplements, STC's and illustrated Spare Parts Catalog visit www.whelen.com or contact our aviation sales dept. at (860) 526-9504.

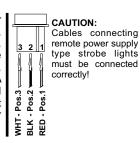

©1998 Whelen Engineering Company, Form No.13297B (062910)

**HS-30 Installation and Cable Package:** 

(1) 30' 50635 Cable, one end with Sockets 61117-1 &

(4) Pins 61118-1 & (1) Connector 1-480305-0 in Small


(1) A421 & (1) A421-1 Pilot's Warning Placards.

® Chester, Ct. 06412-0684 Tel: 860-526-9504 www.whelen.com

### **HS-30 Installation and Cable Package:**

- (1) 30' 50635 Cable, one end with Sockets 61117-1 & Connectors 1-480303-0 installed.
- (4) Pins 61118-1 & (1) Connector 1-480305-0 in Small Bag for Field Installation.
- (1) A421 & (1) A421-1 Pilot's Warning Placards.
- (1) A438 Lens Masking Strip.
- (1) A445 Switch Label.

To view information about our Products. Installation Guides. Installation and Service Manual, Trouble Shooting Procedure for Strobe Light Systems, Technical Support, System Recommendations, PMA Supplements, STC's and illustrated Spare Parts Catalog visit www.whelen.com or contact our aviation sales dept. at (860) 526-9504.

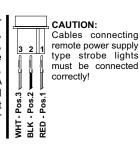


©1998 Whelen Engineering Company, Form No.13297B (062910)

® Chester, Ct. 06412-0684 Tel: 860-526-9504 www.whelen.com

#### **HS-30 Installation and Cable Package:**

- (1) 30' 50635 Cable, one end with Sockets 61117-1 & Connectors 1-480303-0 installed.
- (4) Pins 61118-1 & (1) Connector 1-480305-0 in Small Bag for Field Installation.
- (1) A421 & (1) A421-1 Pilot's Warning Placards.
- (1) A438 Lens Masking Strip.
- (1) A445 Switch Label.

To view information about our Products. Installation Guides. Installation and Service Manual, Trouble Shooting Procedure for Strobe Light Systems, Technical Support, System Recommendations, PMA Supplements, STC's and illustrated Spare Parts Catalog visit www.whelen.com or contact our aviation sales dept. at (860) 526-9504.

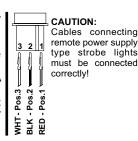

©1998 Whelen Engineering Company, Form No.13297B (062910)



Connectors 1-480303-0 installed.

Bag for Field Installation.

(1) A445 Switch Label.

(1) A438 Lens Masking Strip.

® Chester, Ct. 06412-0684 Tel: 860-526-9504

# www.whelen.com

® Chester, Ct. 06412-0684 Tel: 860-526-9504 www.whelen.com


## **HS-30 Installation and Cable Package:**

- (1) 30' 50635 Cable, one end with Sockets 61117-1 & Connectors 1-480303-0 installed.
- (4) Pins 61118-1 & (1) Connector 1-480305-0 in Small Bag for Field Installation.
- (1) A421 & (1) A421-1 Pilot's Warning Placards.
- (1) A438 Lens Masking Strip.

(1) A445 Switch Label. To view information about our CAUTION:

CAUTION: Cables connecting remote power supply type strobe lights must be connected correctly!



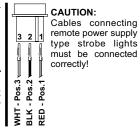


® Chester, Ct. 06412-0684 Tel: 860-526-9504 www.whelen.com

# **HS-30 Installation and Cable Package:**

- (1) 30' 50635 Cable, one end with Sockets 61117-1 & Connectors 1-480303-0 installed.
- (4) Pins 61118-1 & (1) Connector 1-480305-0 in Small Bag for Field Installation.
- (1) A421 & (1) A421-1 Pilot's Warning Placards.
- (1) A438 Lens Masking Strip.
- (1) A445 Switch Label.

To view information about our Products, Installation Guides, Installation and Service Manual, Trouble Shooting Procedure for Strobe Light Systems, Technical Support, System Recommendations, PMA Supplements, STC's and illustrated Spare Parts Catalog visit www.whelen.com or contact our aviation sales dept. at (860) 526-9504.



©1998 Whelen Engineering Company, Form No.13297B (062910) ©1998 Whelen Engineering Company, Form No.13297B (062910) ©1998 Whelen Engineering Company, Form No.13297B (062910)

Installation and Service Manual, Trouble Shooting Procedure for Strobe Light Systems, Technical Support, System Recommendations, PMA Supplements, STC's and illustrated Supplements, STC's and illustrated spare Parts Catalog visit www.whelen.com or contact our www.whelen.com or contact our



