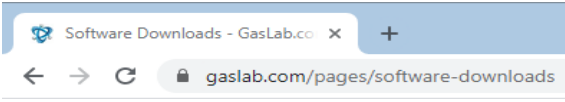
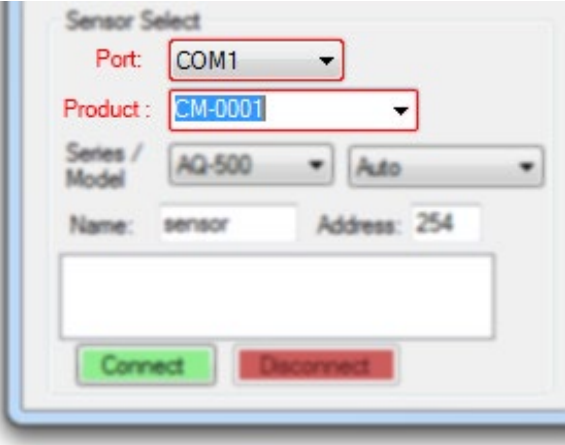
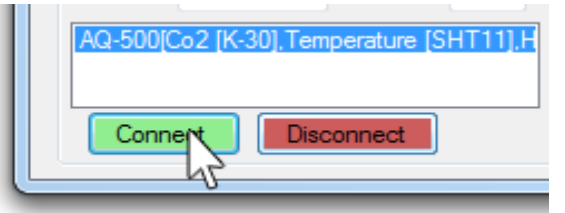
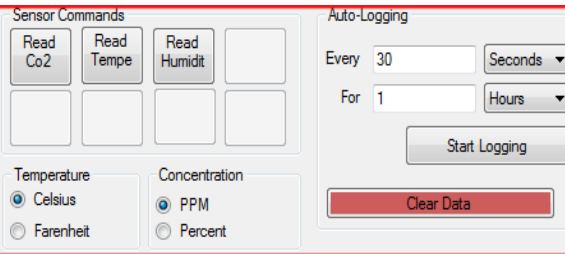


<p>1. Download and install the GasLab software from the CO2Meter.com website at: https://gaslab.com/pages/software-downloads</p>	
<p>2. Exit the GasLab software and unplug the USB Cable.</p>	
<p>3. Start the GasLab software. Select the port dropdown in the lower left corner.</p> <p>4. Plug the USB cable into your PC. A new COM port number should appear.*</p> <p>5. Select the new COM port.</p> <p>6. Select your sensor model from the Product dropdown list.</p>	
<p>7. Click Connect.</p>	
<p>8. Click any enabled "Read" button to take a sensor reading.</p> <p>See the manual for additional options or to begin data logging.</p>	

* Note: If a new COM# port does not appear in step 4:

Windows 7 Computers. Click this link and follow the instructions: https://www.ftdichip.com/Support/Documents/AppNotes/AN_119_FTDI_Drivers_Installation_Guide_for_Windows7.pdf

Windows 10 Computers. Click this link and follow the instructions: https://www.ftdichip.com/Support/Documents/InstallGuides/AN_396%20FTDI%20Drivers%20Installation%20Guide%20for%20Windows%2010.pdf