


ASSEMBLY & INSTALLATION INSTRUCTIONS

A540

Trove Pendant 139860

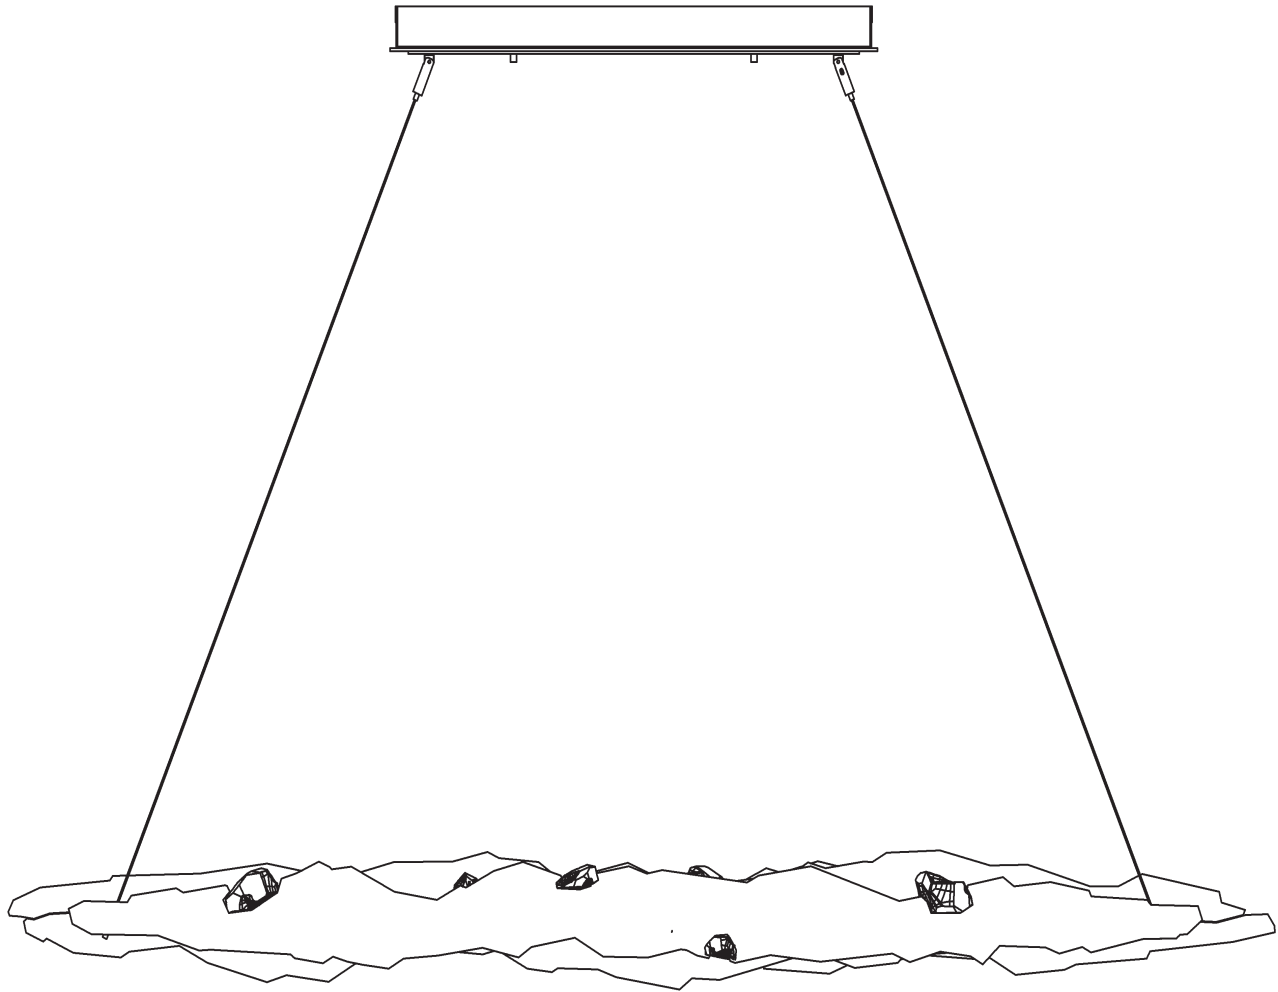

HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

40293 Rev A

1 OF 6

Component Parts

- A Fixture**
- B Mounting Bracket**
- C #10 Screws (4)**
- D Anchors (4)**
- E Safety Cable**
- F Safety Cable Nut**
- G Ground Nut**
- H Cupped Washer**
- I Driver**
- J Canopy**
- K Gripper (4)**
- L Hex Standoff (2)**
- M Knob (2)**
- N Supply/Support Cable (4)**
- O Large Crystals (3)**
- P Small Crystals (7)**
- Q Middle Plate**
- R Spring Clips (7)**
- S Threaded Studs (2)**



Trove Pendant 139860

CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician. This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.*

Install Canopy (Figure 1 - on following page)

CAUTION: BE SURE POWER IS OFF AT THE MAIN BREAKER BOX PRIOR TO INSTALLATION.

1. Carefully unpack the fixture from the carton.
2. Center the mounting bracket (B) over the electric box. With a pencil, mark the location of desired mounting positions on the ceiling. Set aside.
3. Drill 1/4" holes in the locations marked on the ceiling. For holes using anchors (D), place the tapered end of the anchor into the hole and gently tap them flush to the ceiling using a light weight hammer.
4. Thread the wires in the electrical box through the center hole in the mounting bracket (B) while moving the bracket into position. Using two machine screws (not provided), fasten bracket to the electric box.

Note: A new electric box comes with screws. When replacing a fixture, retain the existing screws for use with the new fixture.

5. Using the #10 screws (C), screw the bracket (B) to the ceiling. Be careful not to over-tighten or strip the anchors (D).
6. Raise canopy (J) close to mounting bracket (B). Attach safety cable (E) using safety cable nut (F).

CAUTION: The cable is intended to temporarily suspend canopy while wiring connections are made.

7. Using suitable wire connectors (not provided), connect driver (I) wires to supply wires (white to white and black to black). Run a pigtail lead from the mounting bracket (B) using cupped washer (H) and ground nut (G). Connect all ground wires (bare copper or green to bare copper or green) together.


CAUTION: Make sure wire connectors are twisted on securely, and no bare wires are exposed.

8. Align grippers (K) with holes in canopy (J). Raise canopy and slide over grippers. Be sure no wires are pinched between the canopy and the ceiling.
9. Secure canopy (J) by installing threaded studs (S) into hex standoffs (L) and securing canopy with knobs (M).
10. Follow steps on following pages to complete installation.

ASSEMBLY & INSTALLATION INSTRUCTIONS

A540

Trove Pendant 139860

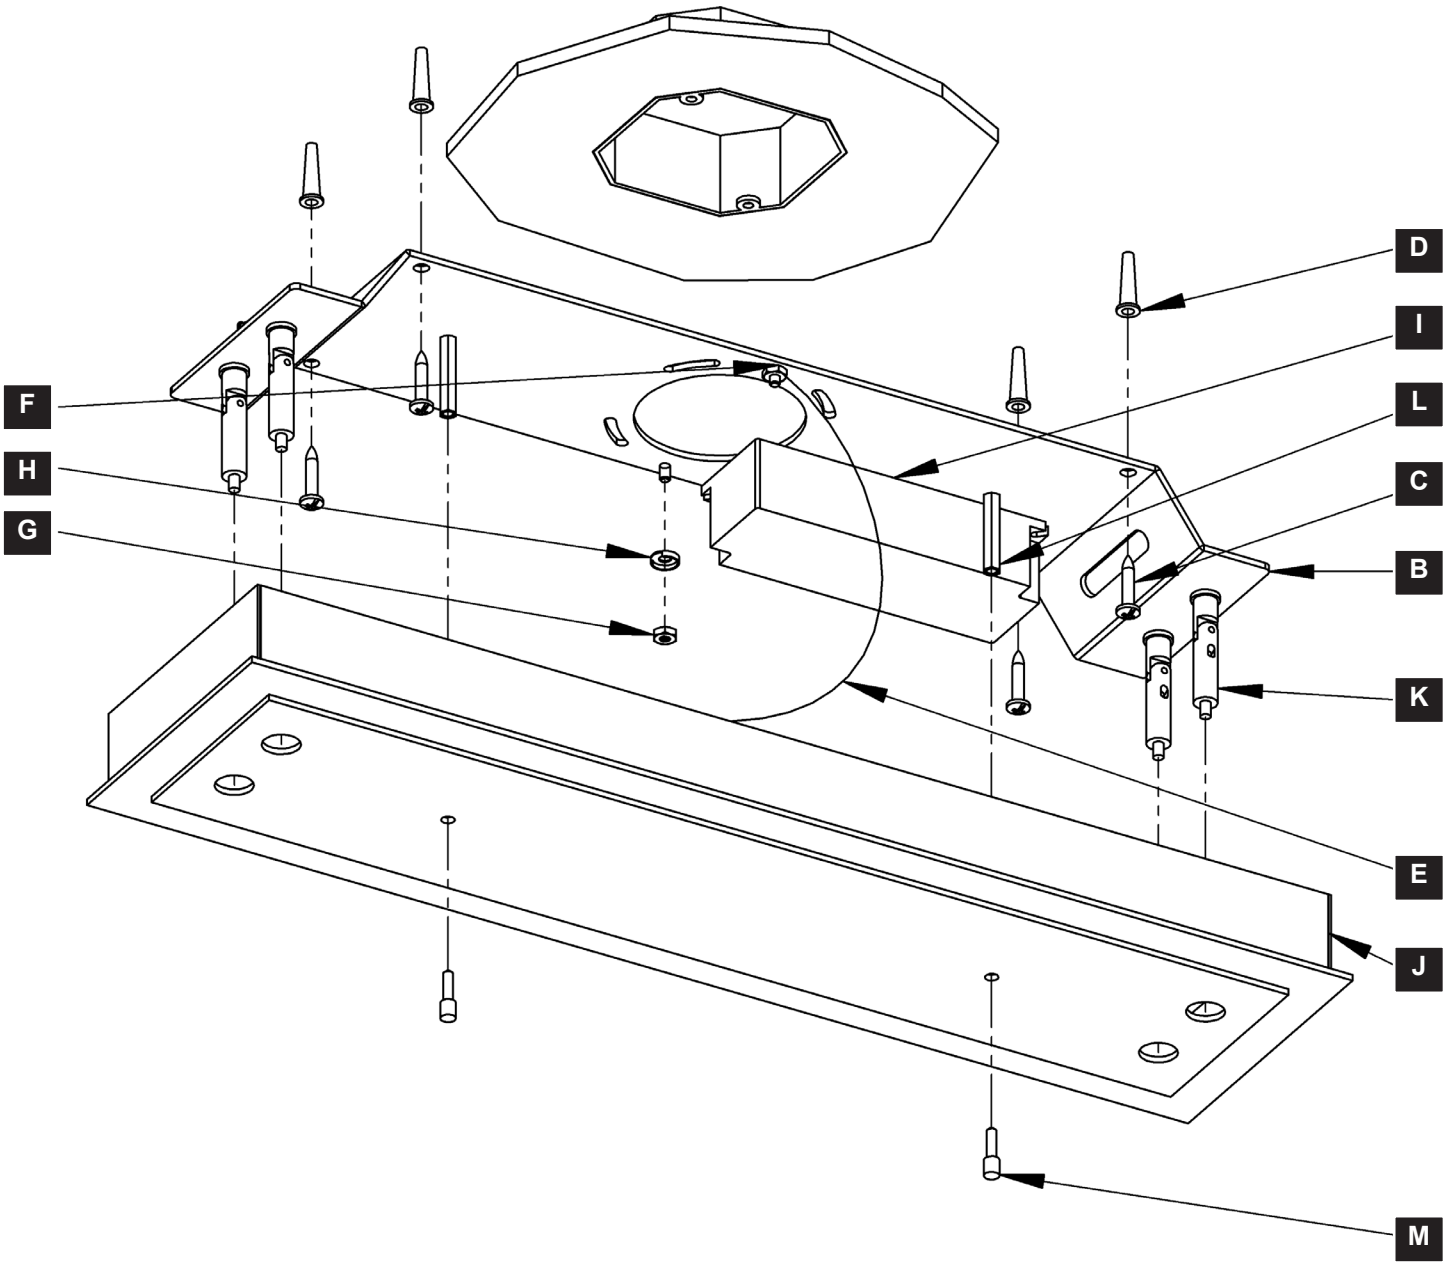

(Figure 1)



HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

40293 Rev A

4 OF 6


Trove Pendant 139860

Install Fixture (Figure 2)

1. Locate the positive (+) and negative (-) labels on the top of the fixture (A).
2. Align the positive (+) and negative (-) labels on the fixture (A) with the positive (+) and negative (-) labels on the grippers (K).
3. Slide a gripper (K) lock, small hole end first, onto supply/support cable (N). Repeat for remaining cables. Locks are shipped in kit bag.
4. Push the supply/support cables (N) from the positive (+) sides of the fixture (A) into the grippers (K) with the positive (+) labels. Push the cables in far enough so that the cables exit the side of the grippers.
5. Repeat Step 3 for the negative (-) supply/support cables (N) & grippers (K).
6. Adjust fixture (A) to the desired height by pressing in the plunger on the grippers (K) and pushing/pulling the supply/support cables (N) as necessary.
7. Once the fixture (A) is at the desired height cut the supply/support cables (N) as close to the notch in the gripper (K) as possible.

Note: Once excess cable is cut, fixture can not be lowered. Besure that no piece of the supply/support cable is touching the fixture.

8. Slide gripper (K) locks up the supply/support cables (N) and thread onto end of gripper to lock adjustment.

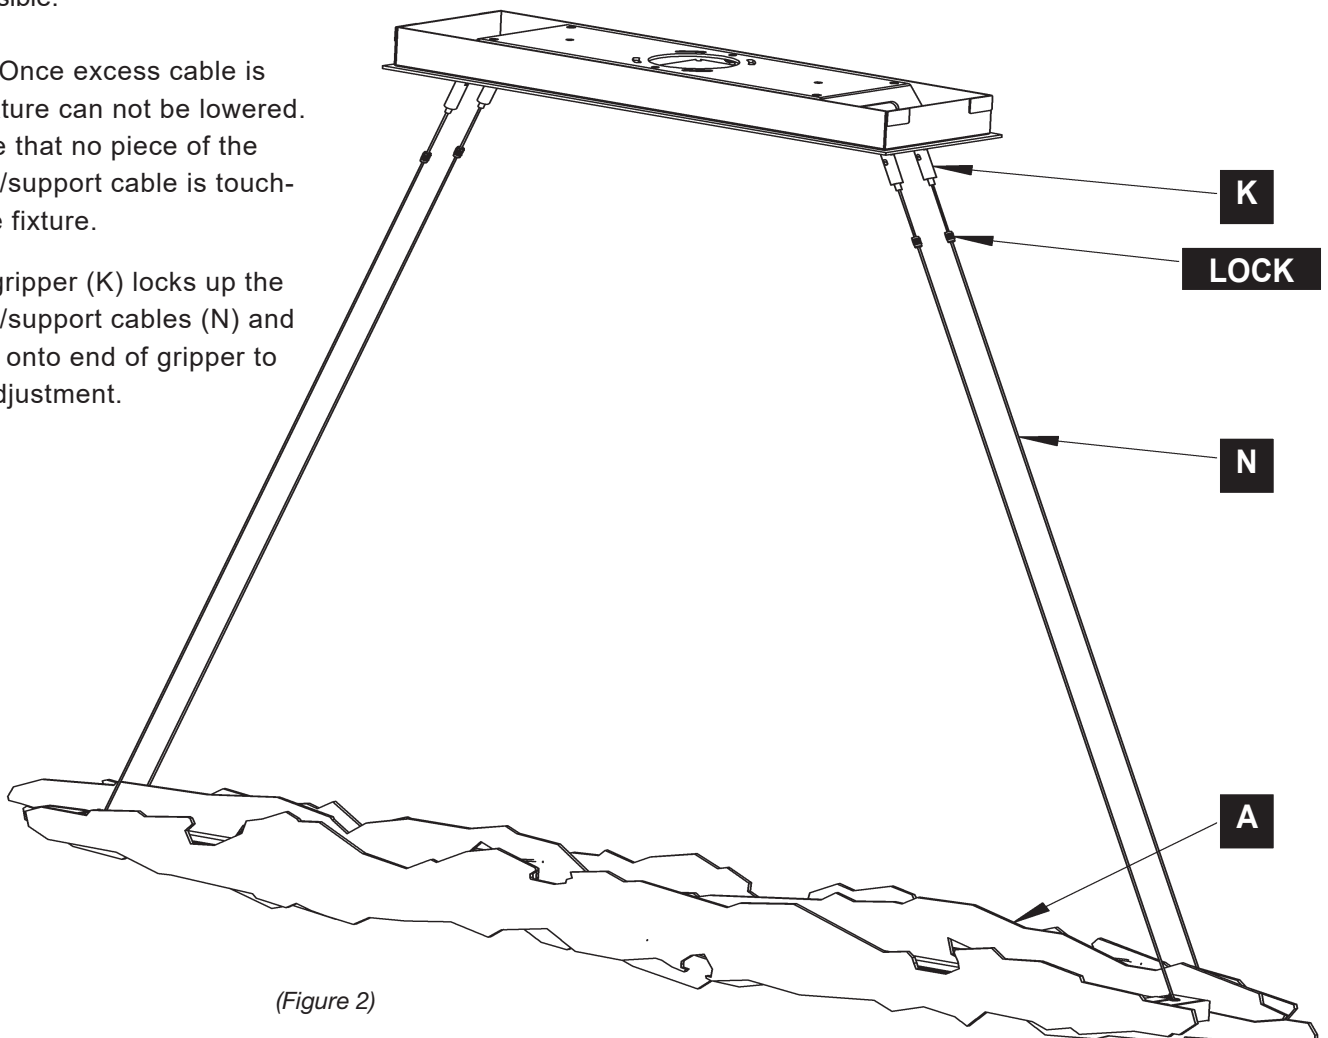

(Figure 2)



HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

40293 Rev A

5 OF 6


ASSEMBLY & INSTALLATION INSTRUCTIONS

A540

Trove Pendant 139860

To Install Crystals (Figures 3 & 4)

1. Locate the large crystals (O), small crystals (P) and white gloves provided in the kit bag.
2. Use the pictures below to see orientation for crystal installation.
3. Figure 3 shows fixture from the top view. All three large crystals (O) are installed on the top side by placing the pointed end of the large crystal (O) through the the slots in the middle plate (Q).
4. Small crystals (P) will use spring clips (R) as shown in Figure 4. Use the slot shapes in the fixture to determine orientation of small crystals (P).
5. Figure 5 shows the fixture from the bottom view. Use Figure 5 and the slots in fixture to install remaining small crystals (P) with spring clips (R).
6. Restore electricity at main breaker.

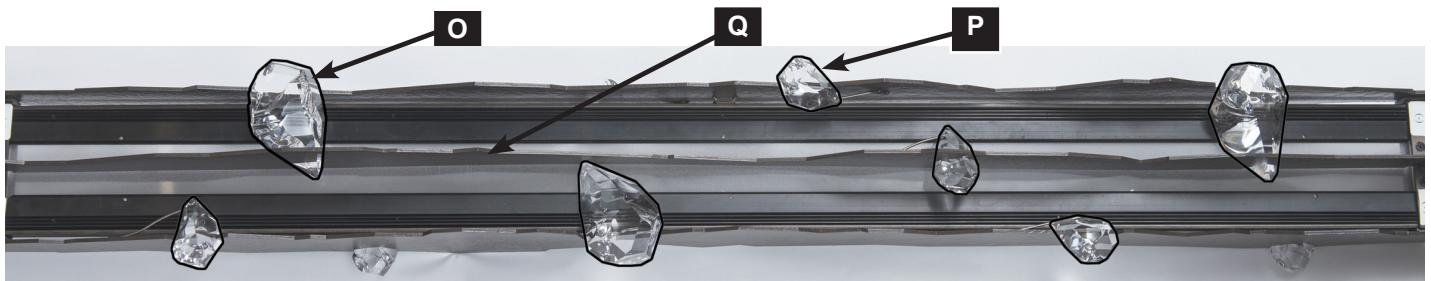

(Figure 3, Top View)



(Figure 4)



(Figure 5, Bottom View)

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!

*** Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.**