

PEAK

# FORGE €

## 3.5MM BATTERY PACK MANUAL



## THE EVOLUTION HAS BEGUN

Peak's first-ever battery packs deliver consistent wireless power to your favorite tattoo machines.



2 PEAK FORGE-C DIAGRAM



3 TECHNICAL SPECIFICATIONS

3 KEY FEATURES

4 HOW TO USE YOUR PEAK FORGE-C

4 PEAK WARRANTY INFORMATION



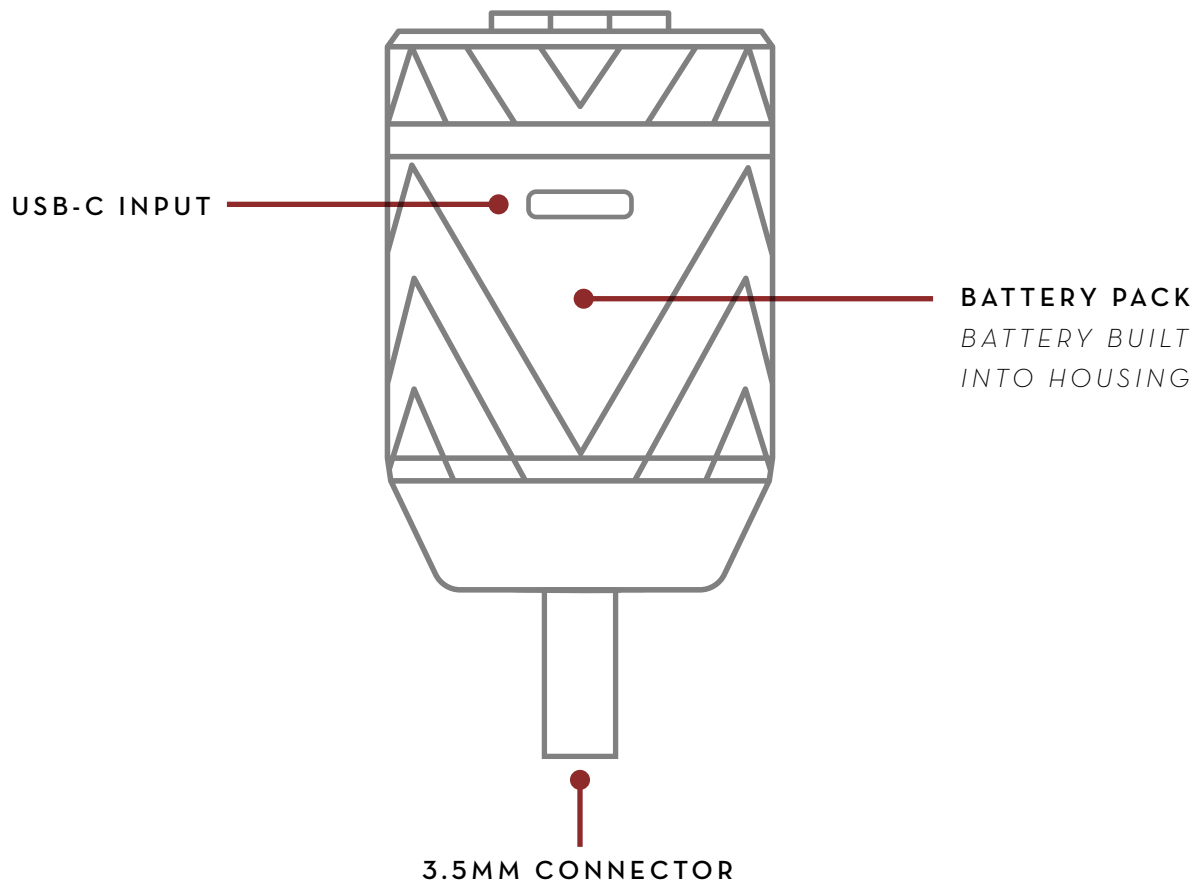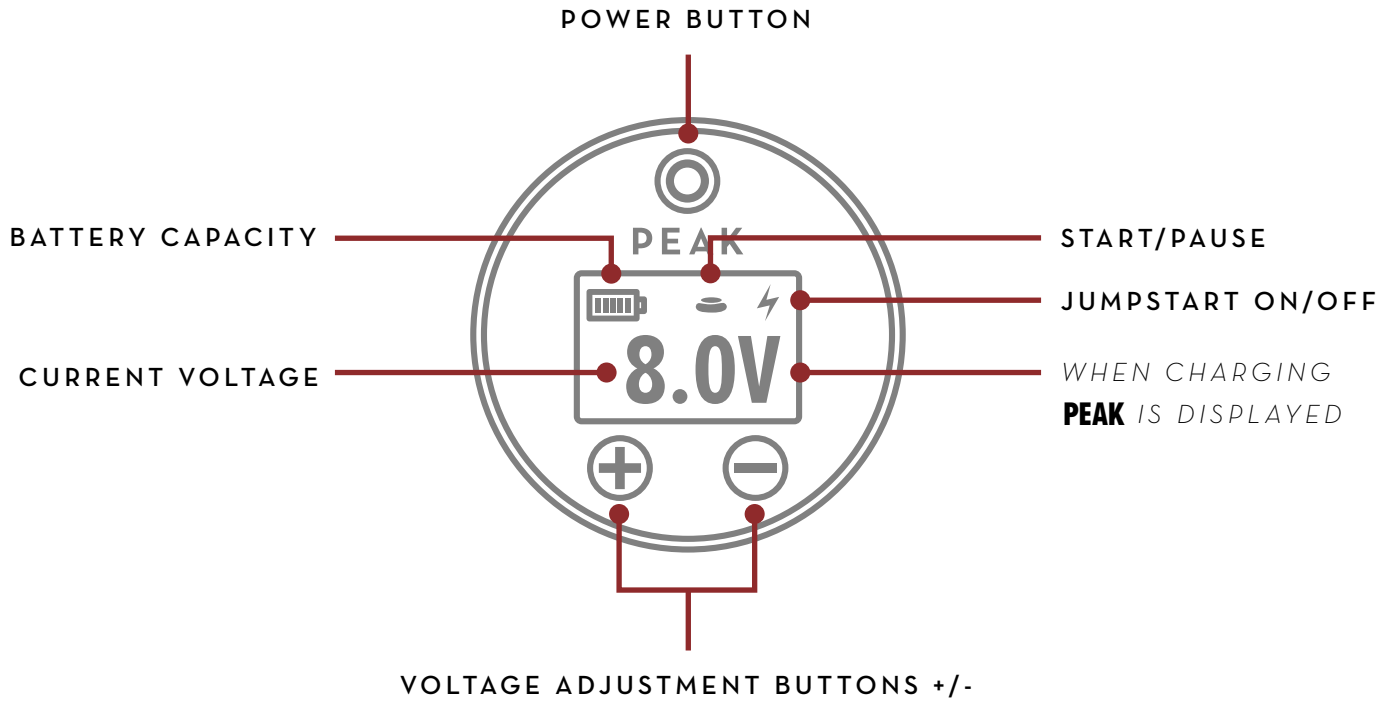

## TECHNICAL SPECIFICATIONS

**Material:** Aluminum

**Size:** 2" (~50mm) height, 1.25" (~32mm) width

**Net Weight:** 64g

**Battery Type:** Li-polymer battery

**Battery Capacity:** 2000mAh

**Operating Voltage:** 4v-12v\*

**Increment/Decrement Voltage Interval:** 0.1v

**Battery Life:** Up to 10 hours when fully charged\*

**Charge Time:** 1.5 hours when used with 2Amp 5v adapter

**Battery Charger:** DC5V/2A (standard USB adapter)

**Battery Charging Cable:** USB-C cable

**Jumpstart Voltage:** 9v in 0.2 seconds

**Package Includes:** (1) battery pack and (1) USB-C charging cable

*\*Some tattoo machines require a minimum voltage to operate correctly. Check your tattoo machine manufacturer's voltage requirements before using with the Peak Forge-C.*

*\*Battery life varies based on (but not limited to) your motor, stroke length, voltage, needle grouping, and pigment thickness.*

## KEY FEATURES

**Battery built into durable aluminum housing**

**Lightweight and compact**

**Automatic jumpstart feature**

**Automatic shut-off if no activity is recorded for 5 minutes**

**Automatic dimming feature if no buttons are pressed for 10 seconds (significantly saves battery capacity)**






**Comes with your choice of RCA connector or 3.5mm connector**

**Comes in black, pink, or red**

---

---

## USING YOUR PEAK FORGE-C BATTERY PACK

- 1 To turn on the Forge-C without the jumpstart feature**, long-press the power button .  
Your machine will start with previously adjusted voltage.
- 2 To turn on the Forge-C with the jumpstart feature**, quickly double press the power button .  
A lightning bolt icon  will appear on your display.
- 3 To start or pause your machine**, press the power button  whenever you want.  
A pedal icon  will appear on your display when your machine is working.
- 4 When you're ready to recharge**, connect your Forge-C to a USB-C charging cable. You will also see your battery capacity.\*

NOTE: \*We highly recommend you charge your Forge-C using a 2Amp 5v adapter for optimal charging time.

## WARRANTY INFORMATION

If you experience any technical issues or your Forge-C battery pack requires repairs, please contact our customer service team at 410-712-0145. After our customer service team provides you with a return authorization, you can download and fill out our **Peak Repair Order Form**:



Mail your completed repair order form, battery pack, and invoice as proof of purchase to 7410 Coca Cola Dr STE 108, Hanover, MD 21076. You can also direct any questions or concerns regarding issues with your Peak Forge-C battery pack to [info@peakneedles.com](mailto:info@peakneedles.com).

If you purchased your Forge-C less than a year ago, we will replace it with a brand new model. If your machine is older than a year, it is unfortunately no longer protected under our one-year warranty.