


# Installation Guide and Support Manual



# GP60NL

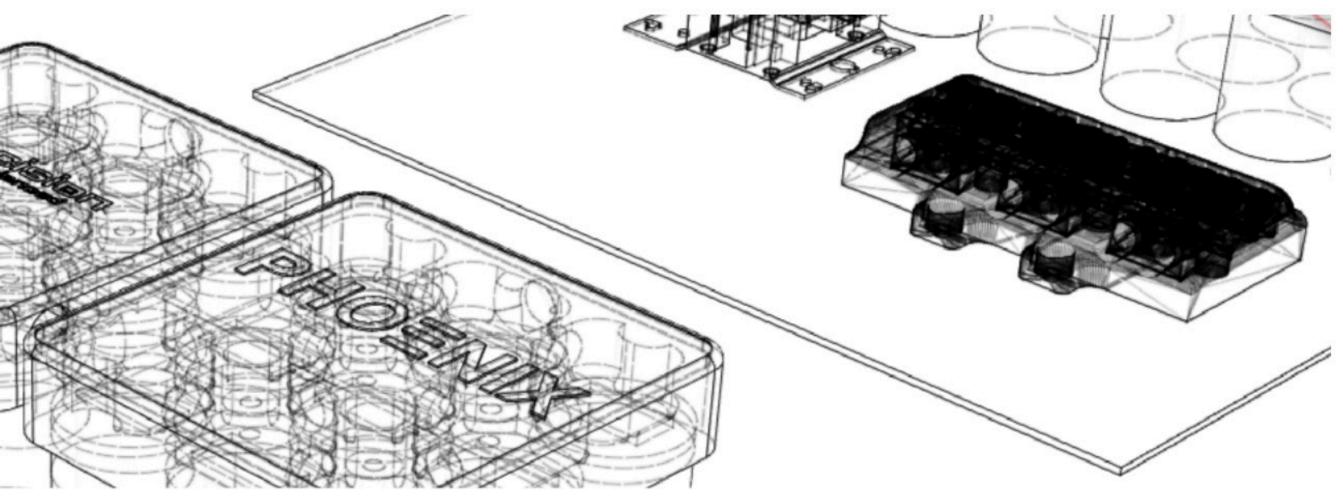

# PHO=NIX**Phase Converters**



### ELECTRICAL SPECIFICATIONS SHEET

### **GENERAL SPECIFICATIONS**

HP 5	60	
ĸw	44.7	
KVA	52.05	
HZ	50/60	
ENCL	TEFC/NEMA 4	
FRAME	364T	
IDLER WEIGHT	782	
PANEL WEIGHT	78	

OLTAGE INPUT	208-250V
MOTOR LOAD BREAKER Minimum Size	120
MOTOR LOAD BREAKER Maximum Size	300
SERVICE KVA Minimum Size	75
SERVICE AMPS Minimum Size	312
COPPER WIRE Minimum Size	1

### CONSTRUCTION, DIMENSIONS, WEIGHT ELECTRICAL PANEL NEMA 4 ENCLOSURE TYPE ENCLOSURE UL 508A (CSA C22.2 No. 14-13.), TUV, CE. CERTIFICATIONS COLOR Light Gray 24 HEIGHT 24 WIDTH DEPT 8 WALL MOUNTING

VOLTAGE OUTPUT	208-230 Volts Delta
MAX OUTPUT INDUCTIVE LOAD AMPS	160
MAX OUTPUT RESISTIVE LOAD AMPS	84
VOLTAGE BALANCING	+/- 2%
WIRE SIZE MIN Idler/Generator	1/0
LARGEST SPINDLE MOTOR START	30
LARGEST COMPRESSOR LOAD START	24
TOTAL COMBINED HORSEPOWER RUN	60

### **Optional Feature**

- 208, 460 Volt Output (includes transformer)
- AutoStart and AutoOff with load detection
- PL Model (includes Start and Stop with Built-in Mag Starter)
  GPX Model (includes WFI Cloud Controls, Timers, Energy Monitor)
- Wireless Remote ON/OFF

**GP60** 

NOTES

PHOENIX PHASE CONVERTERS

800-417-6568



# **READ INSTRUCTIONS BEFORE OPERATING**

# **READ FIRST - BEFORE** INSTALLATION

- Most important step to know.
- NEVER Start the phase converter with a load, this includes transformers.
- Make sure you have the incoming service to start the phase converter, call your electric company verify the KVA size of the transformer, that KVA number should be larger then the HP of the idler motor.
- DO NOT use WIRE NUTS for any connection, use the bolt down lugs. Check all make sure all connections even factory connections to the power block are secure, also recheck connections after a few week of using the converter.
- When powering up the unit, if the idler does **NOT** come up to **FULL SPEED**, then shut the phase converter down right away. If you don't understand then call us or a qualified electrician. if you do not turn the unit **off** you have a chance to damage the idler motor that will **not be** covered under warranty.
- Must be installed by a license industrial electrician, our guidelines are not to supersede local and state laws.











# **Power requirements**

- You will need to use a **motor load** type breaker. NOT a quick blow or trip breaker.
- Sizing a breaker for a single machine with an inductive load (motors) double the amps size of the machine. Example if the equipment pulls 20 amps use a 40 amp breaker.
- Sizing the equipment for multiple machine double the amp of the largest machine and add the the other machine that will run at the same time. Example; 20 AMP Lathe. 9 amp saw, 6 amp milling machine.  $20 \times 2 = 40 + 9 + 6 = 45$  amps, use the next standard size breaker which would be 50 Amps two pole breaker.
- Use the chart to make sure you don't go over or under the Minimum and maximum size allowed. For rural areas increase the minimum size breaker by 20% Click on the next picture to see this chart.

# 


## **WIRE AND BREAKER SIZES**

SINGLE PHASE	3/0 AWG Copper under 50 feet
IDLER MOTOR	1 AWG COPPER
BREAKER/FUSE	100 MIN / 300 MAX



## **Mounting the Phase Converter Panel**

Mount the enclosure first, to a non-vibrating surface, there are two options provided for mounting, next install the back plate with the four nuts provided. Mounting the phase converter panel near the breaker panel is recommended the larger wire is you single phase line, that is best to keep as short as possible. Every 50 feet you will need to increase the size of the single phase wire.

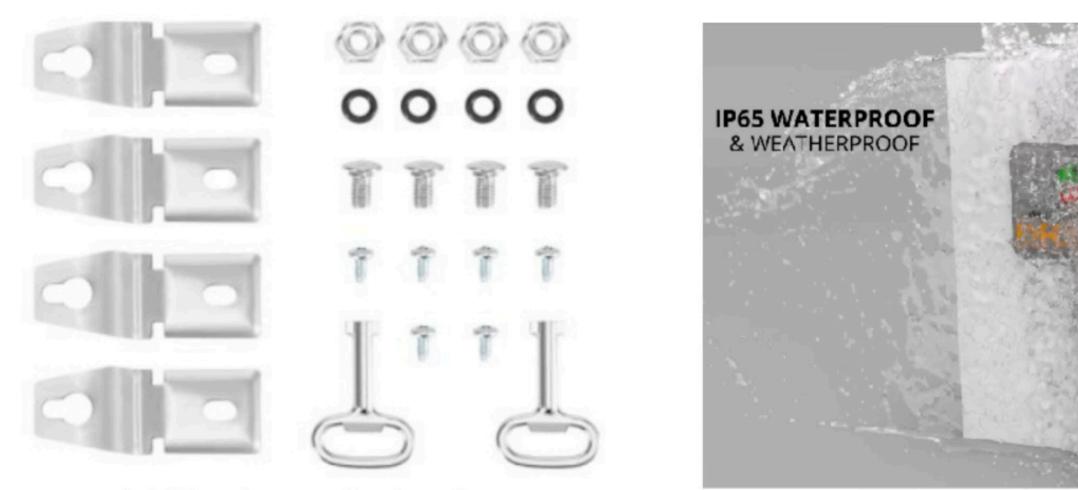

Additional mounting brackets and hardware are inside the enclosure.

Indoor or outdoor enclosure











## **CONNECTING THE IDLER MOTOR WIRES**


### **IF YOU HAVE 9 LEADS AT THE MOTOR CLICK HERE**

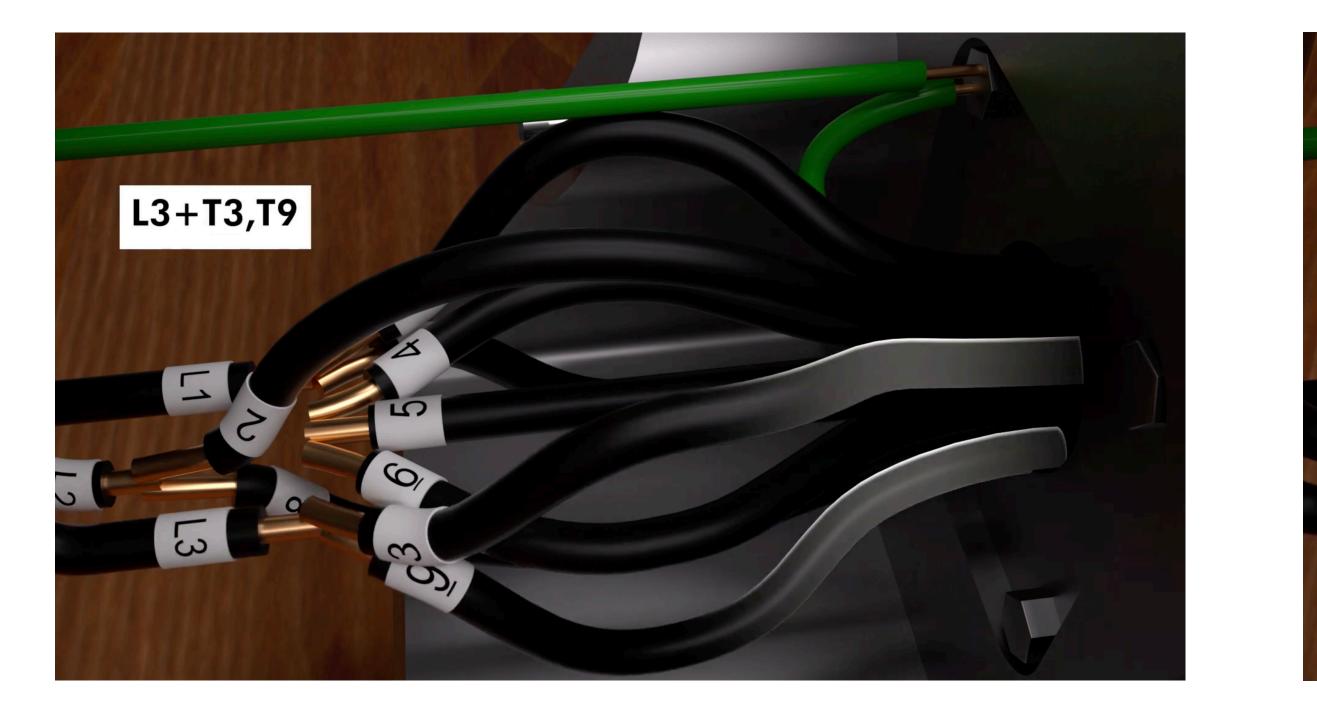


THIS IS JUST A ILLUSTRATION OF WHAT WIRES GET CONNECTED TOGETHER, DO NOT USE WIRE NUTS, USE BOLT DOWN LUGS


### **IF YOU HAVE 12 LEADS AT THE MOTOR CLICK HERE**

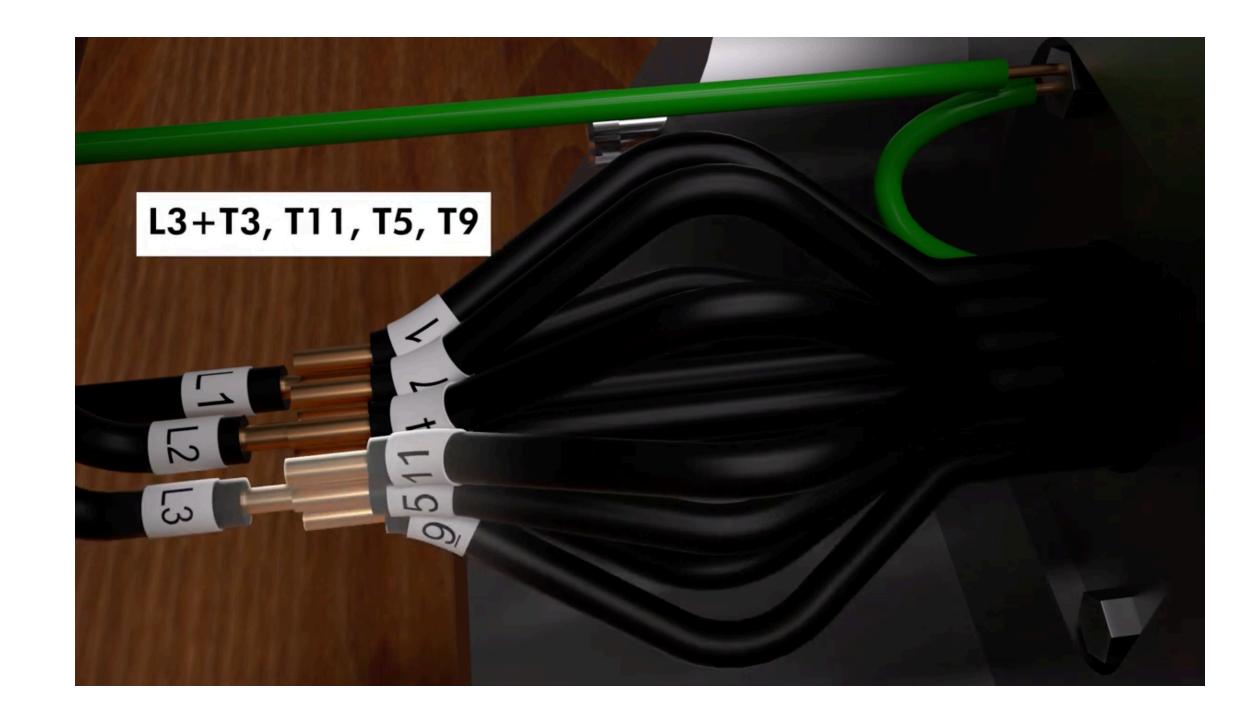


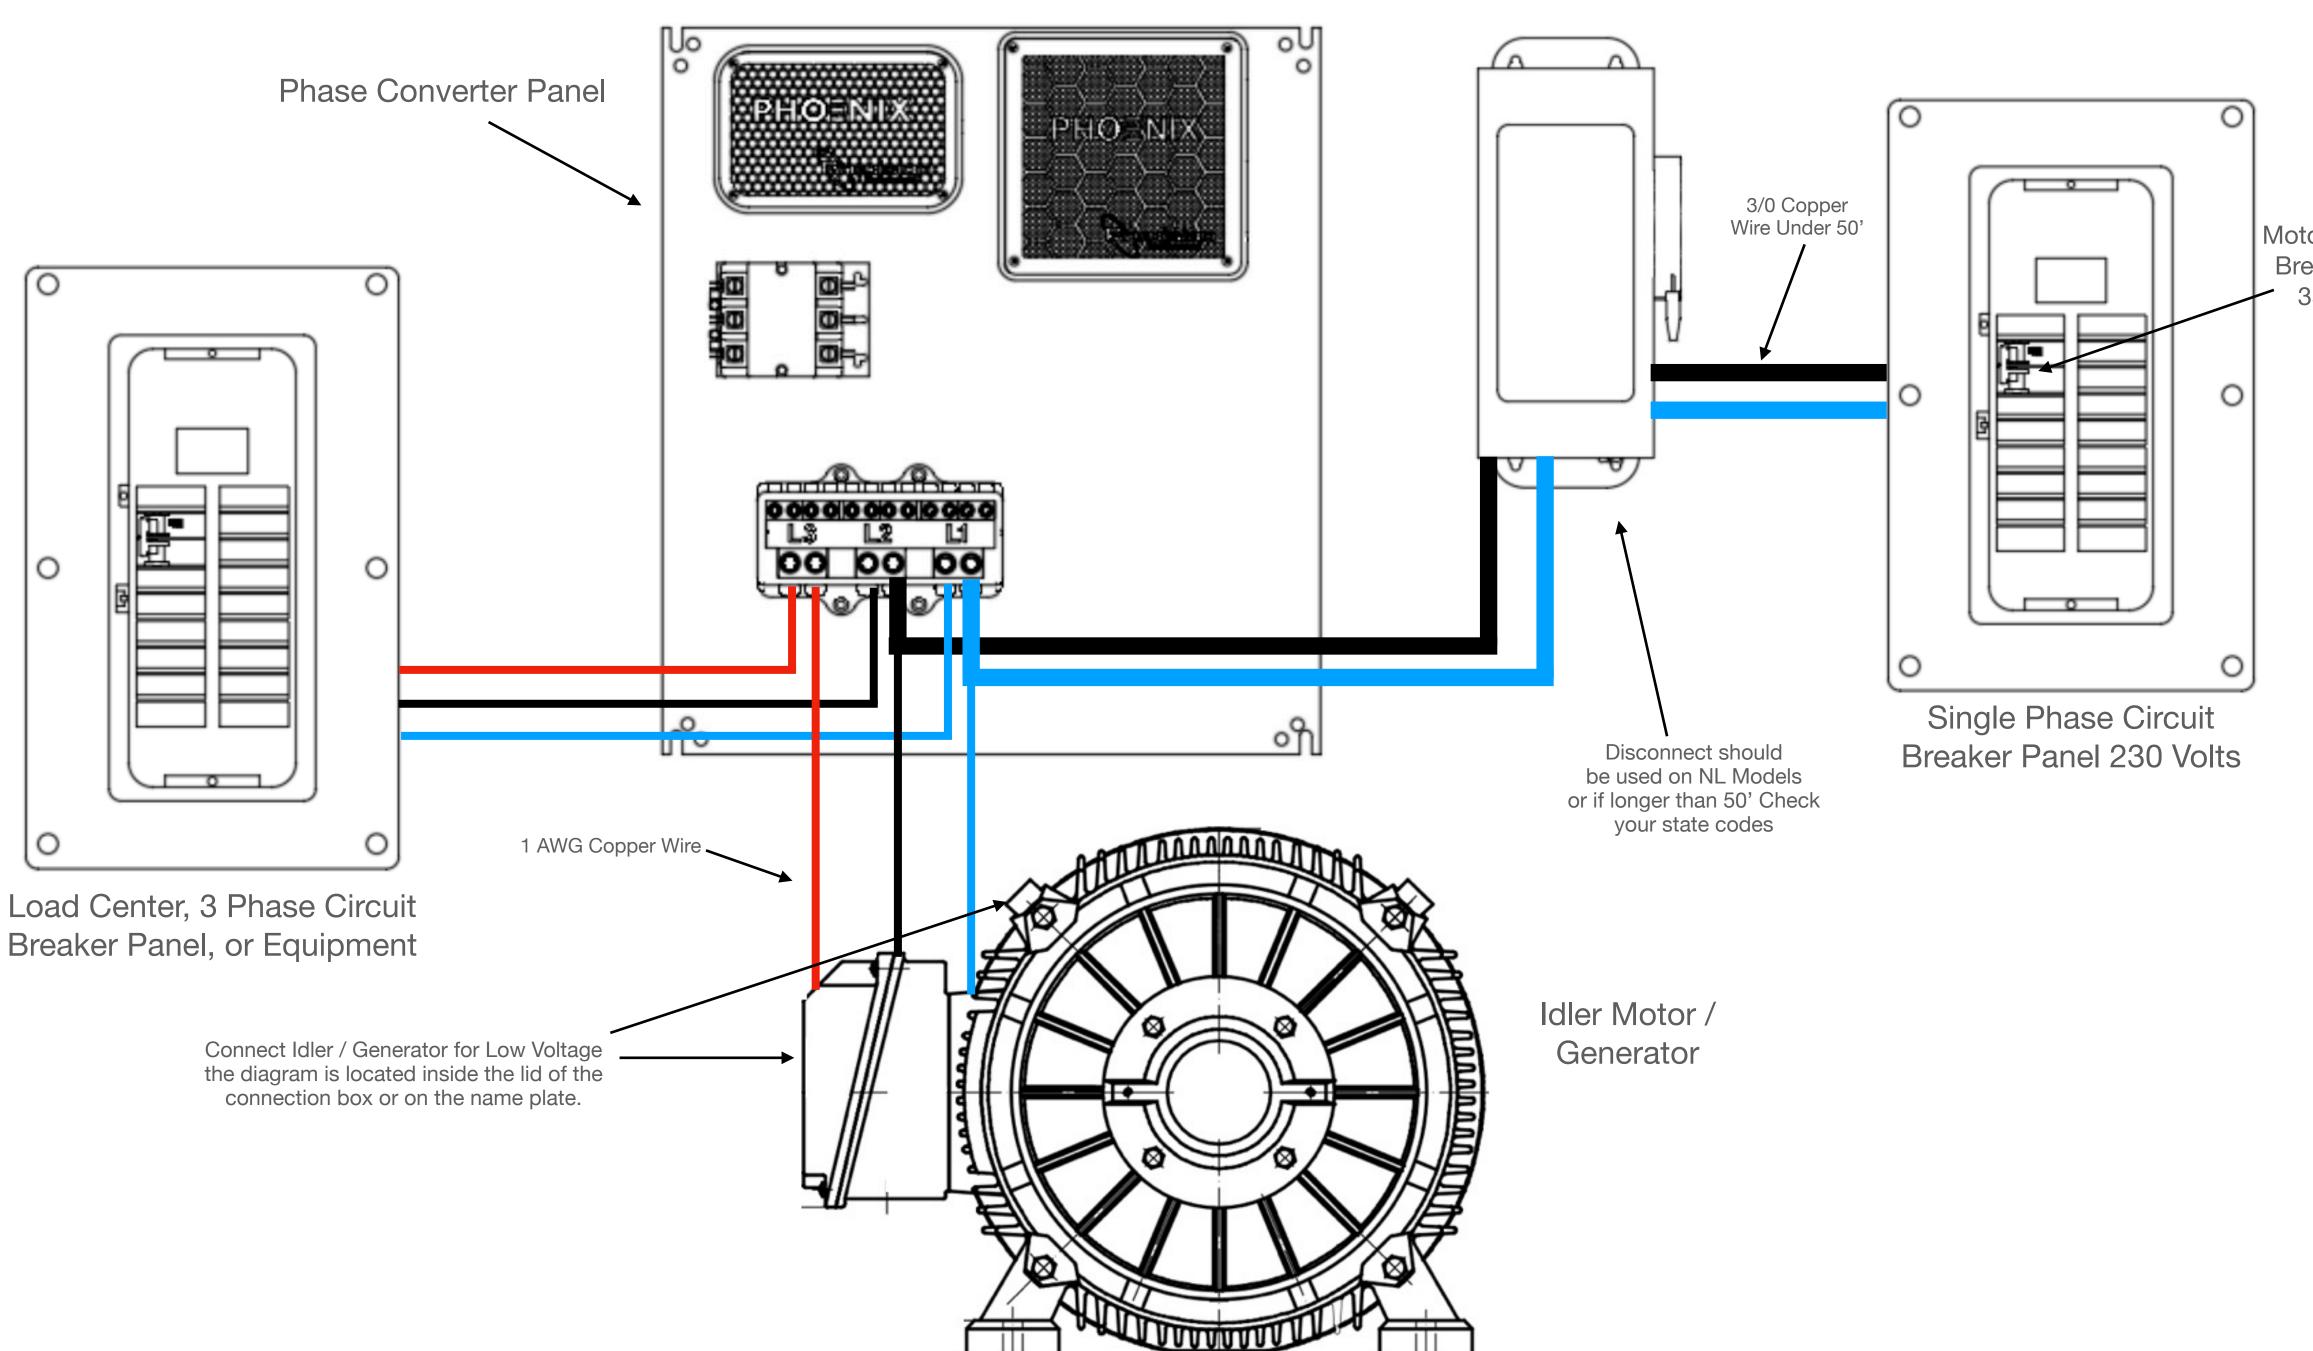

Motor Load Type Breaker 125 to 350 AMPS

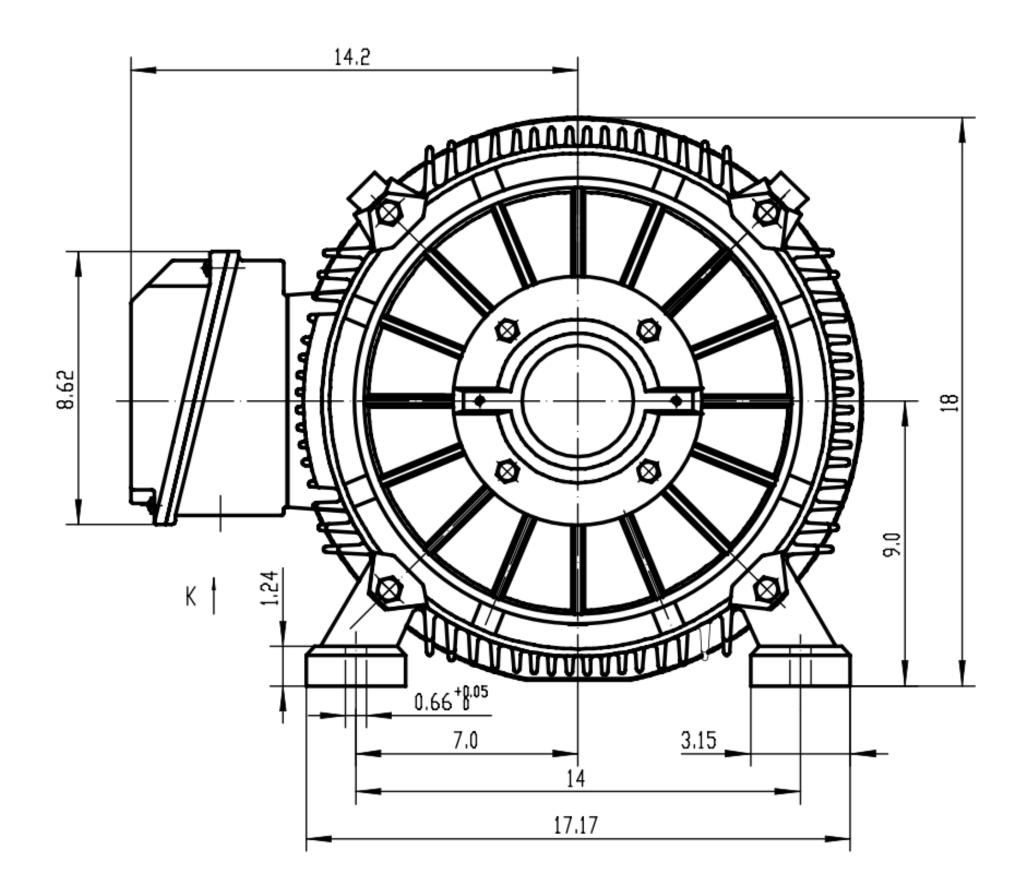


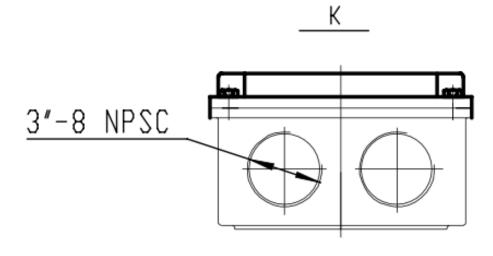

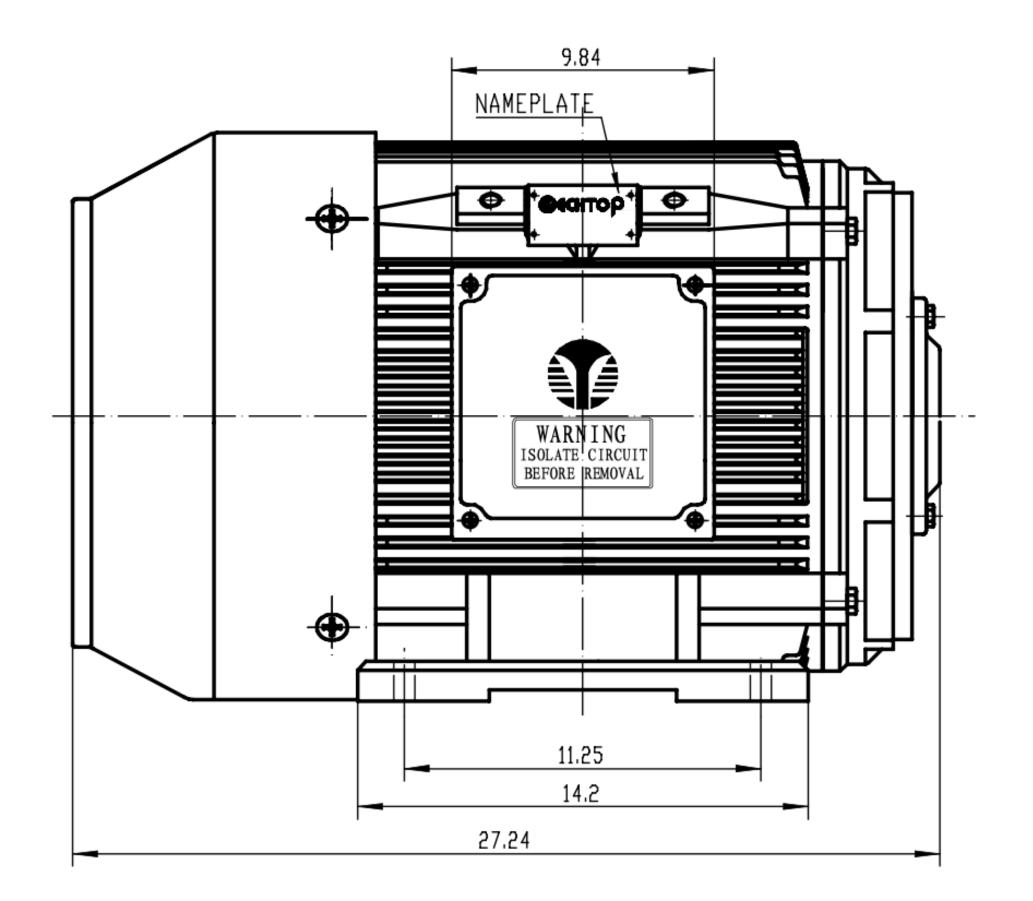

<del>-</del> -

Weight: 60 HP = 782.75 lbs

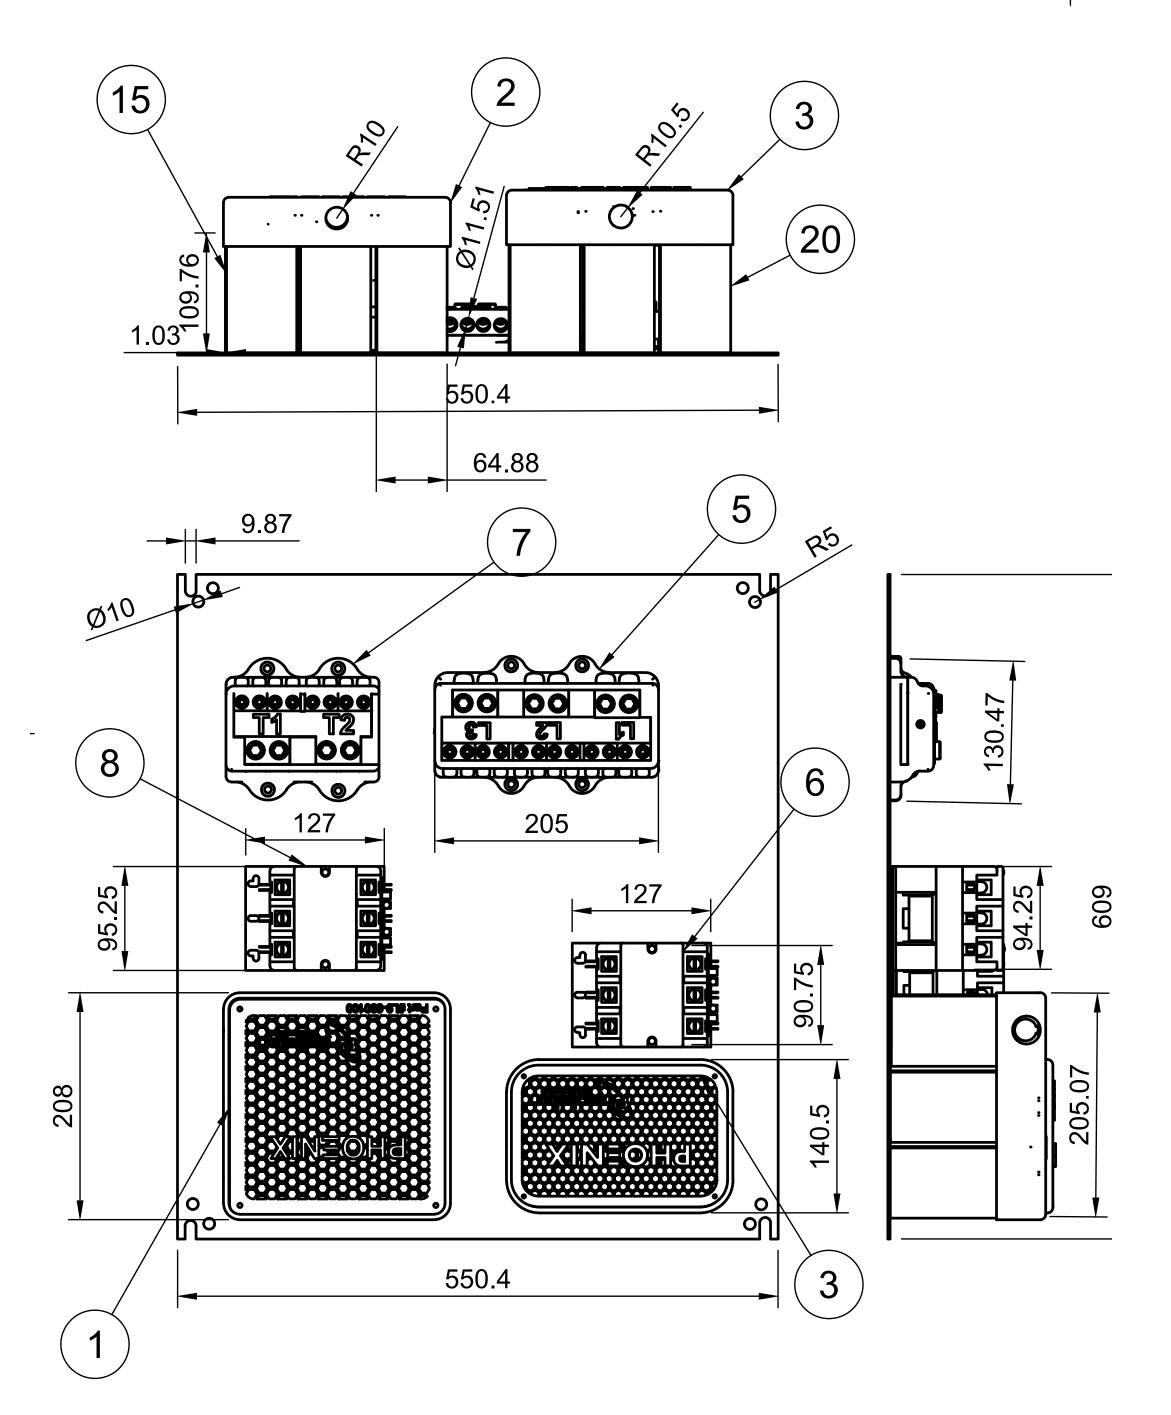



### 60 HP Rotary Phase Converter Components

ltem Number	Description (Click on the description to visit the link to that item)	Quantity in Model	Price	SKU# (Click on 3D viewing)
9	Relay	1	47.00	GP90-66
	Complete Run Bank Assembly - Prewired	1	490.00	*
27	<u>3 Pole Contactor 75 amp</u> <u>- 230V</u>	2	182.90	<u>C375C</u>
4	<u>9 Bank Start and Run</u> <u>Capacitor Holder Only</u> <u>with Base</u>	1	<u>239.00</u>	CB409HO
2	<u> 3 Phase Power Block</u>	1	395.00	<u>GPB603</u>
10	Single Phase Power Block	1	295.00	*
3	630 MFD 220V Start Capacitor	3	<u>24.14</u>	<u>PTMJ630</u>
5	<u>100 MFD 370V Run</u> <u>Capacitor</u>	1	<u>26.00</u>	<u>TRC100</u>
1	Complete Capacitor Start Bank Assembly - Prewired	1	<u>490.00</u>	<u>CB30230</u>
*	Complete Back Plate Assembly - Prewird NL Model. (Without Start and Stop Button)	1	3250.00	CBA60PL
*	Complete Panel with NEMA 4 Enclosure - Prewird NL Model (without Start and Stop	1	3634.00	GP60PLPO
*	Idler Motor	1	3875.00	*
*	<u>Complete Unit Phase</u> <u>Converter Panel (PL</u> <u>Model) and Idler/</u> <u>Generator Motor</u>	1	7228.00	<u>GP60NL</u>

