

Number:  
Subject:

(Twin) 5/73  
Sump Plug  
Models: TR7/T140  
Date: 6/6/73

**TRIUMPH MOTORCYCLE CORPORATION** A subsidiary of The Birmingham Small Arms Company Incorporated, Verona, New Jersey  
Duarte, Calif. 91010, P. O. 80x 275

Towson, Baltimore, Md., P. O. Box 6790


21204

### OIL LEAKAGE AT SUMP PLUG

The sealing washer currently being used on the sump filter plug is sometimes prone to leakage.

Leakage at this point can easily be cured by fitting a "O" ring Part No. E-7310 in place of the flat washer. (This "O" ring is currently in use on the push rod tubes).

### SUMP PLUG WITH 110<sup>th</sup> RING

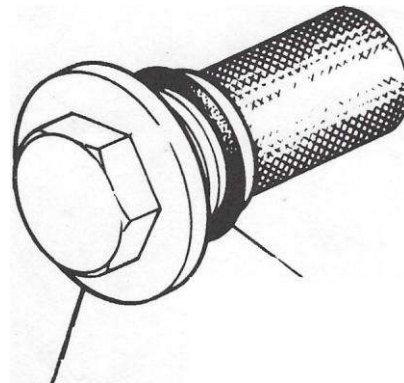

SUMP FILTER PLUG  
(E9336)



110<sup>th</sup> RING (E7310)

For Triumph & BSA

Parts: [www.classicbritishspares.com/](http://www.classicbritishspares.com/)