



TRACMASTER

Landscape • Groundcare • Conservation


TECHNICAL SERVICE BULLETIN




TC07 Turf Cutter

- PROBLEM:** Unable to engage or disengage drive to rear wheels.
- POSSIBLE CAUSE:** Pressure washing has removed the lubricant from the clutch system.
- SOLUTION:** Lubricate the sliding clutch, shaft and chain with light oil or penetrating fluid. the clutch system should be lubricated weekly and before storage.
- NOTE - PRESSURE WASHING THE TRANSMISSION ASSEMBLY SHOULD BE AVOIDED.**

DISENGAGED LUBRICATE

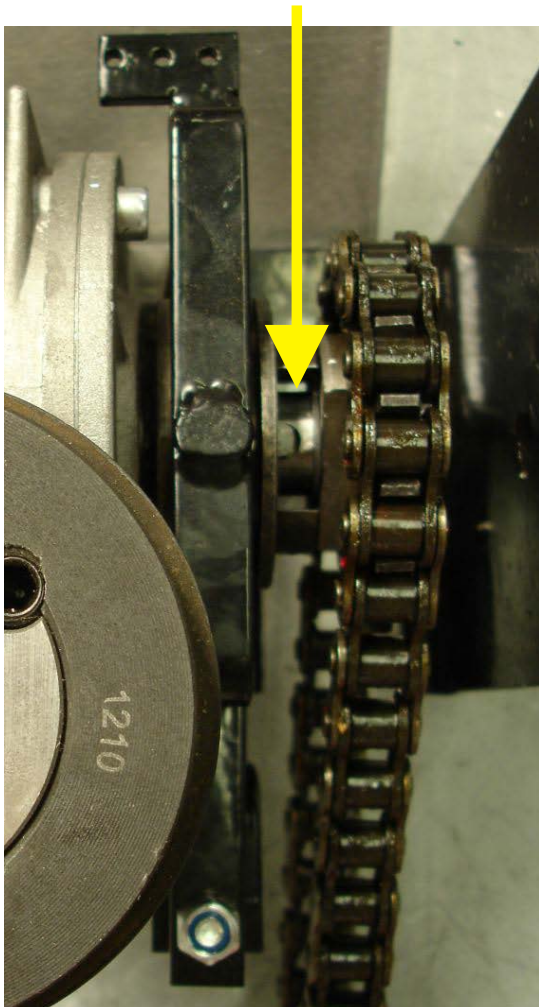

ENGAGED LUBRICATE

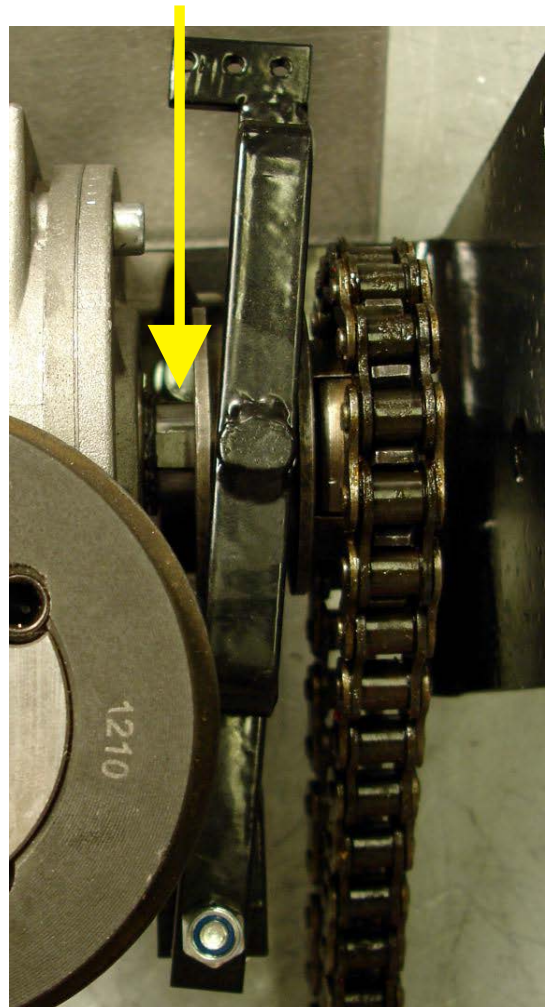

14 August 2008 (rev. 5 March 2009)