

---

## TECHNICAL SERVICE BULLETIN

---




### TC07 Turf Cutter

- PROBLEM:** Unable to engage or disengage drive to rear wheels.
- POSSIBLE CAUSE:** Pressure washing has removed the lubricant from the clutch system.
- SOLUTION:** Lubricate the sliding clutch, shaft and chain with light oil or penetrating fluid. the clutch system should be lubricated weekly and before storage.

**NOTE - PRESSURE WASHING THE TRANSMISSION ASSEMBLY SHOULD BE AVOIDED.**

---

**DISENGAGED LUBRICATE**

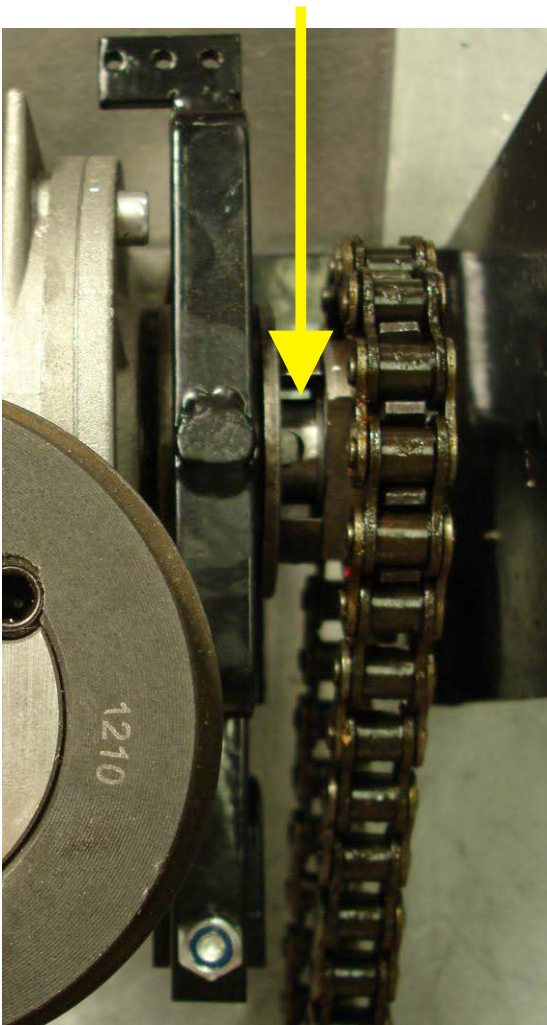

**ENGAGED LUBRICATE**

