


NTEP FLOOR SCALE ASSEMBLY GUIDE

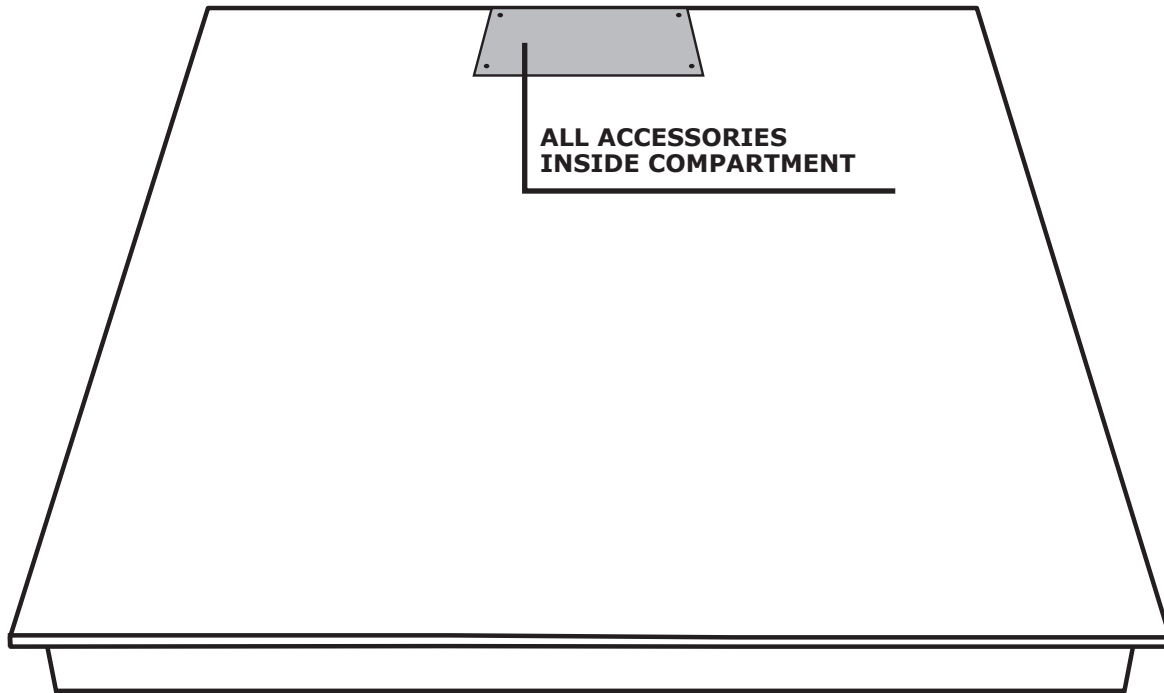

1. Carefully open box and remove scale
2. Locate compartment (found on top of scale) and remove the screws
3. Remove all contents - feet, indicator, indicator cable, power cable, indicator bracket and manual
4. Screw the 4 feet into each load cell until scale is leveled
NOTE: Do not screw in too deep that it will touch the platform
5. Place scale on flat surface and make sure scale is stable
6. Route the indicator cable inside the compartment through an available opening (inside compartment) and connect to the indicator
7. Close compartment latch with screws
8. Connect the indicator and power on
9. Once indicator is powered on, display will count down and be zeroed out (no calibration needed). Scale is ready for use
10. If indicator does not count down and zero out, calibration will be needed (please refer to manual for proper calibration steps)

Please call **(844) 735-5386** for support questions

For updated indicator manual, please refer to www.selleton scales.com "Downloads"