

Sagaon


CNC 5040/100100




Manual de ensemble

Paso 1: Marco

1.-

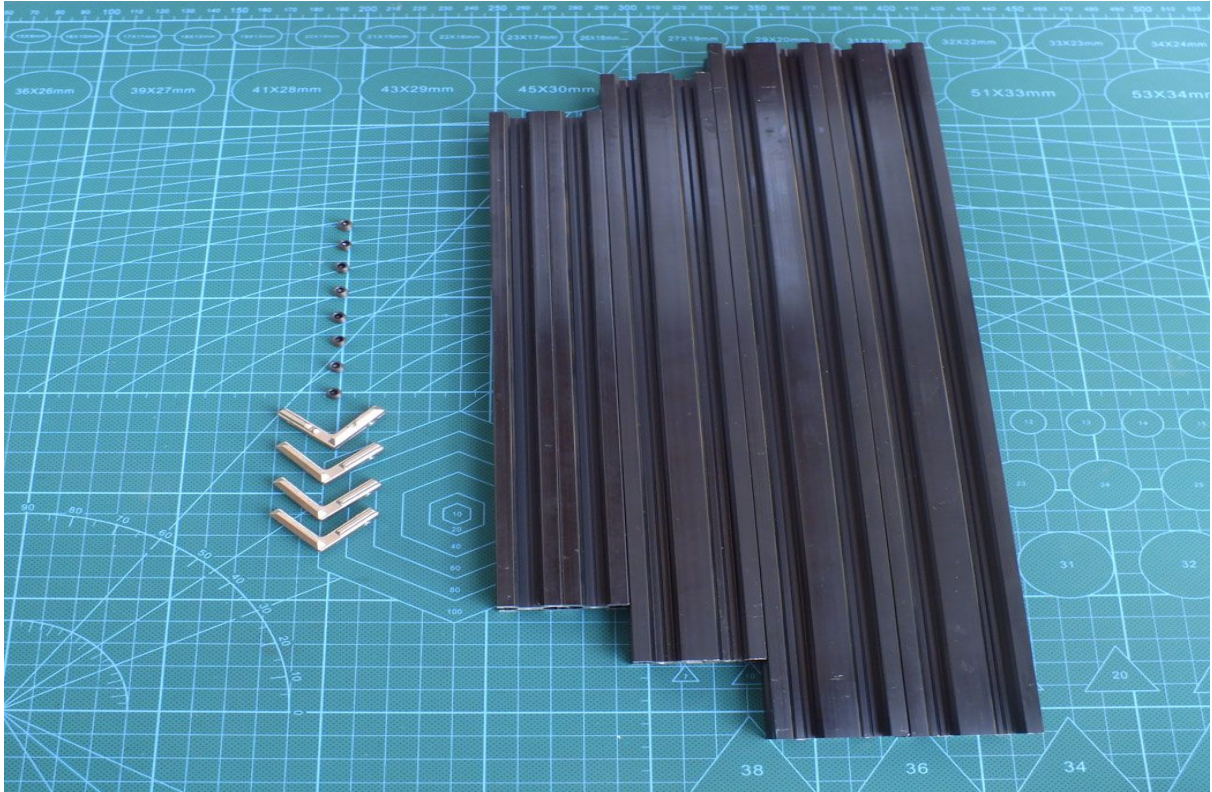


2.-

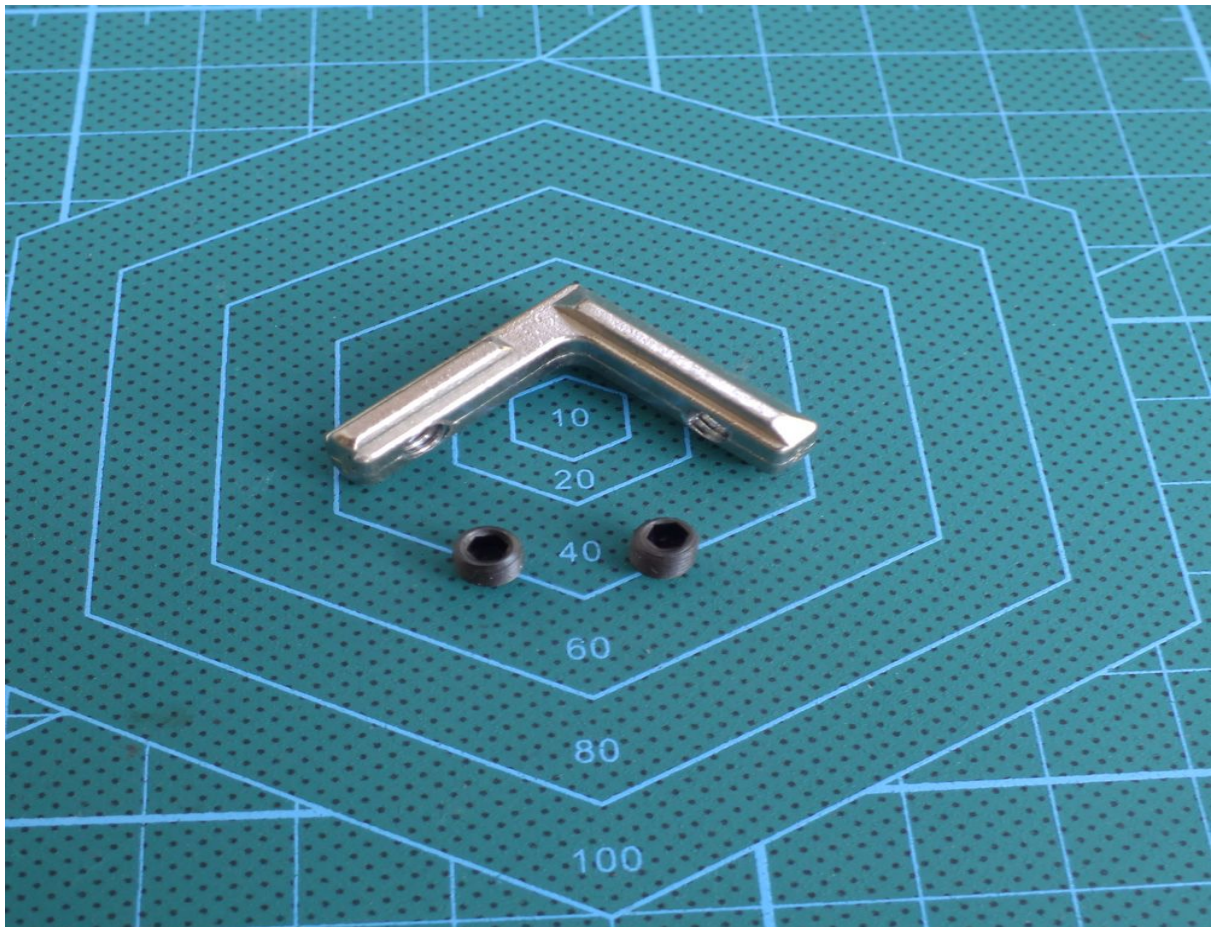


Sagaon

3.-

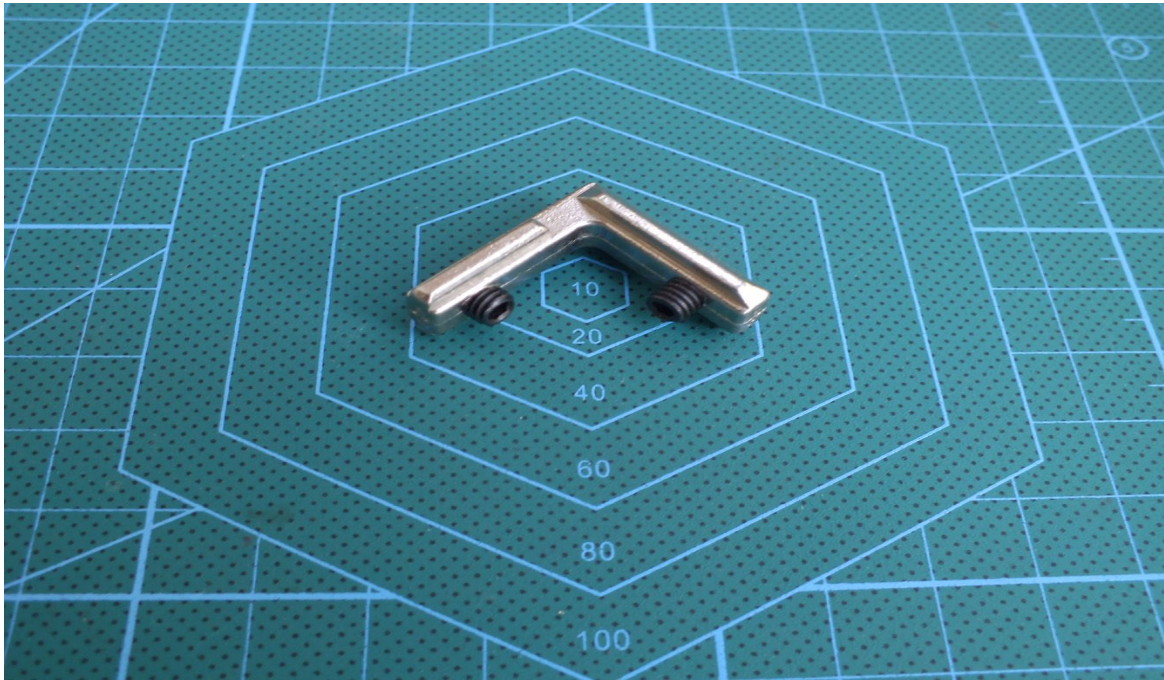


4.-

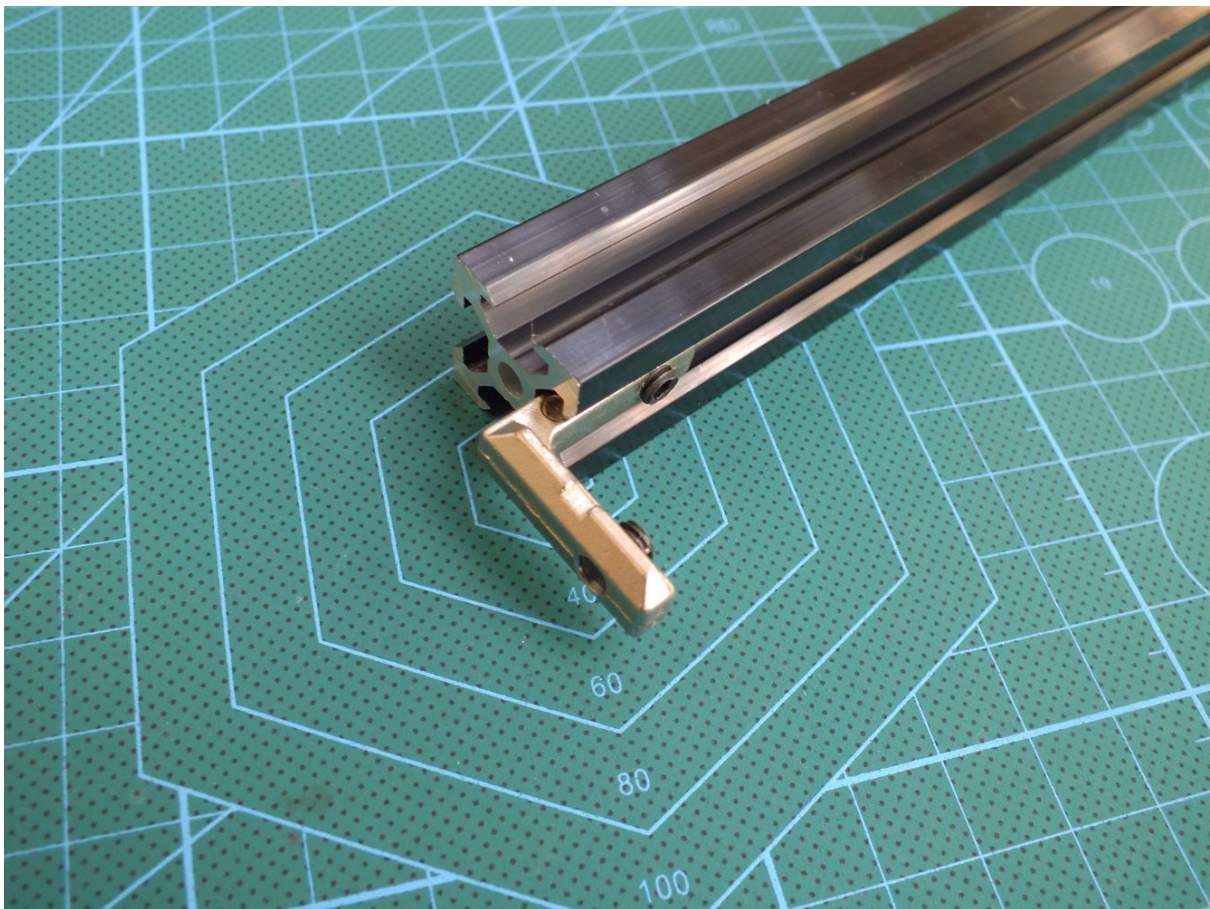


Sagaon

5.-

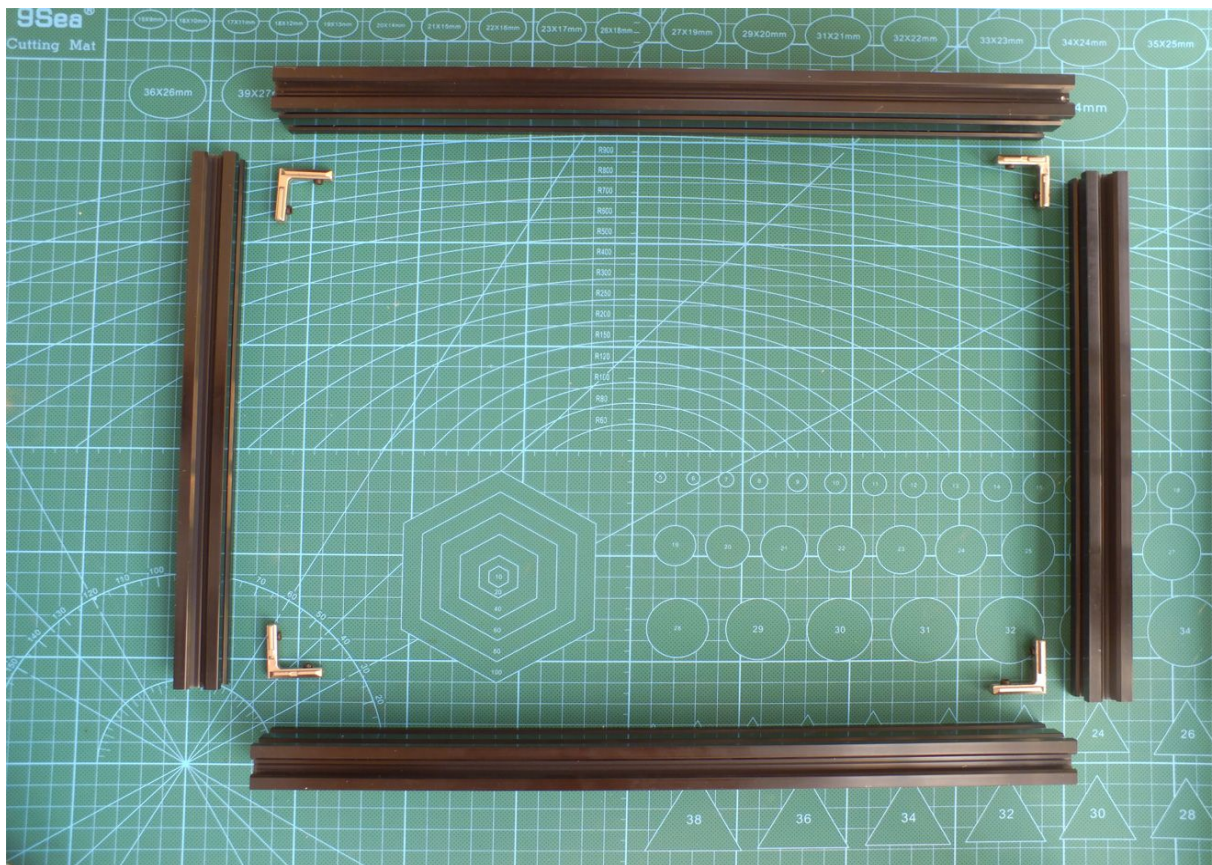

6.-

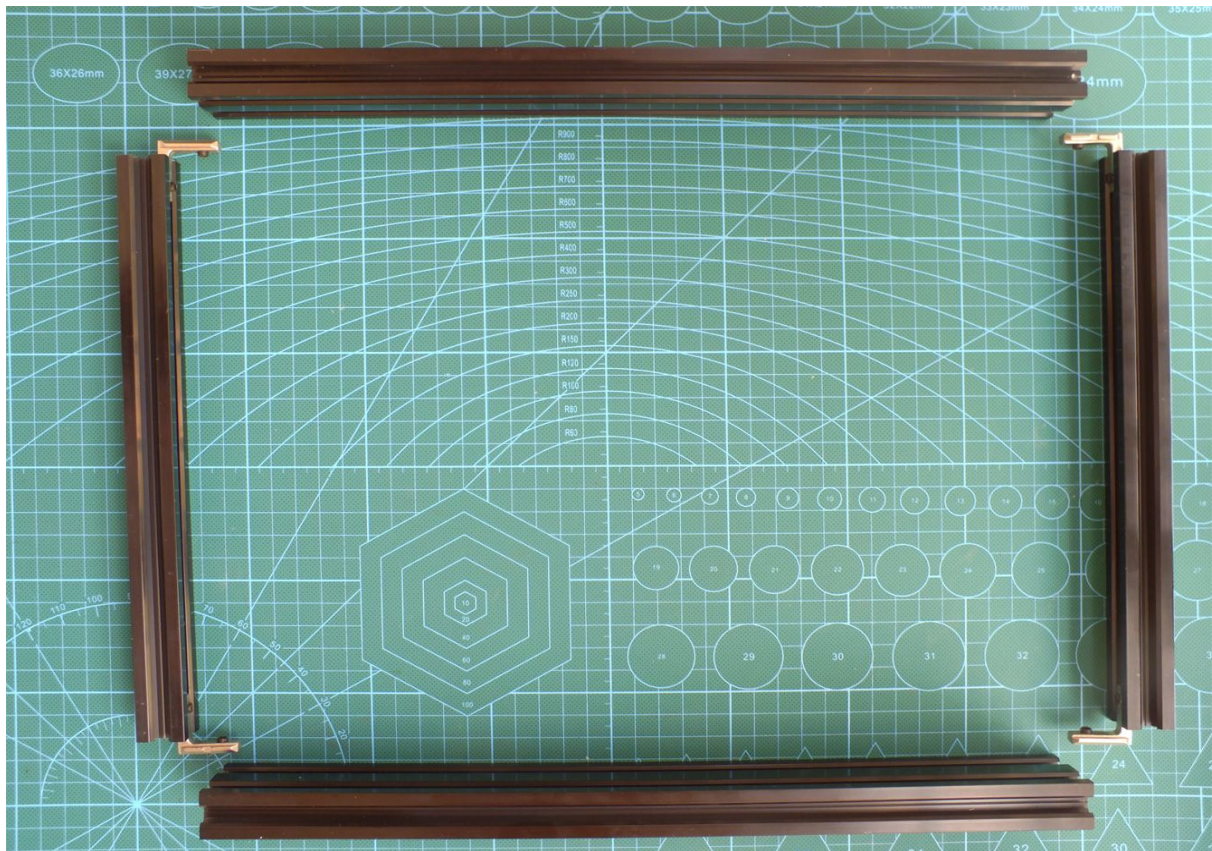


Sagaon

7.-




8.-

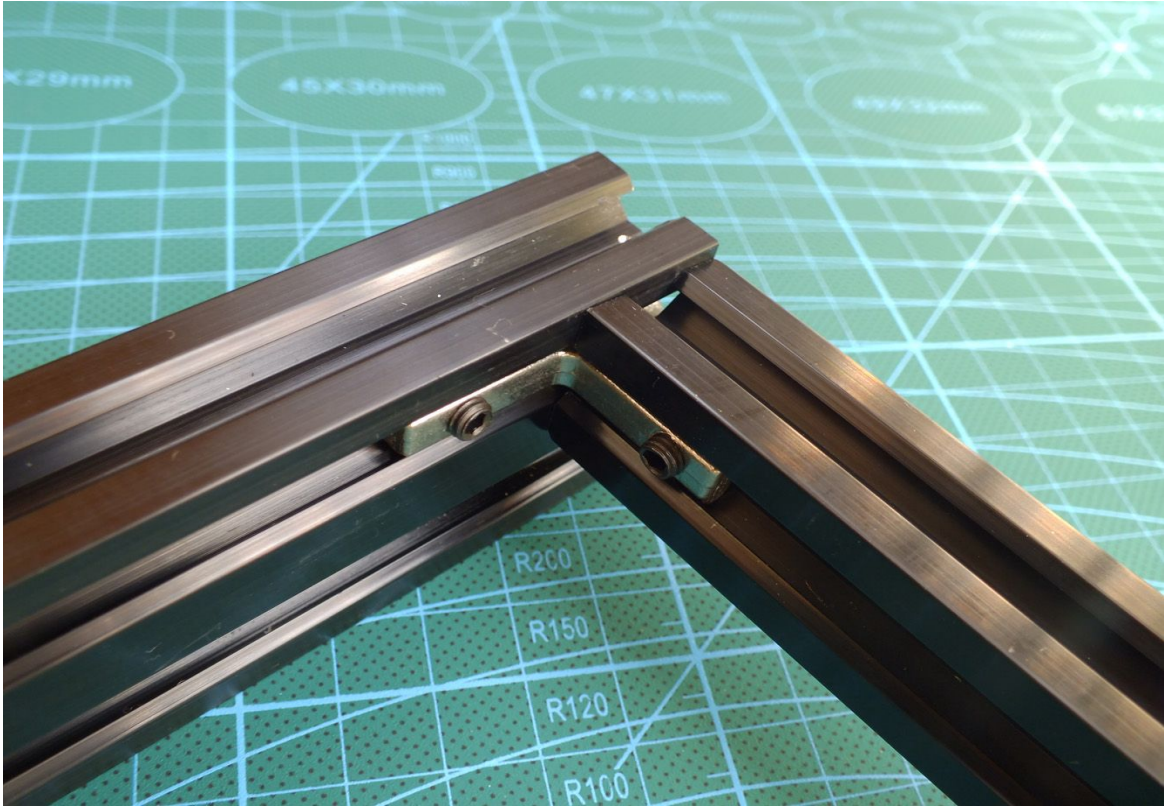


Paso 2: Motores ejes Y


1.-

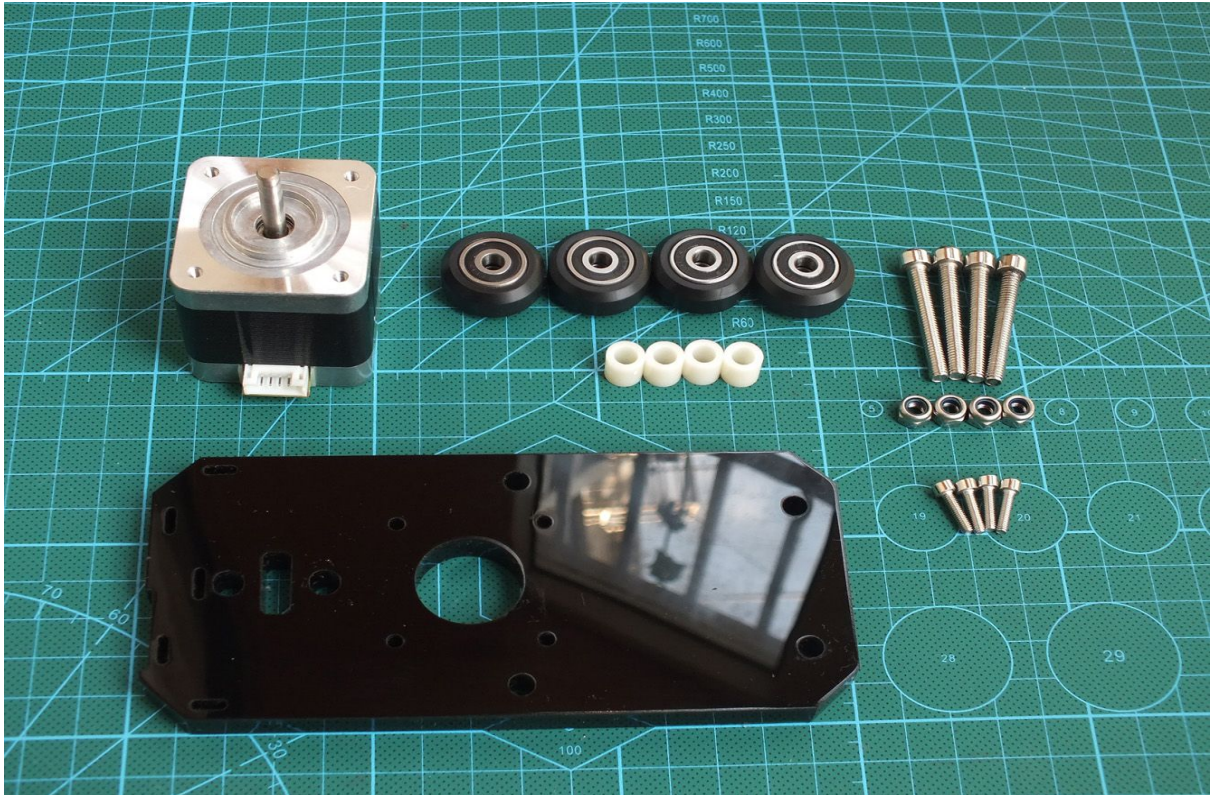


2.-

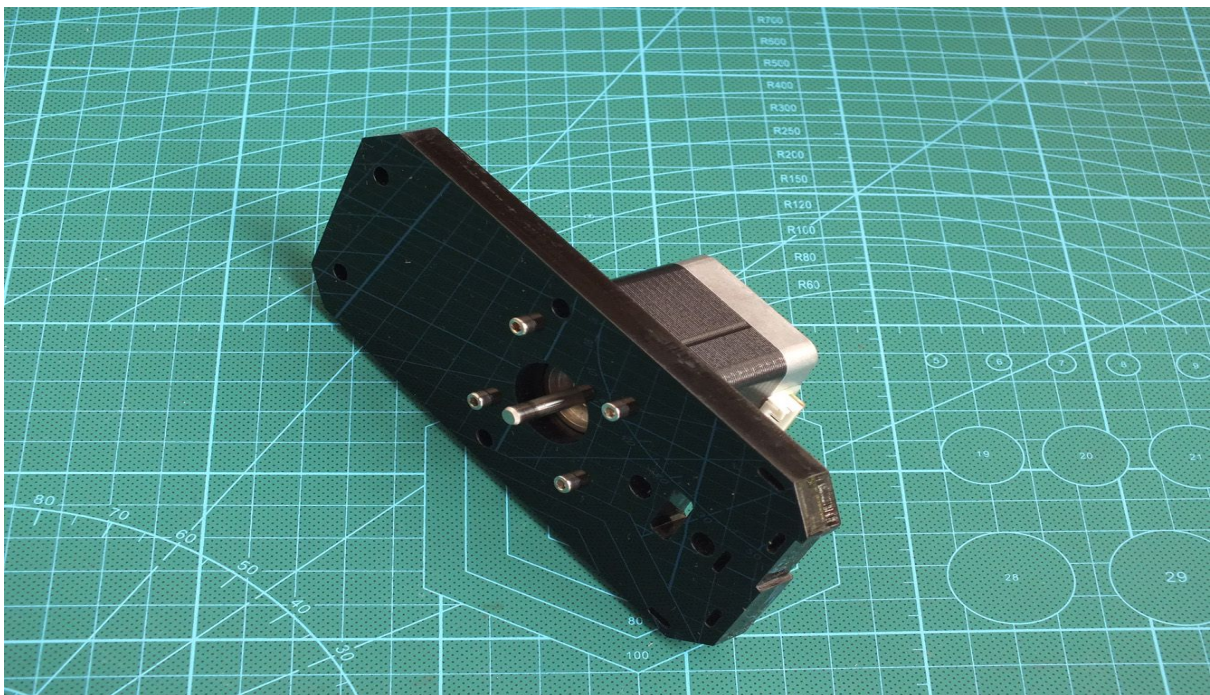

3.-

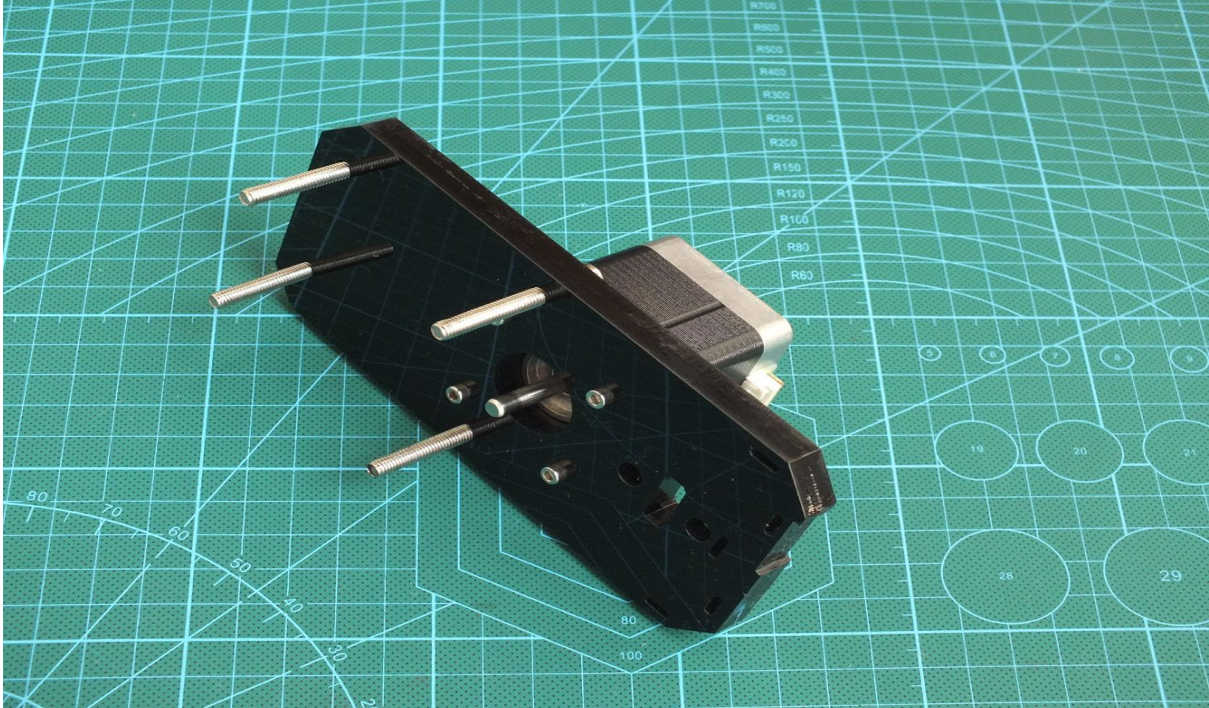


4.-

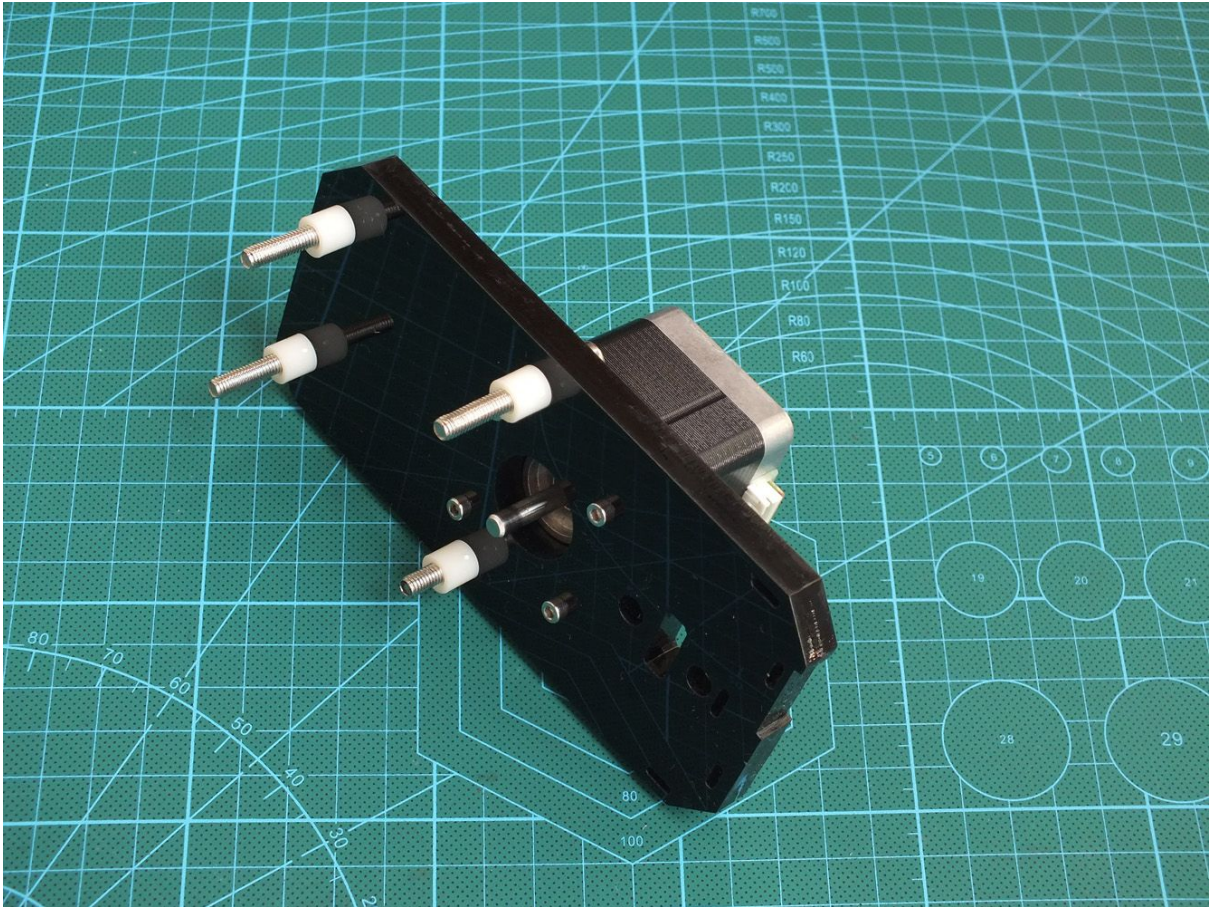


Sagaon

5.-

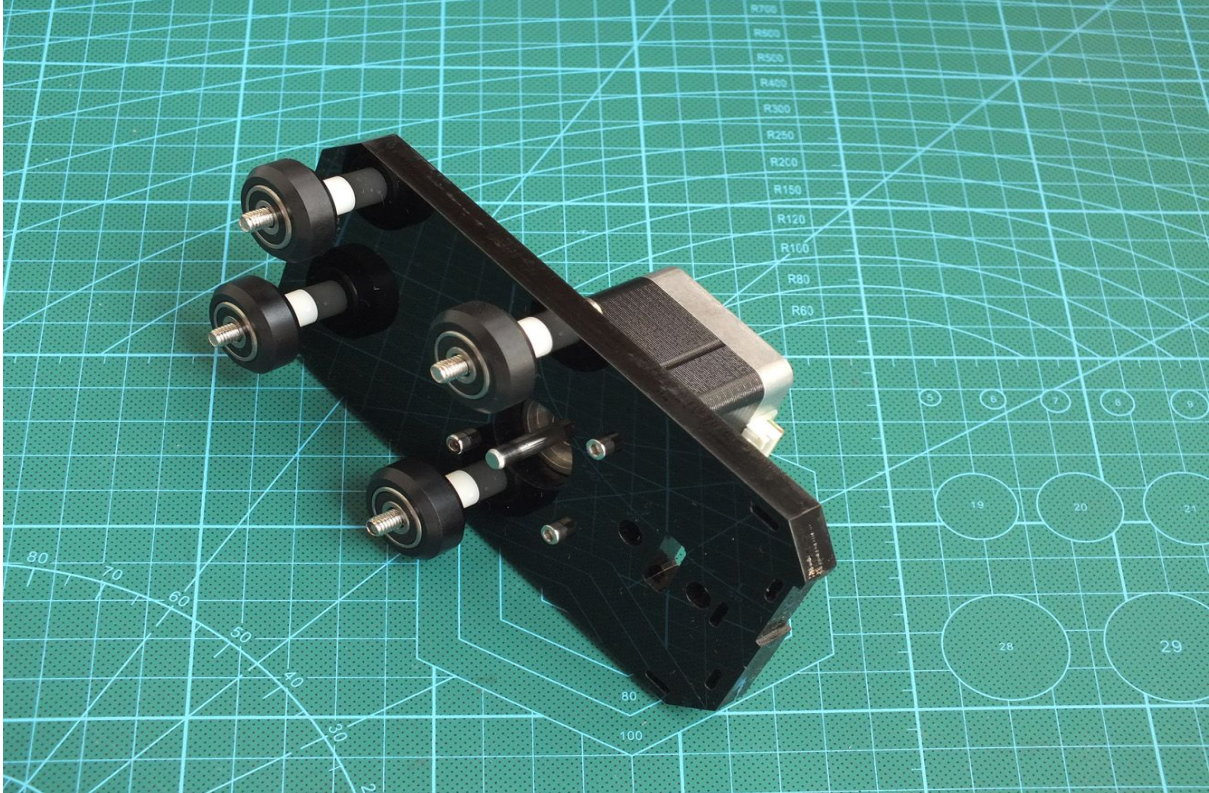


6.-

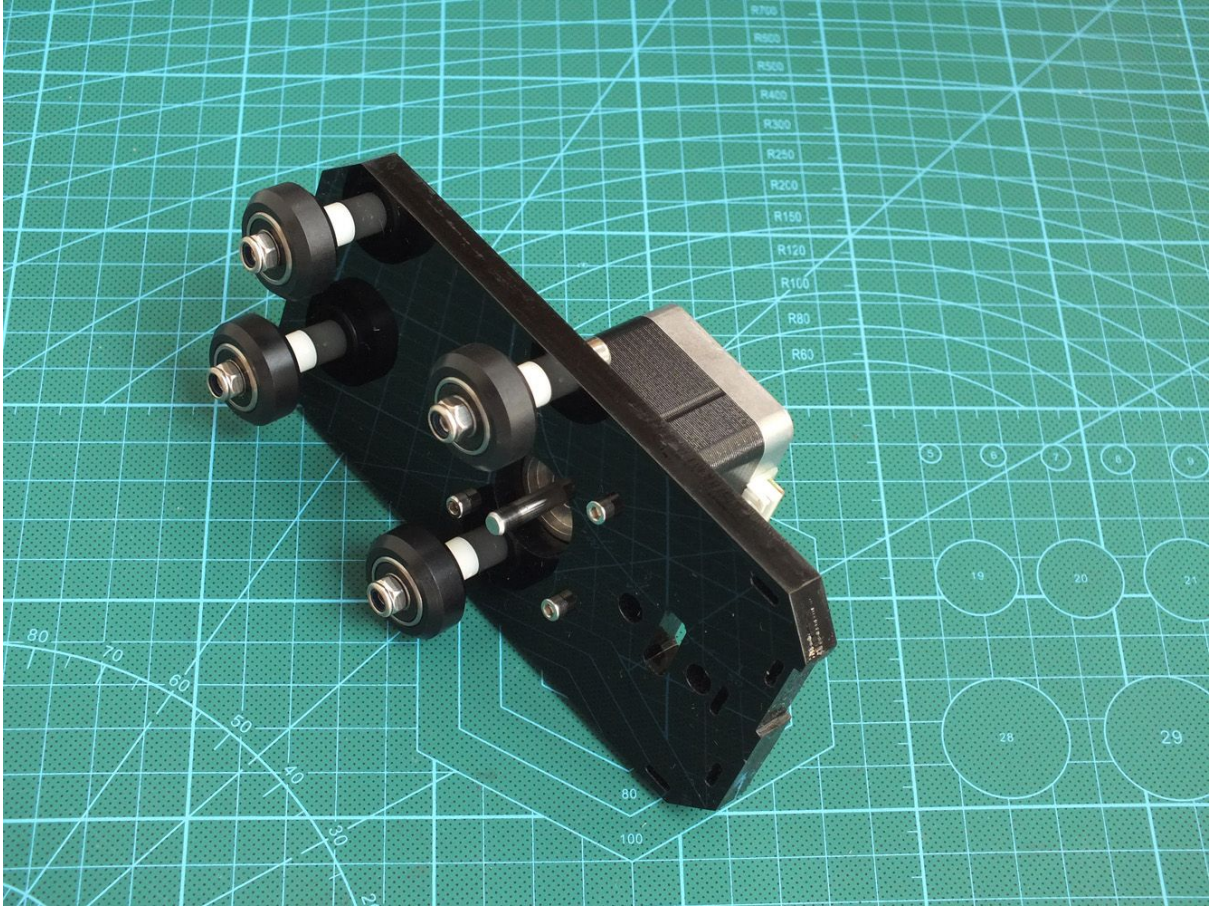

Sagaon

7.-

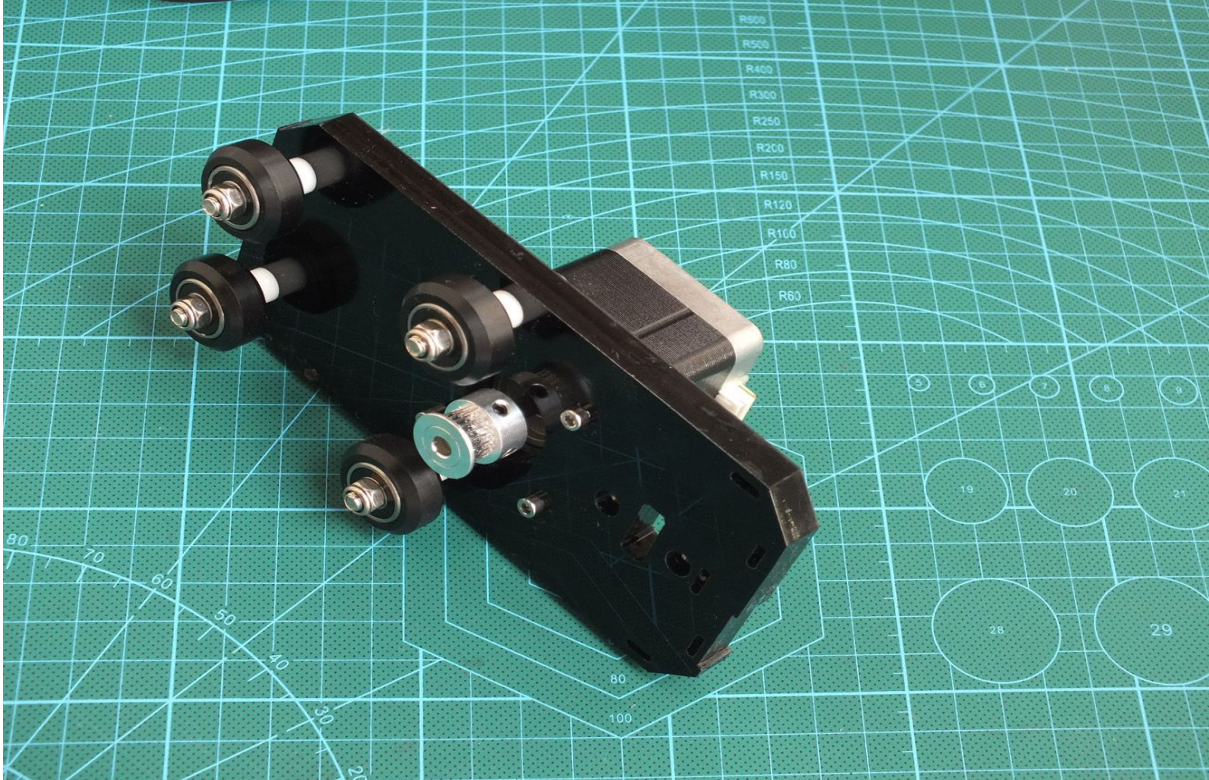


8.-




Paso 3: Ensamble de motor y laser en placa de eje X

1.-

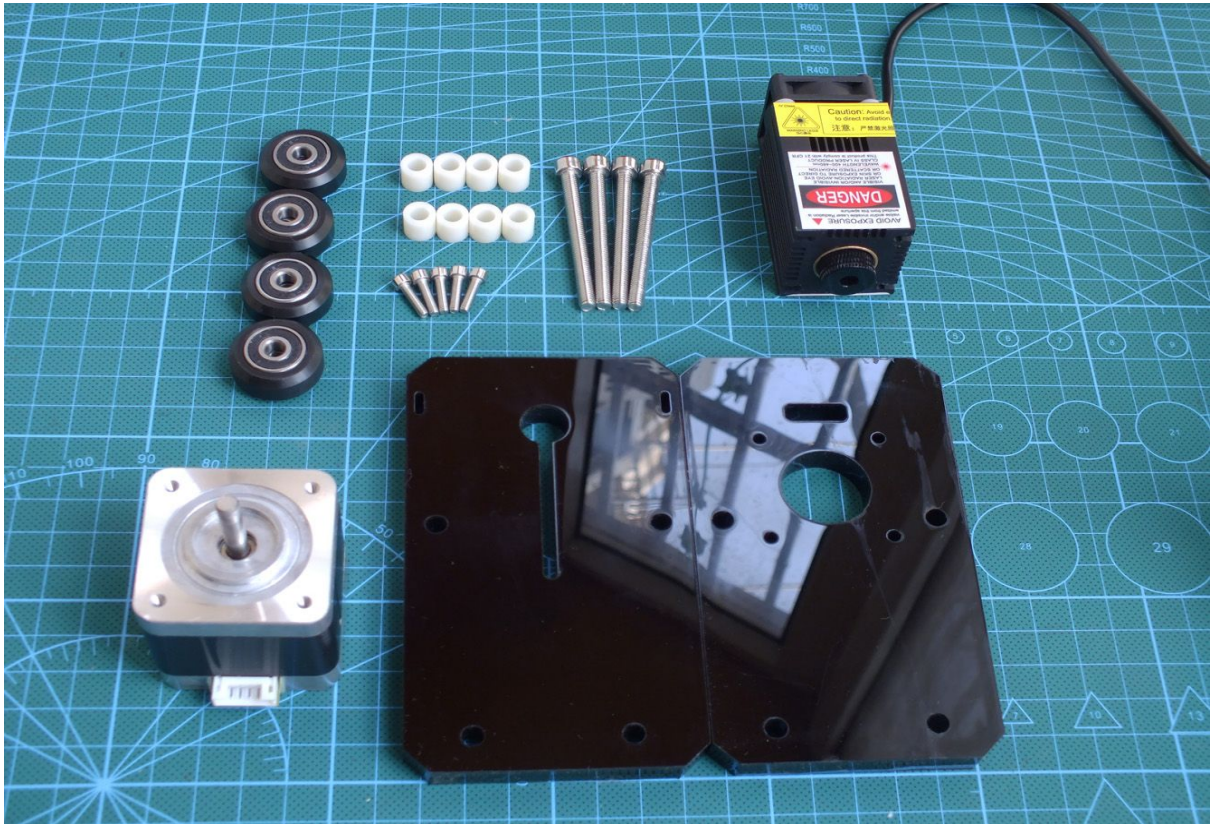


2.-

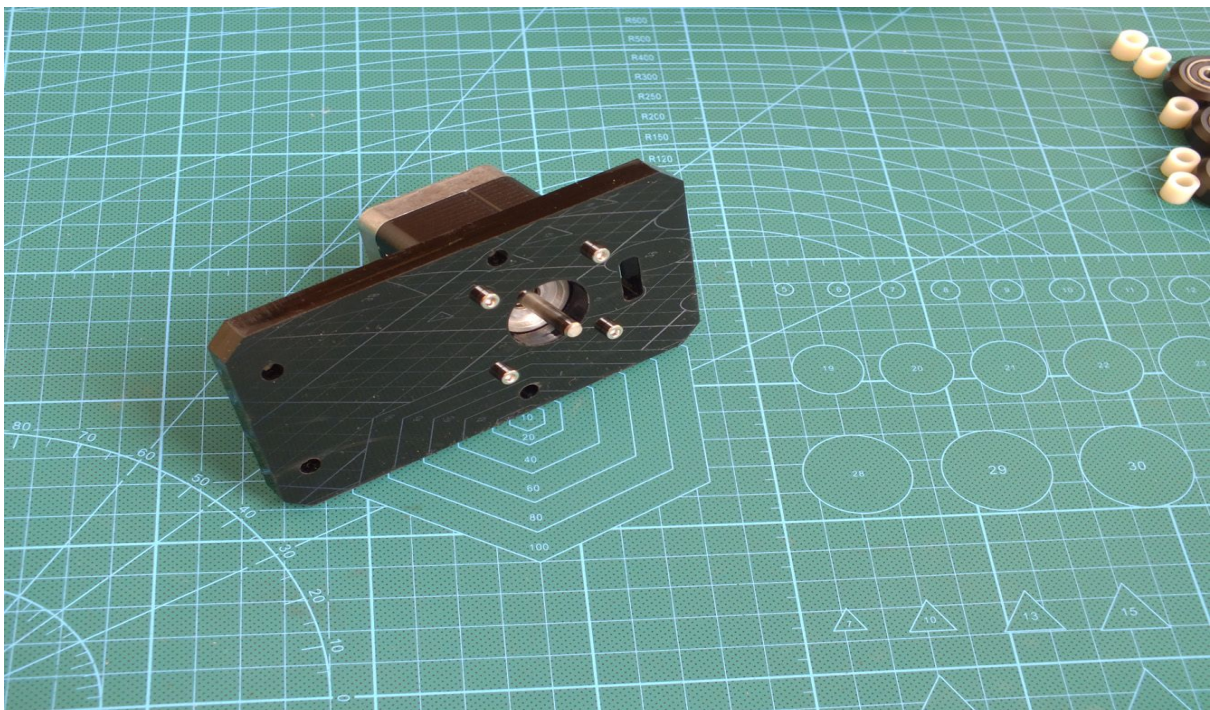


Sagaon

3.-

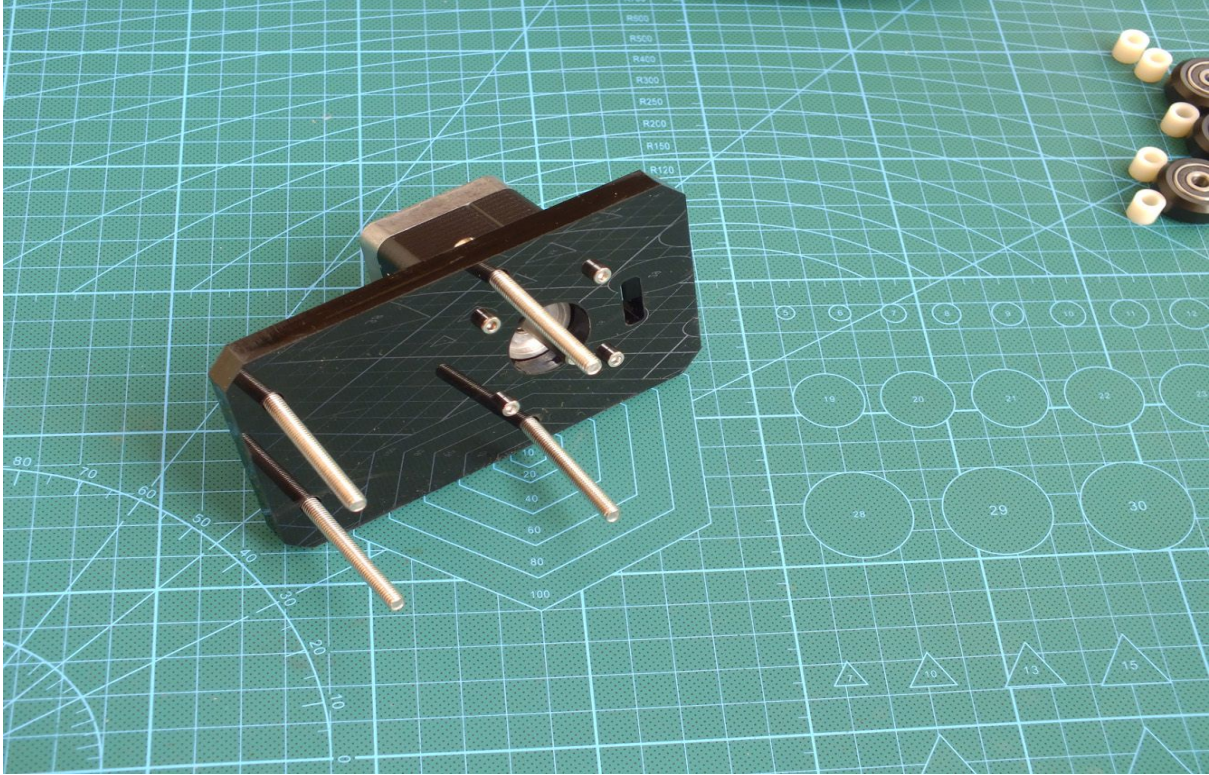


4.-

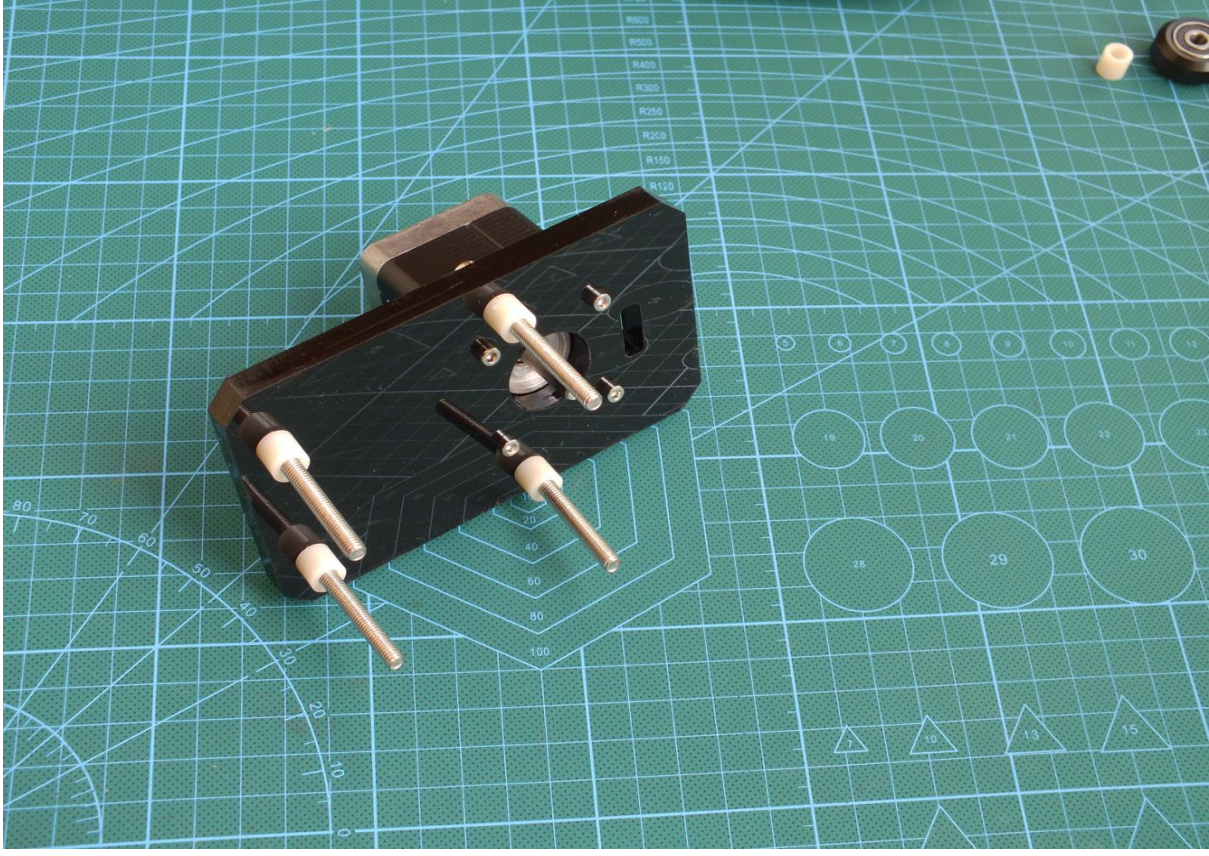


Sagaon

5.-

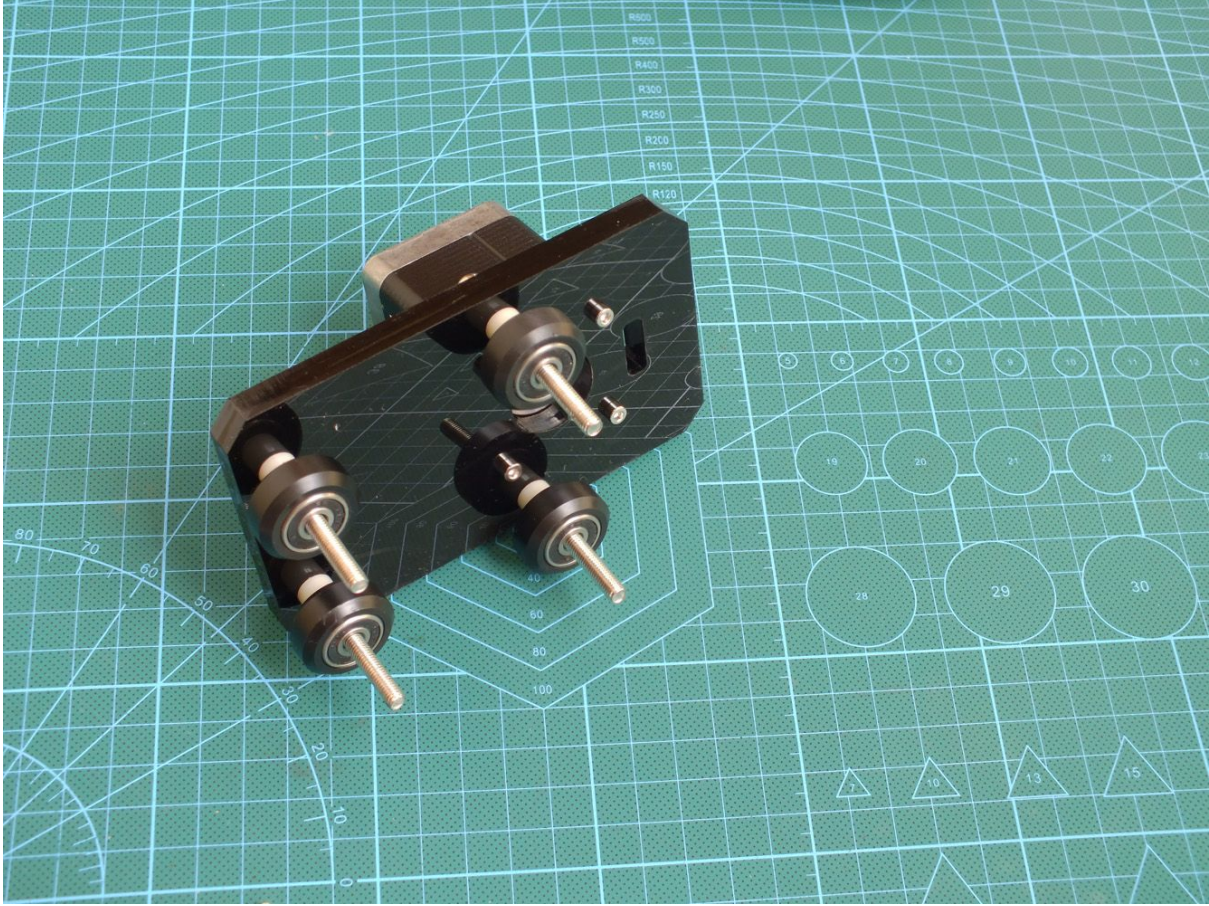


6.-

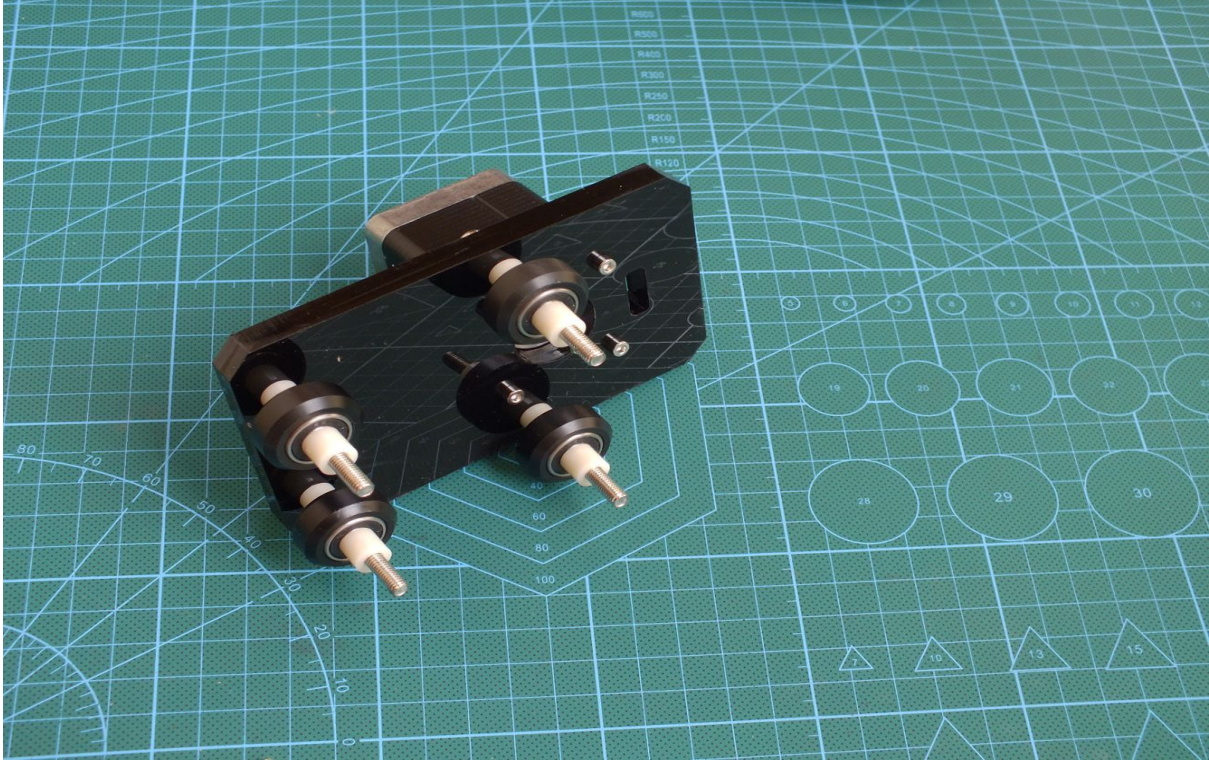


Sagaon

7.-

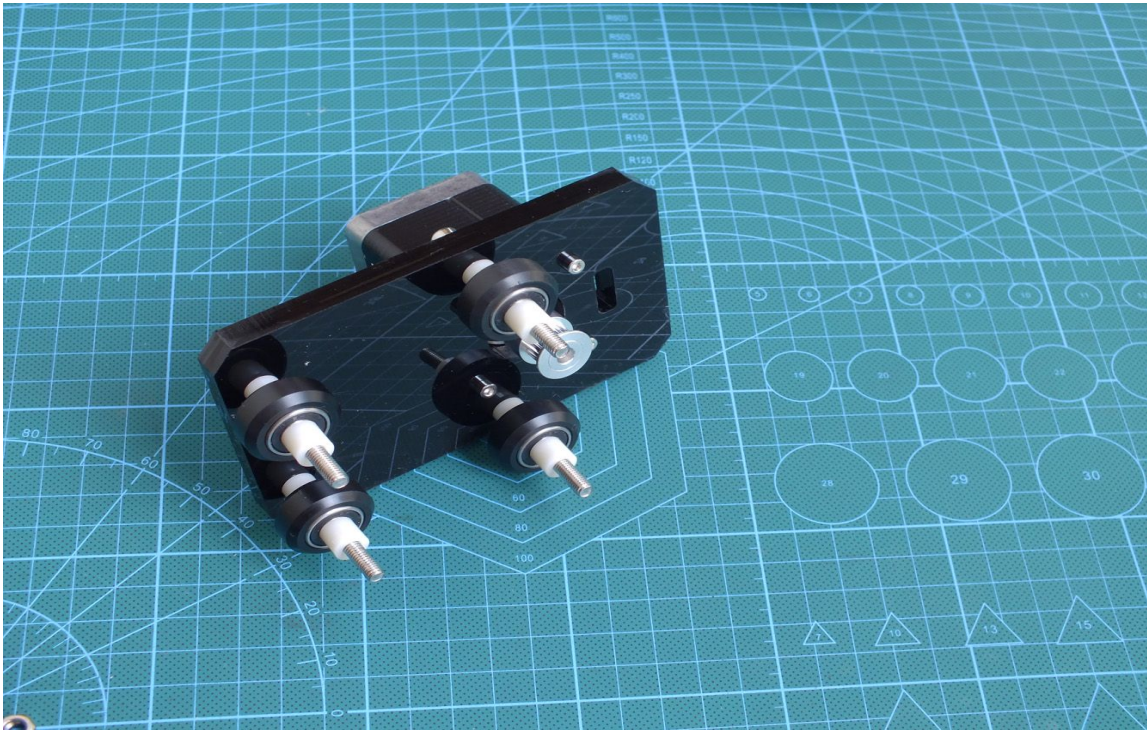

8.-

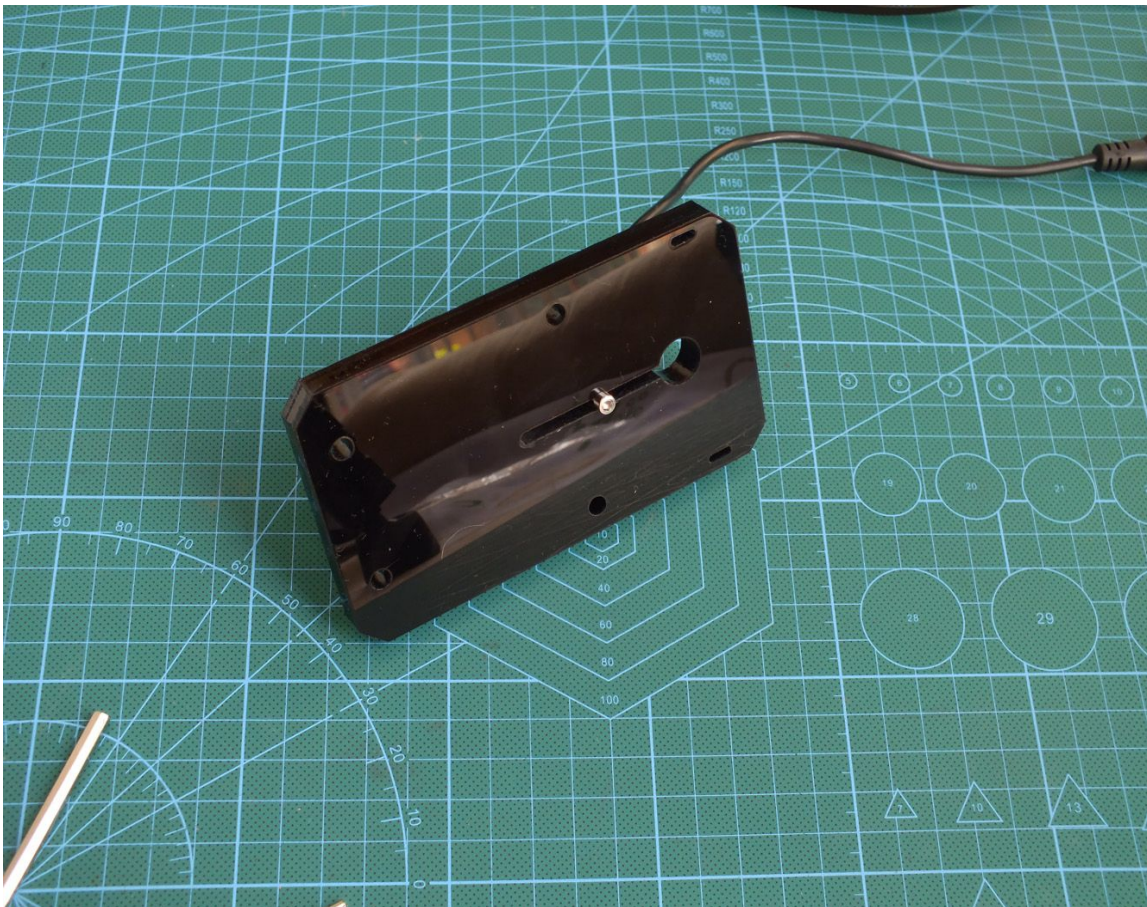


Sagaon

9.-




10.-

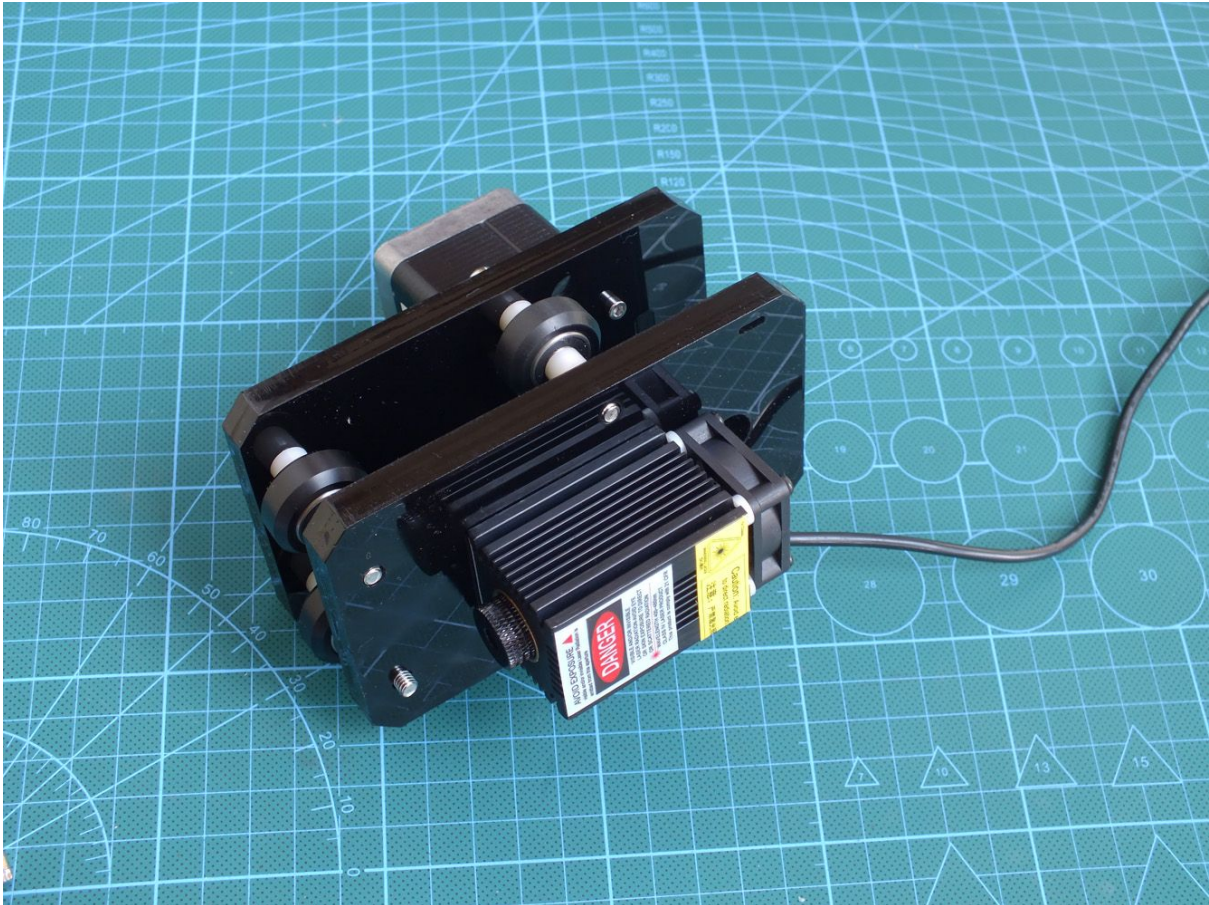


Sagaon


11.-

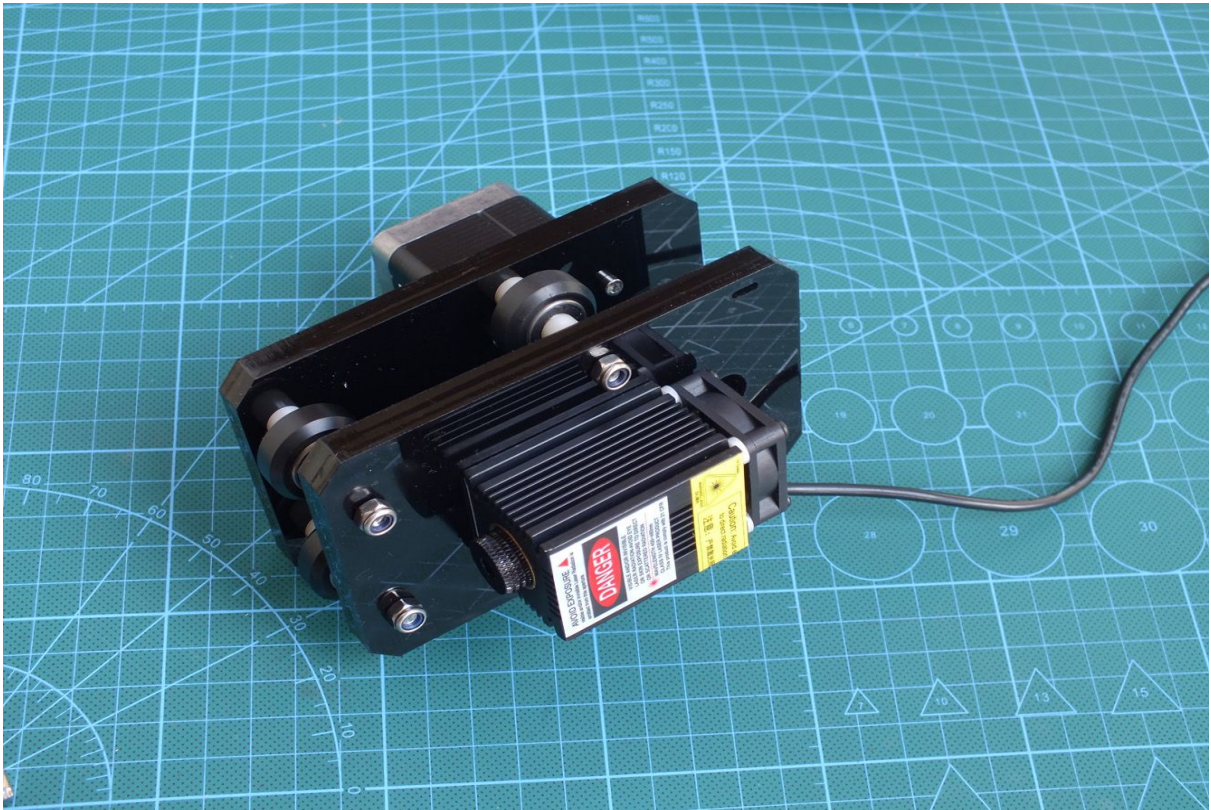

12.-

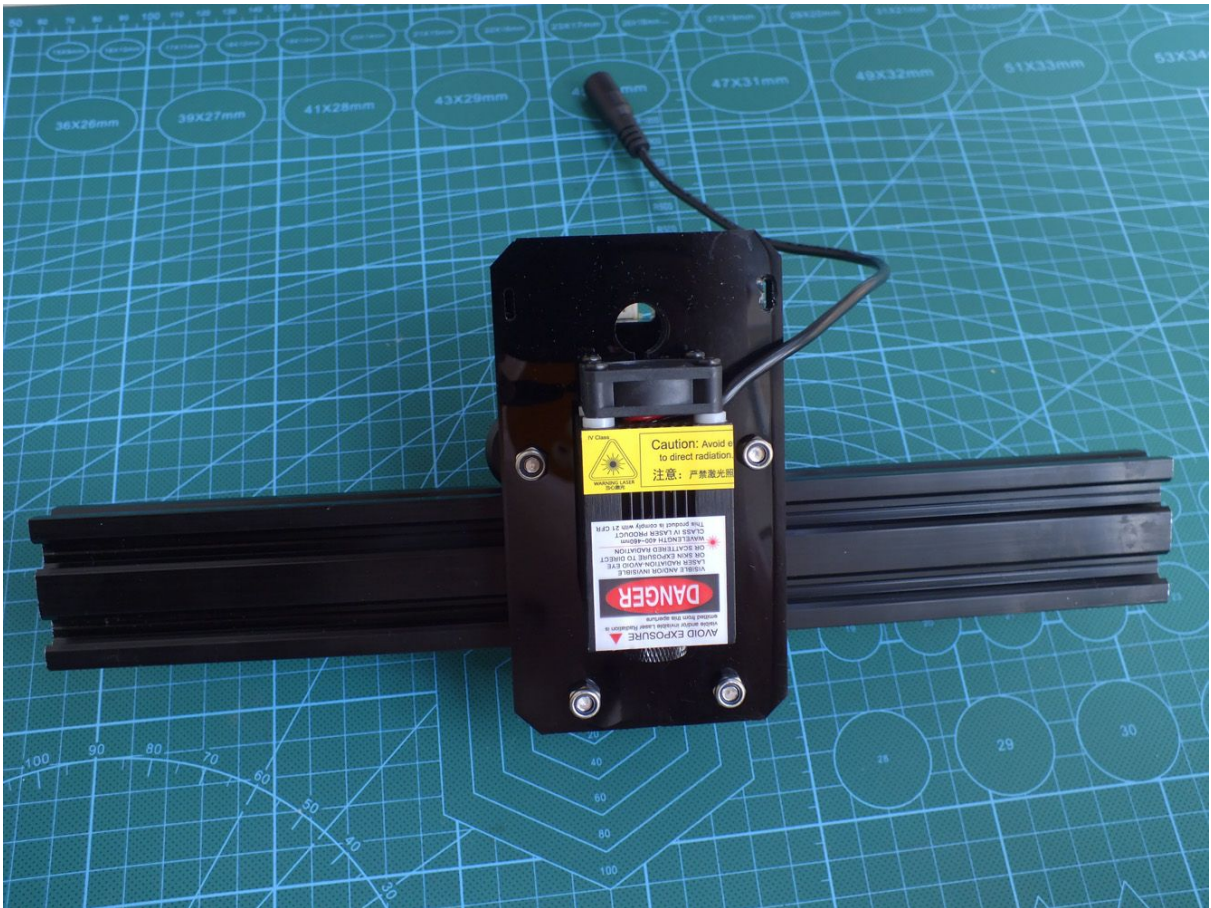


13.-

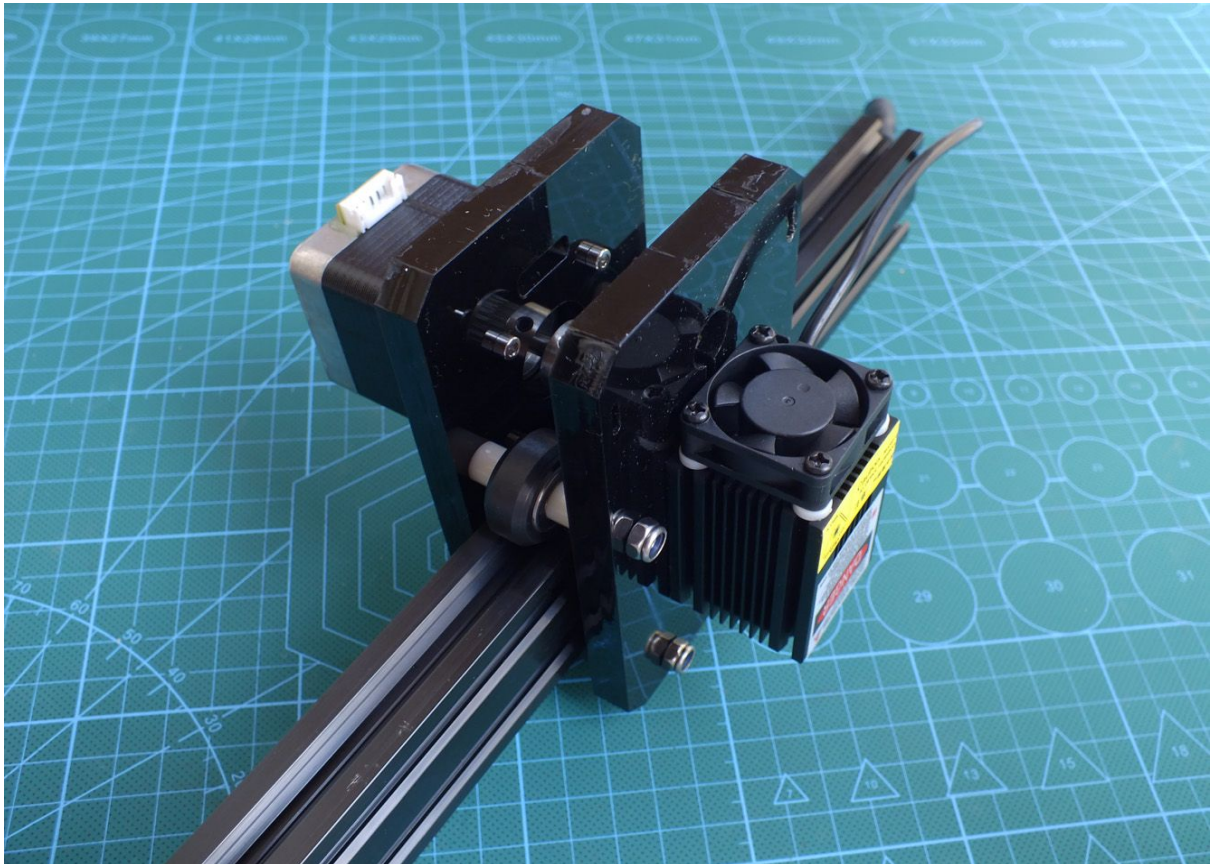


Paso 4: Ajuste de bandas en ejes Y & X

1.-

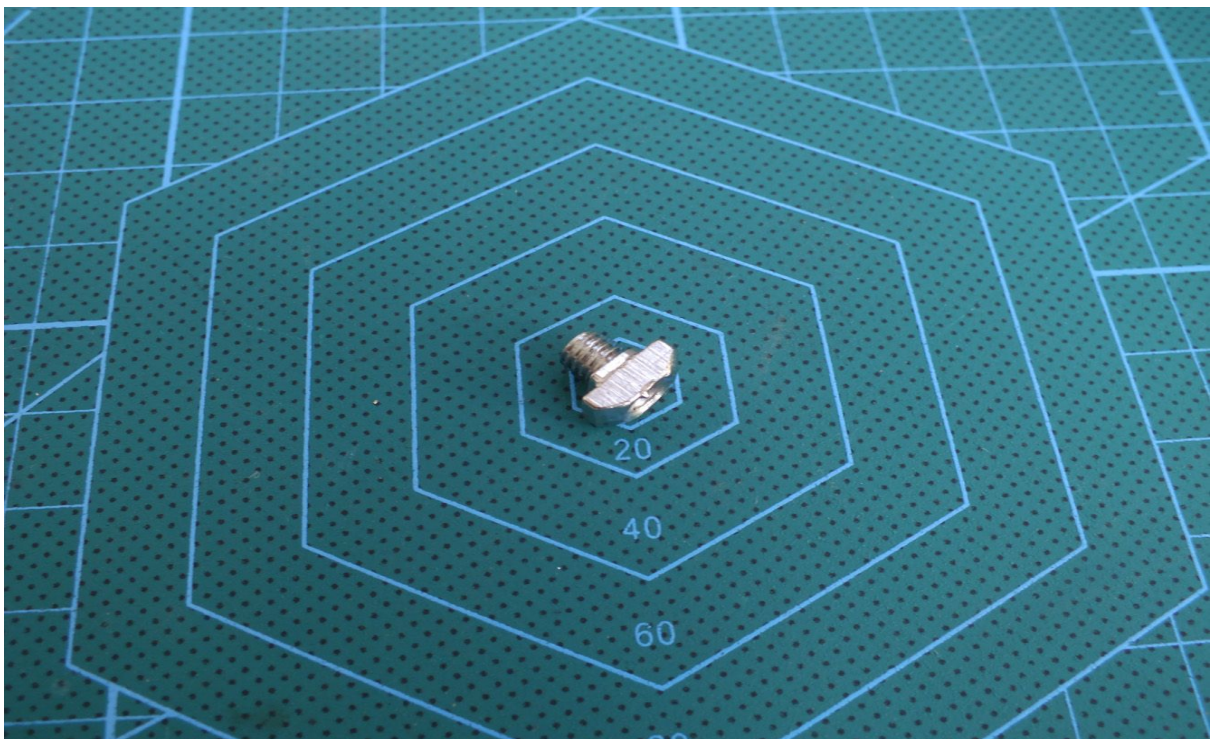


Sagaon

2.-

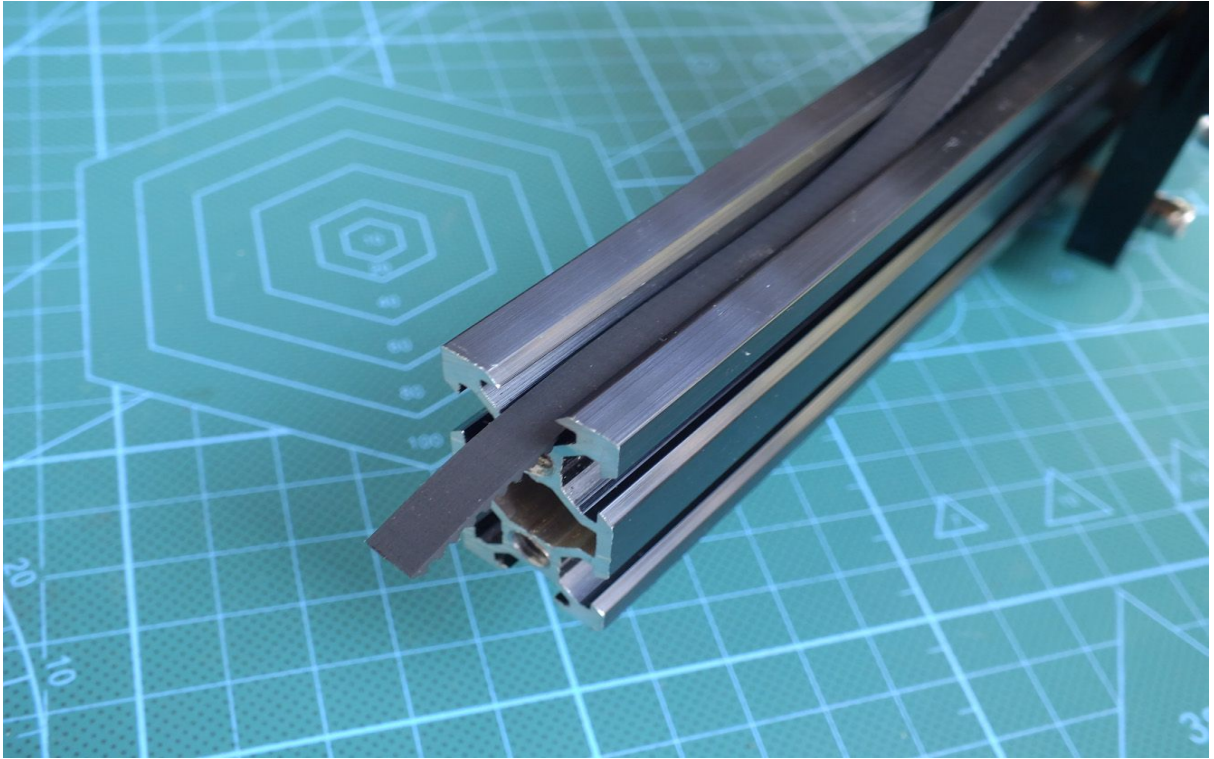


3.-

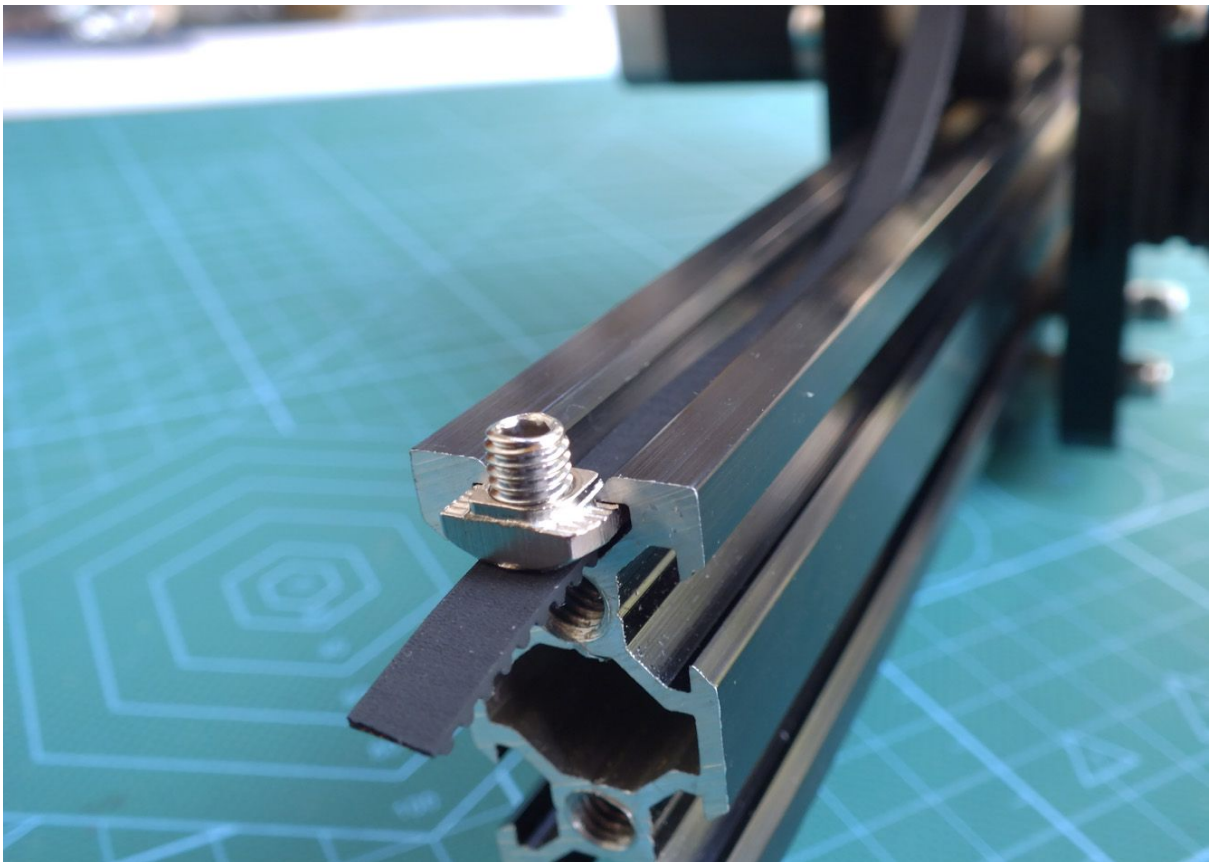


Sagaon

4.-

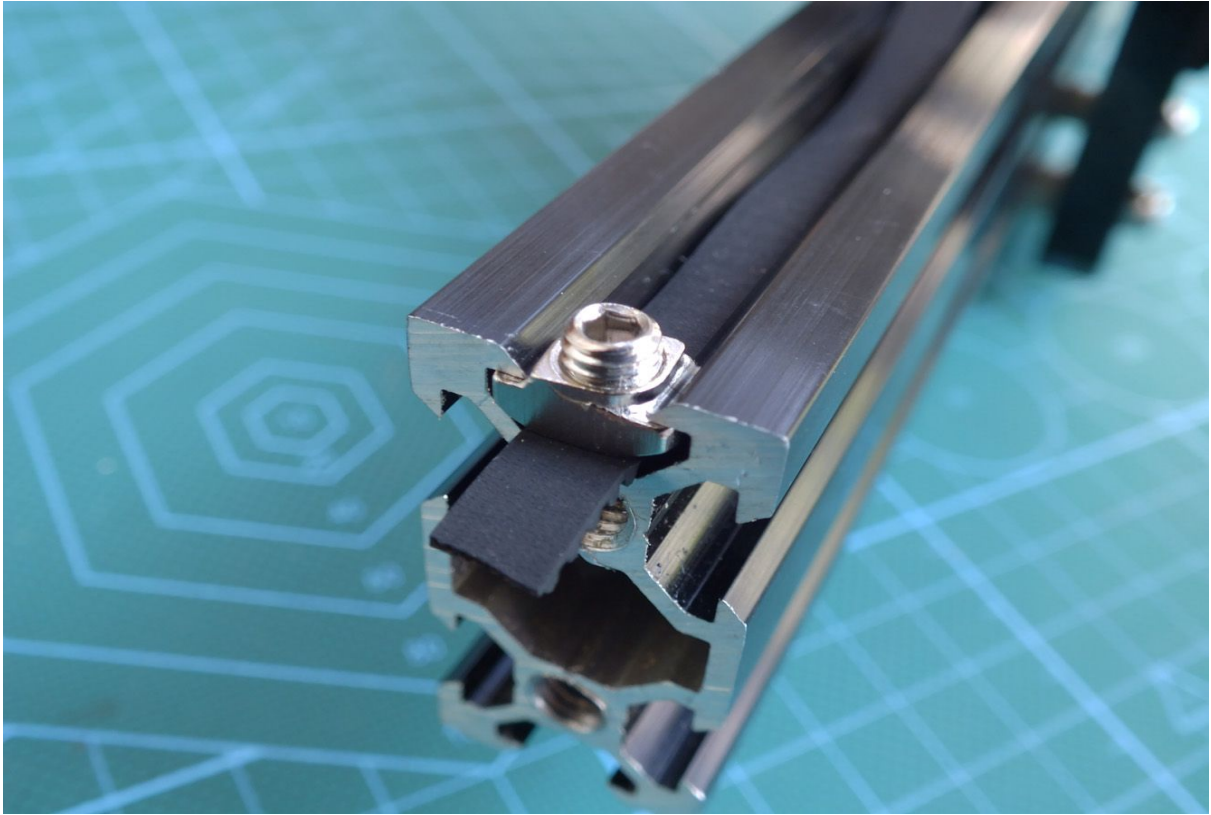


5.-

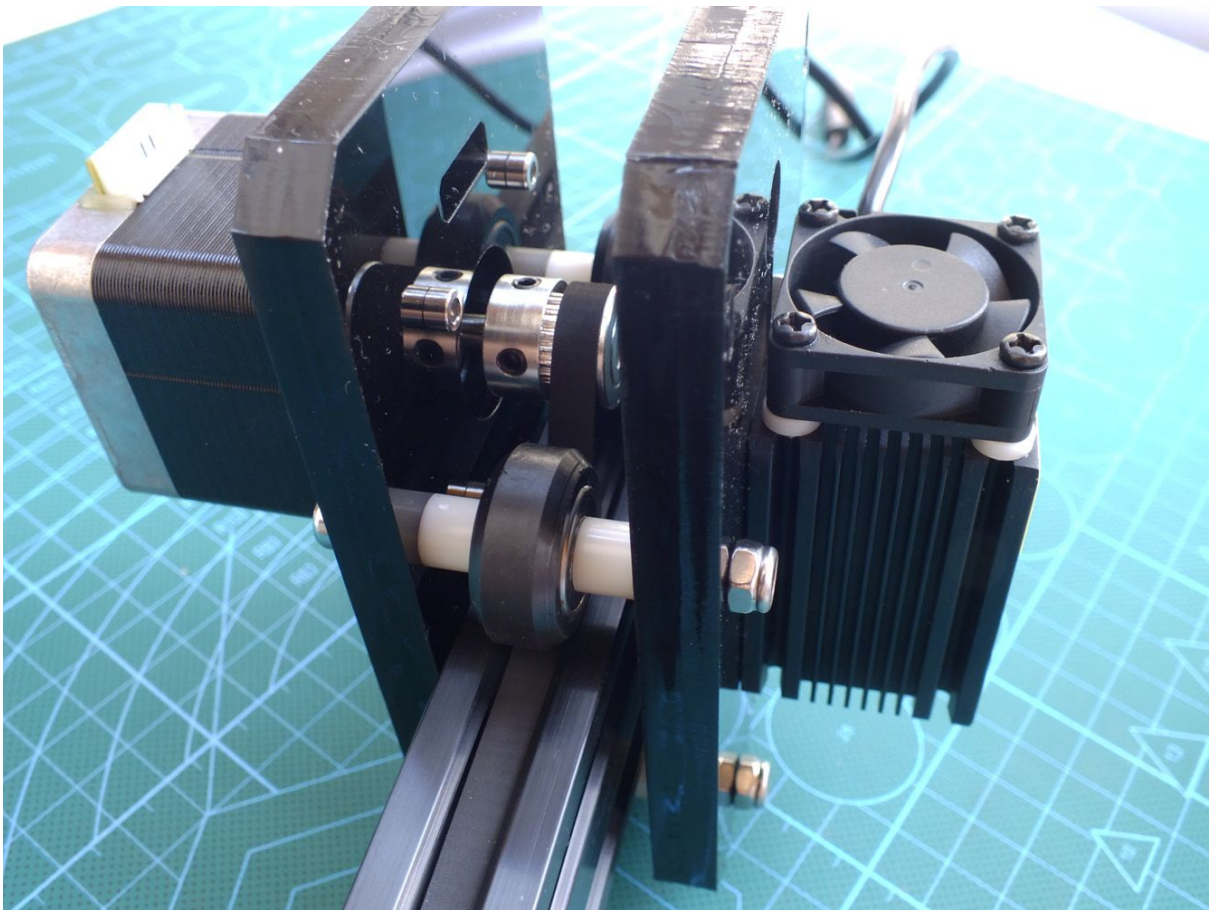


Sagaon

6.-

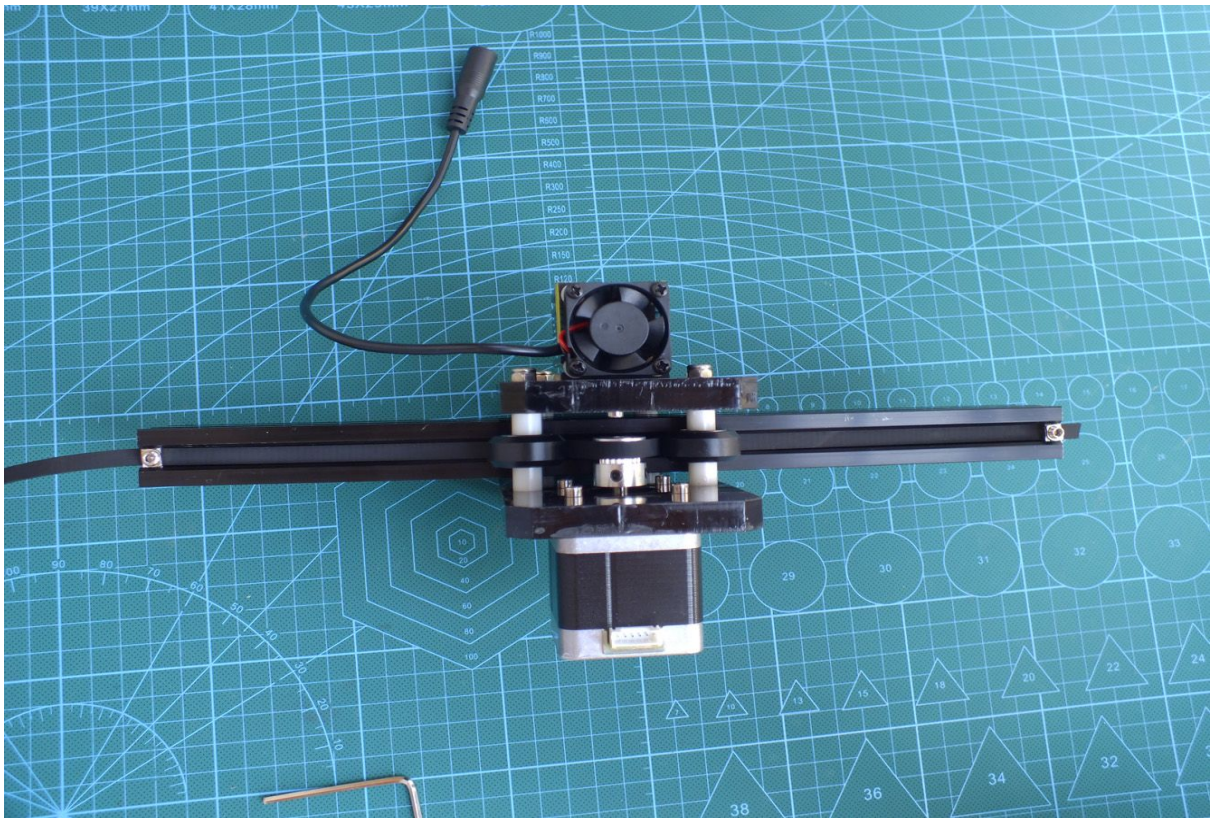


7.-

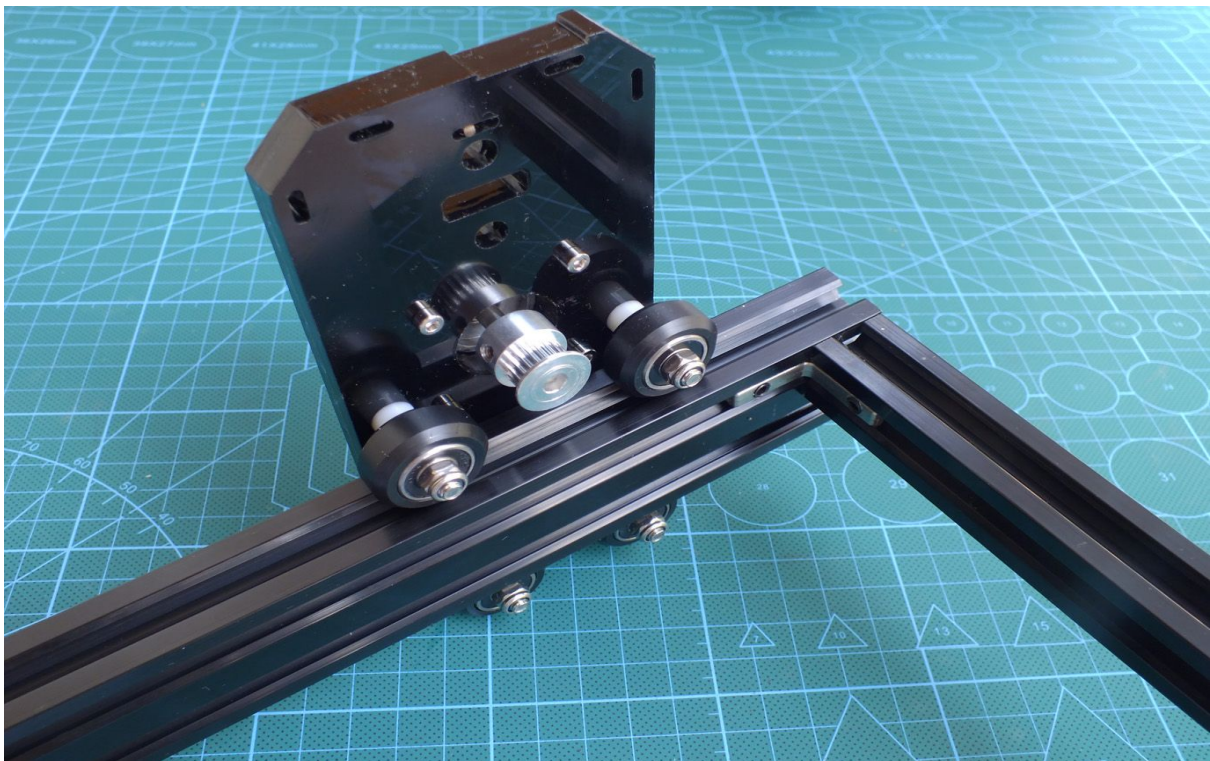


Sagaon

8.-

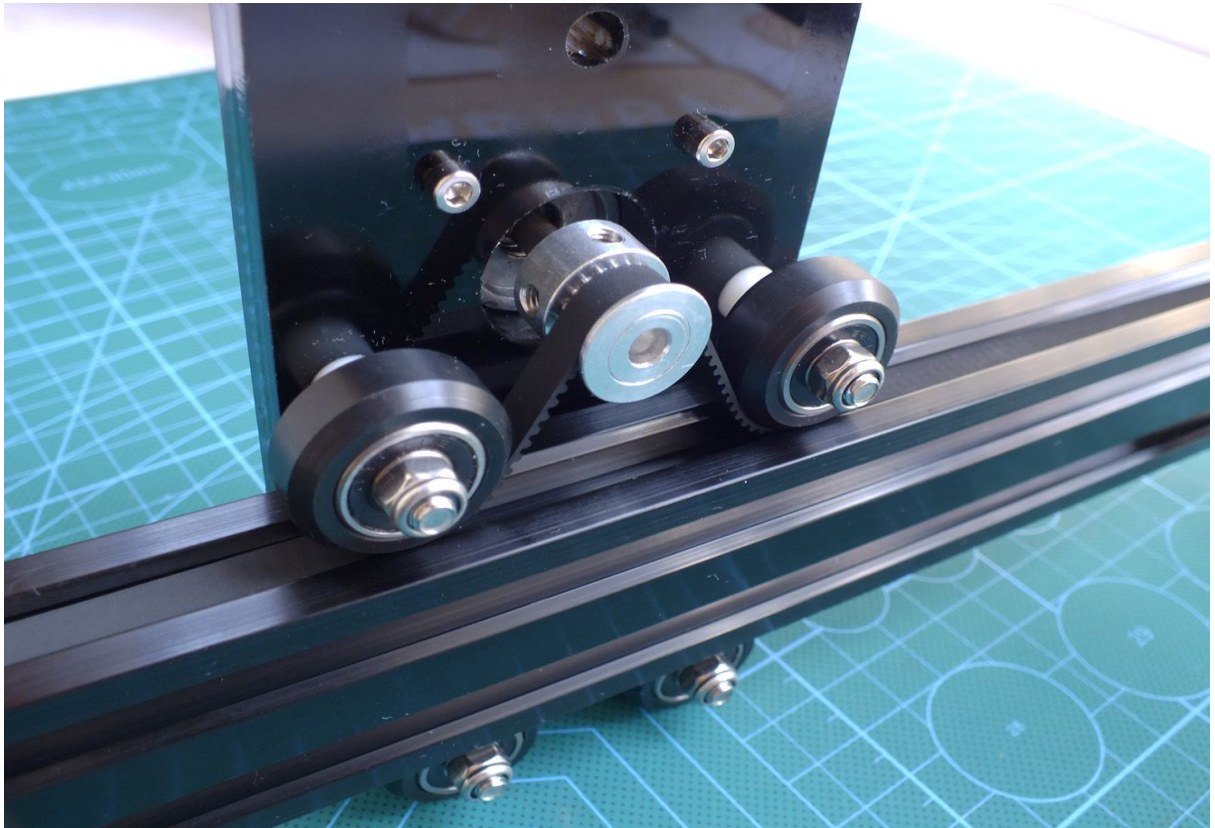


9.-

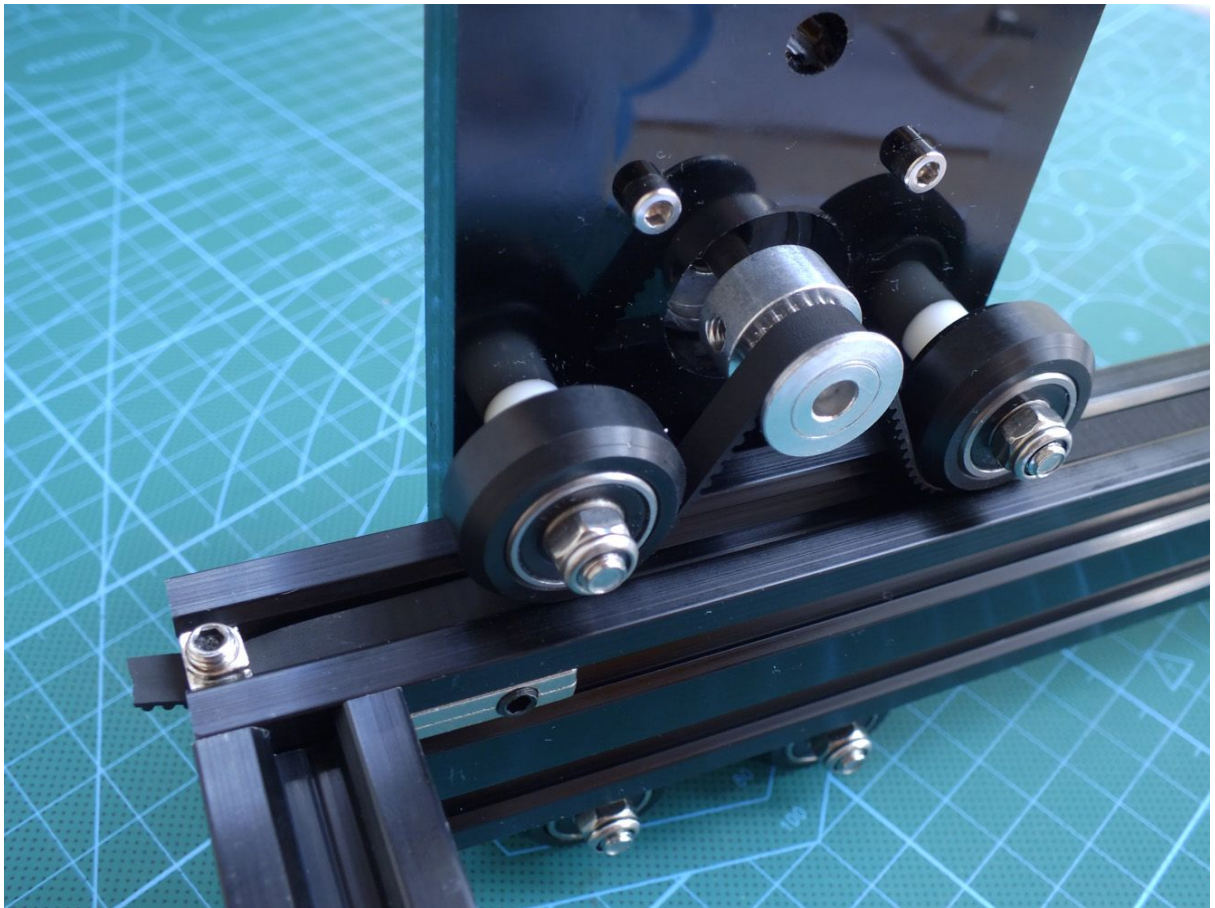


Sagaon


10.-

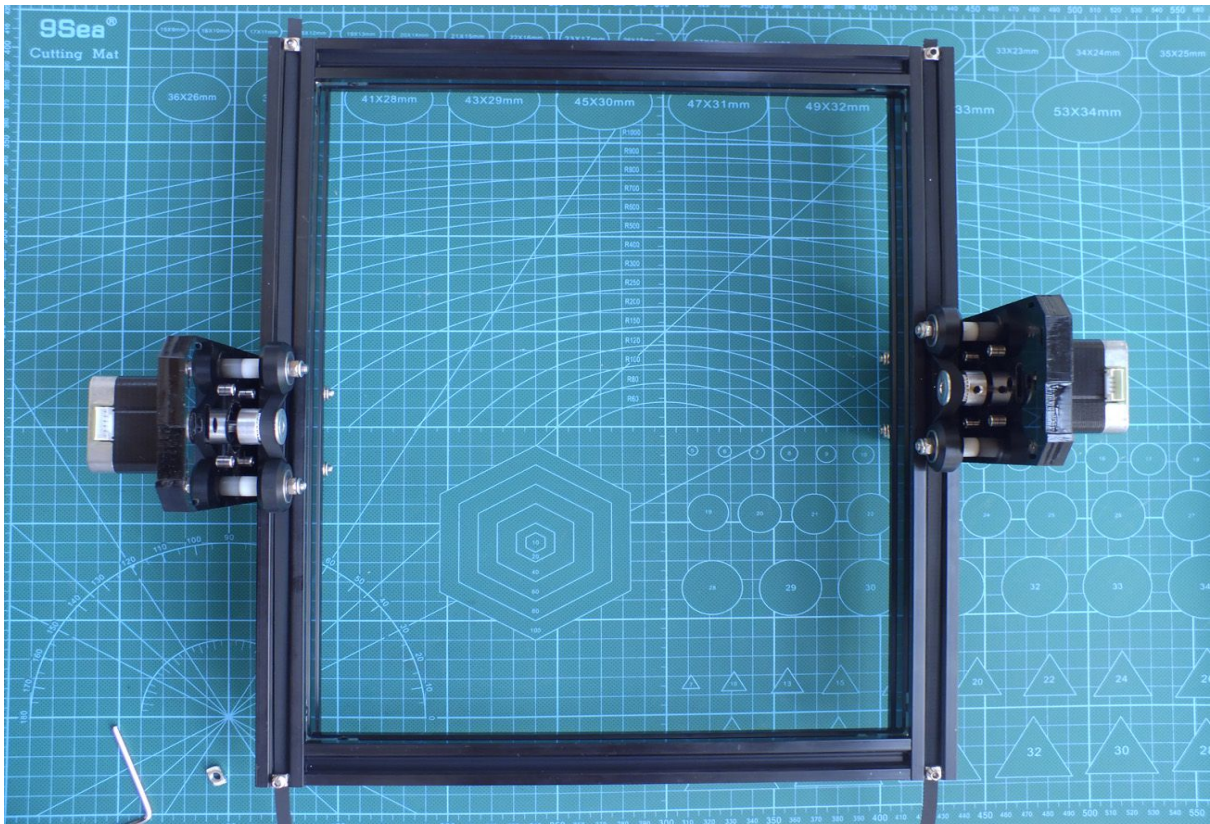

11.-

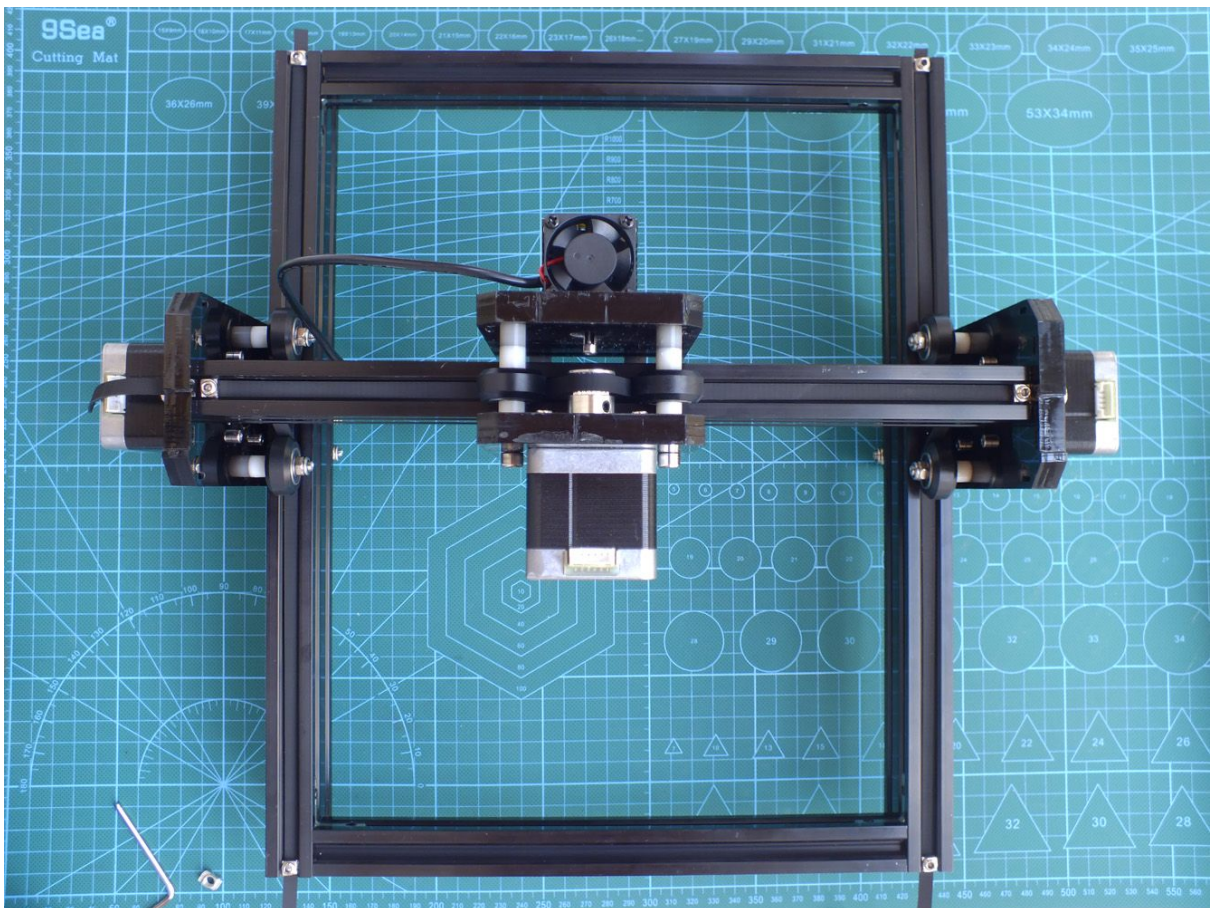


12.-

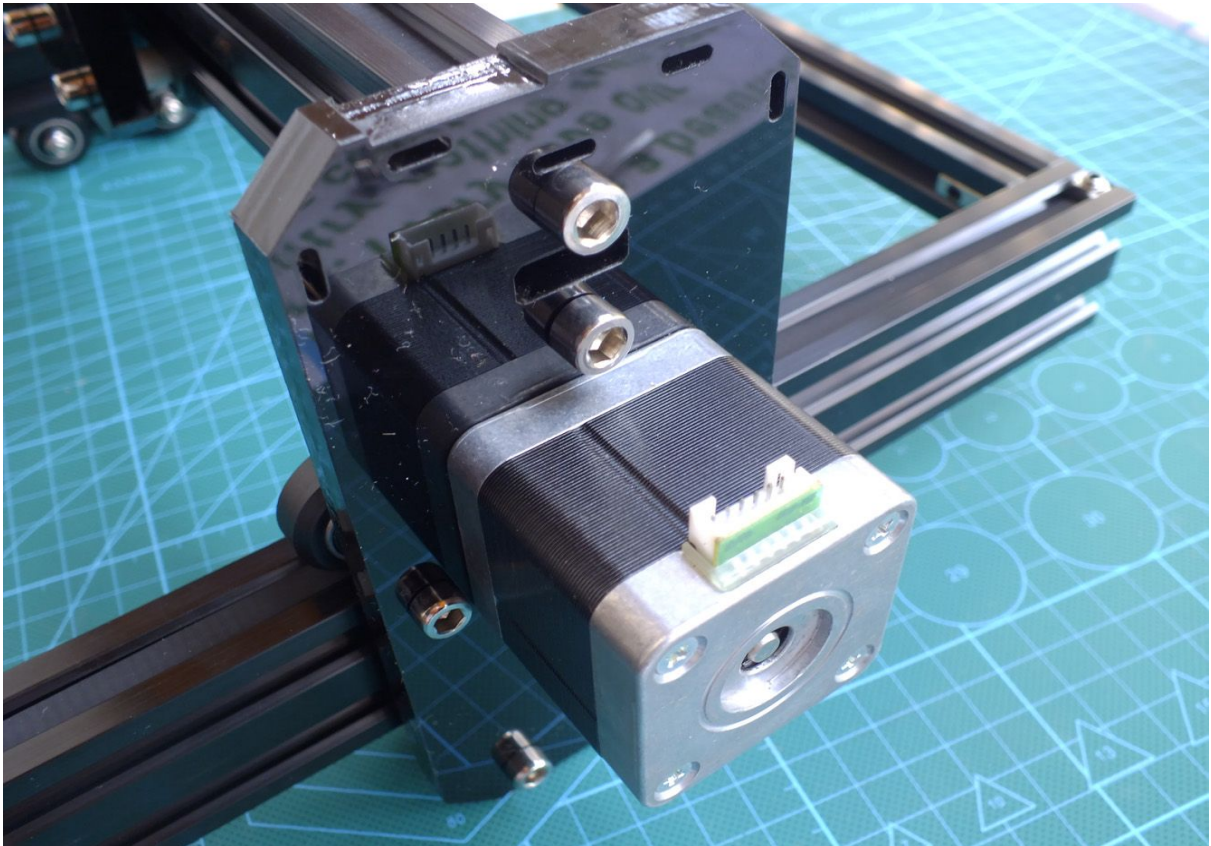


Paso 5: Ajuste placa de control

1.-

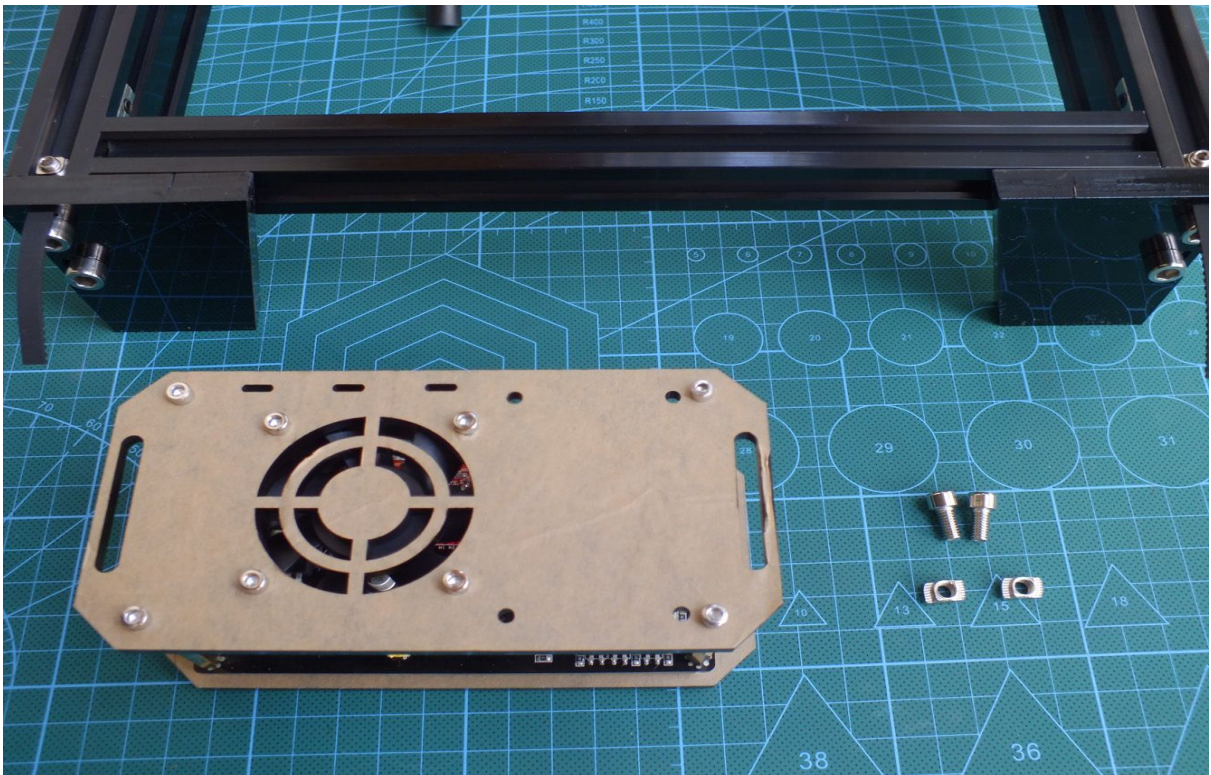


Sagaon

2.-

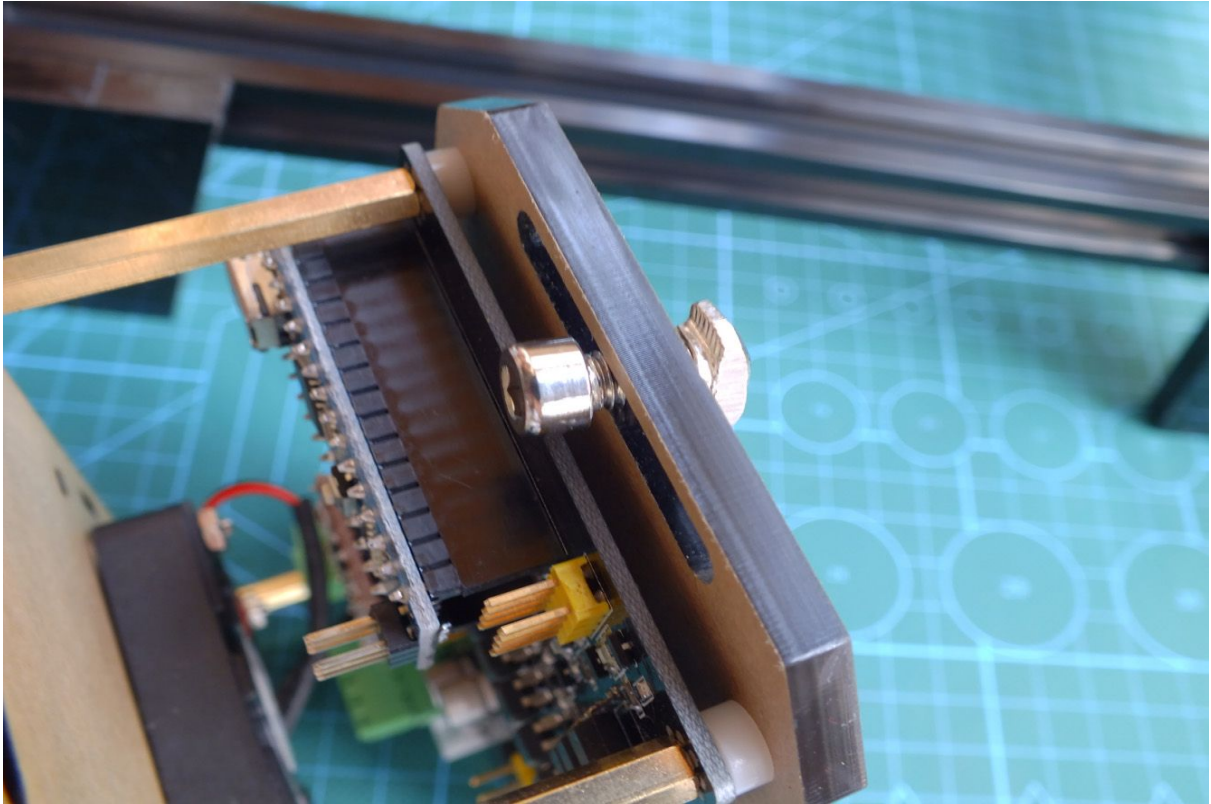


3.-

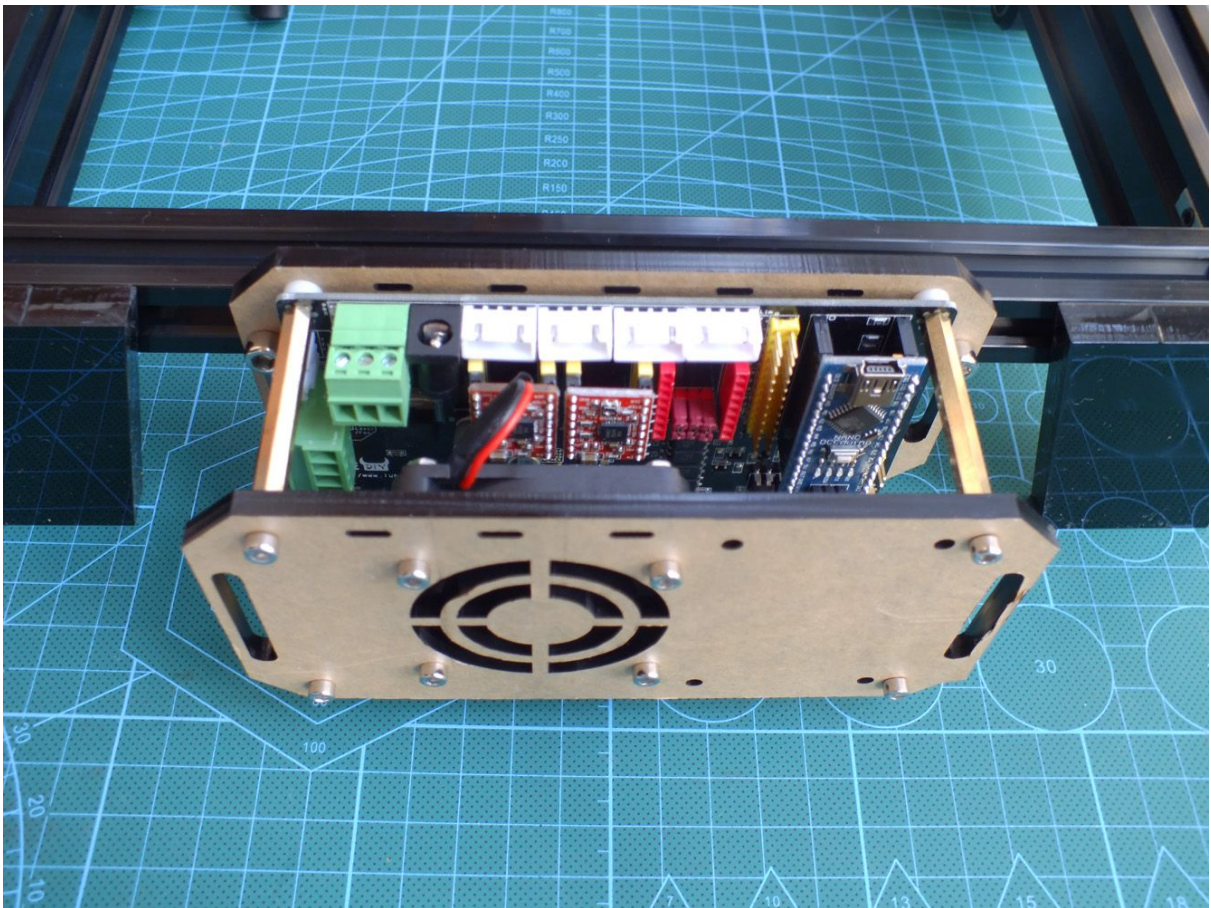


Sagaon

Paso 6: Ensamble motores, láser y esquineros

1.-

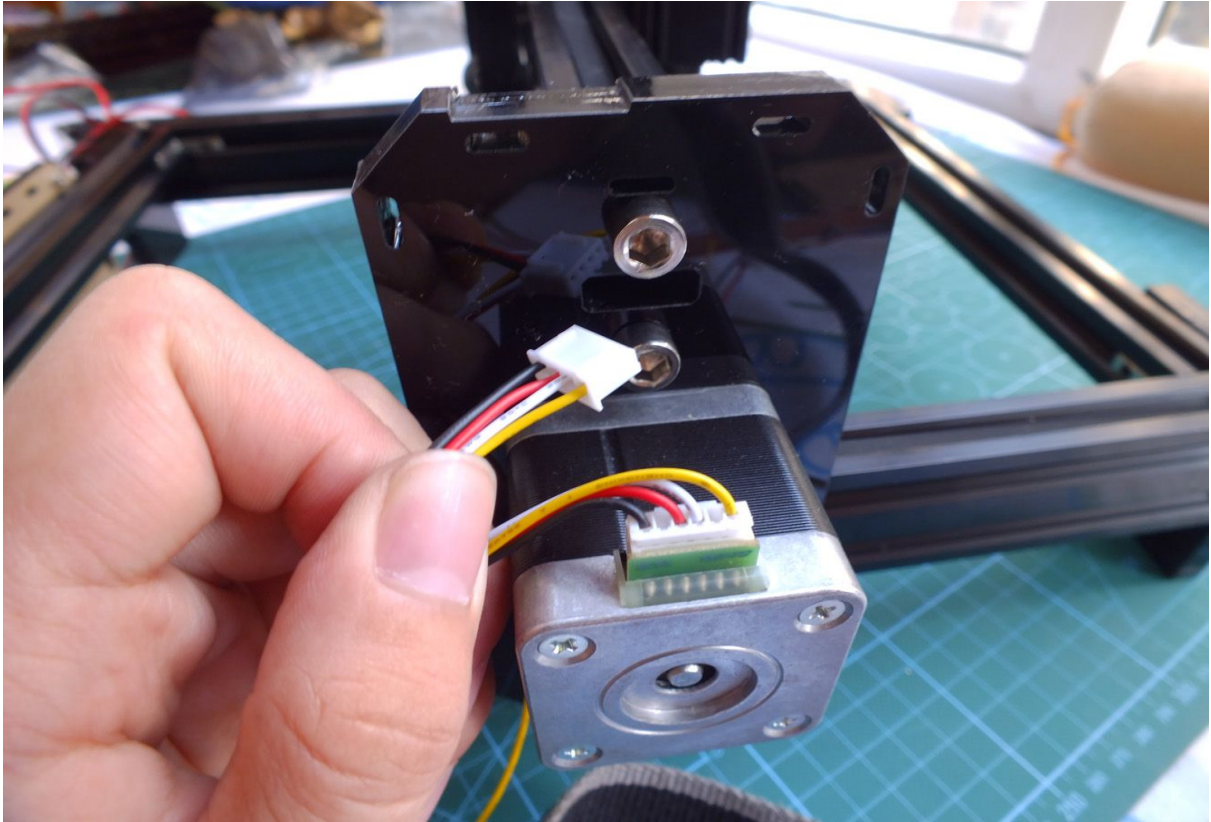


2.-

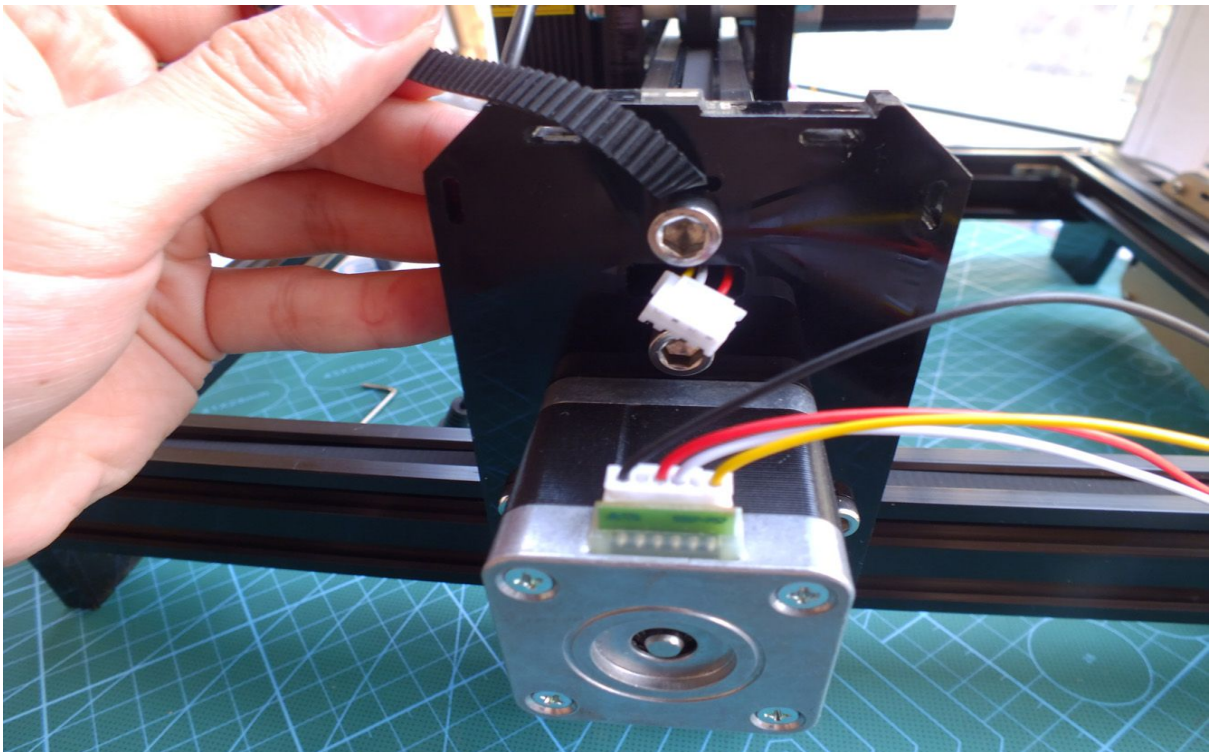


Sagaon

3.-

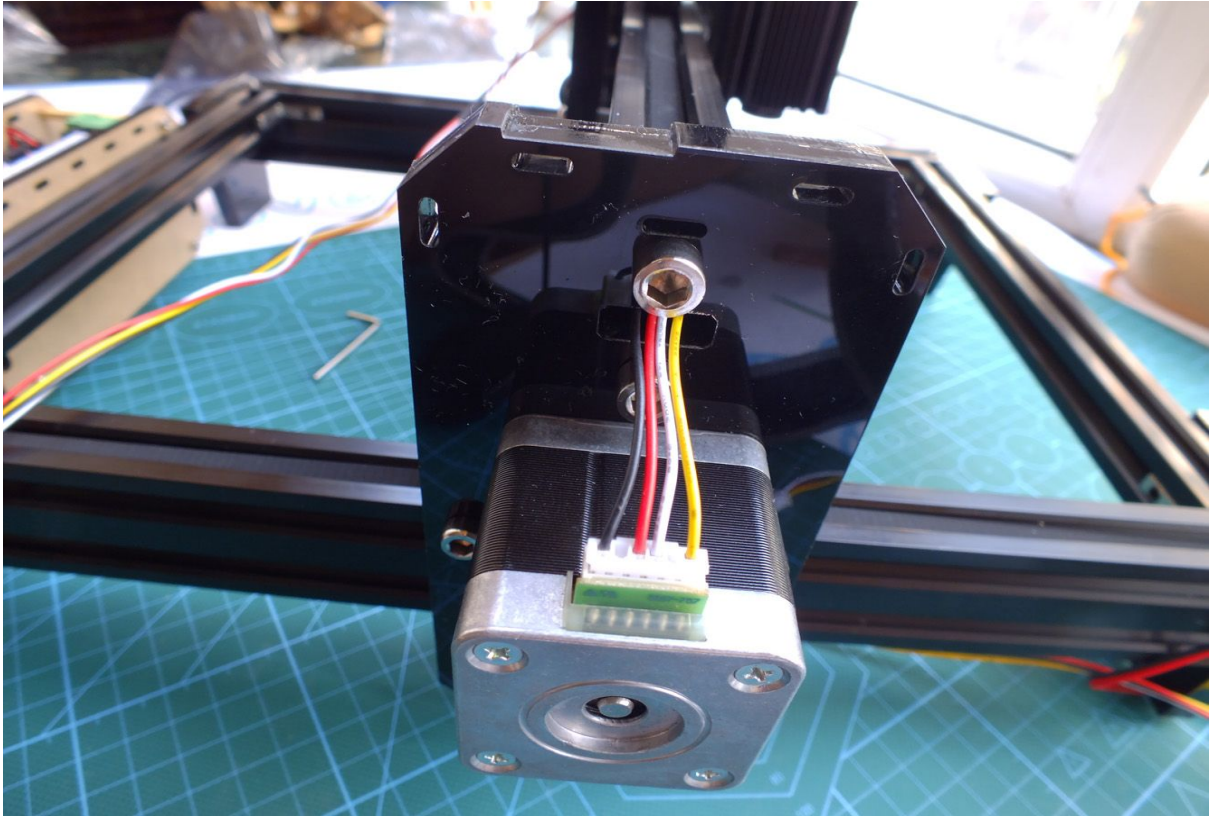


4.-

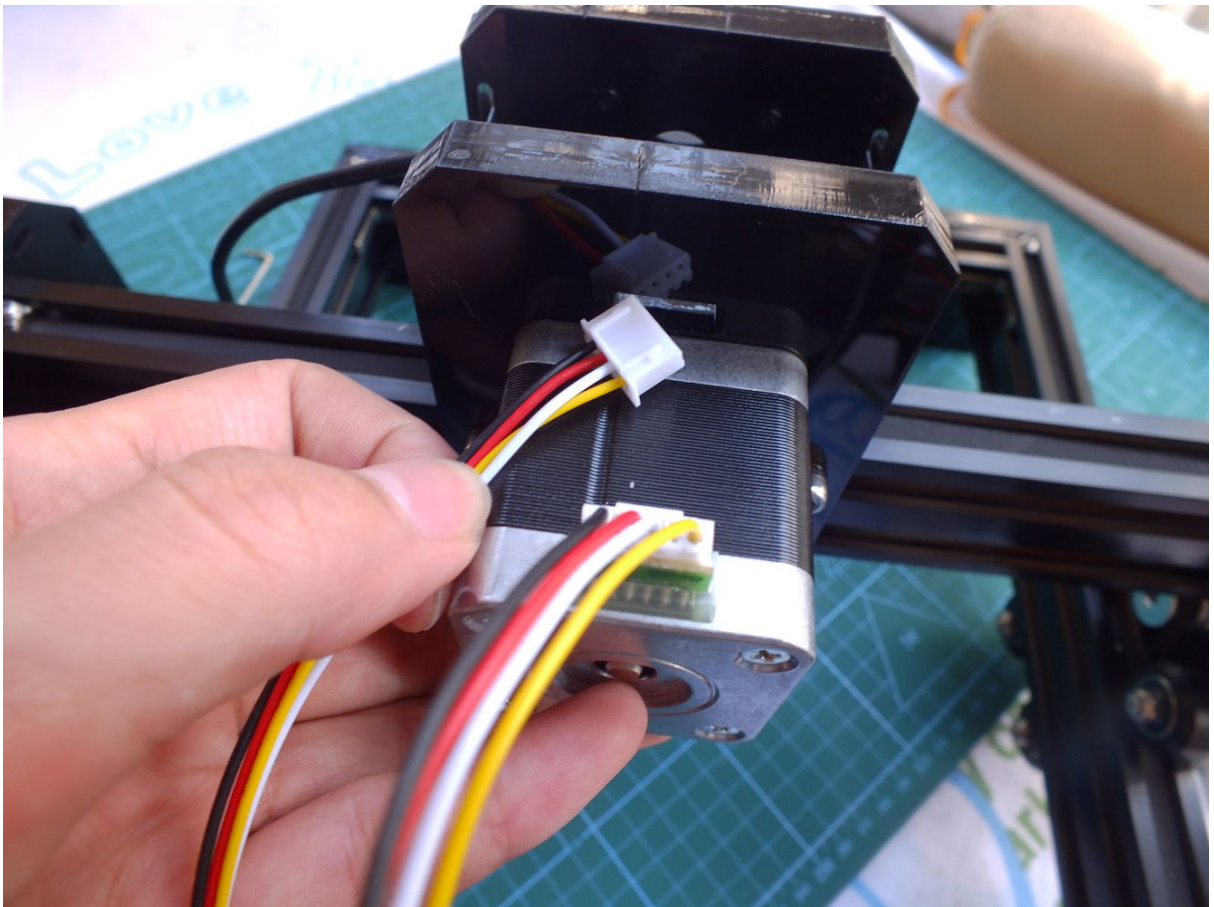


Sagaon

5.-

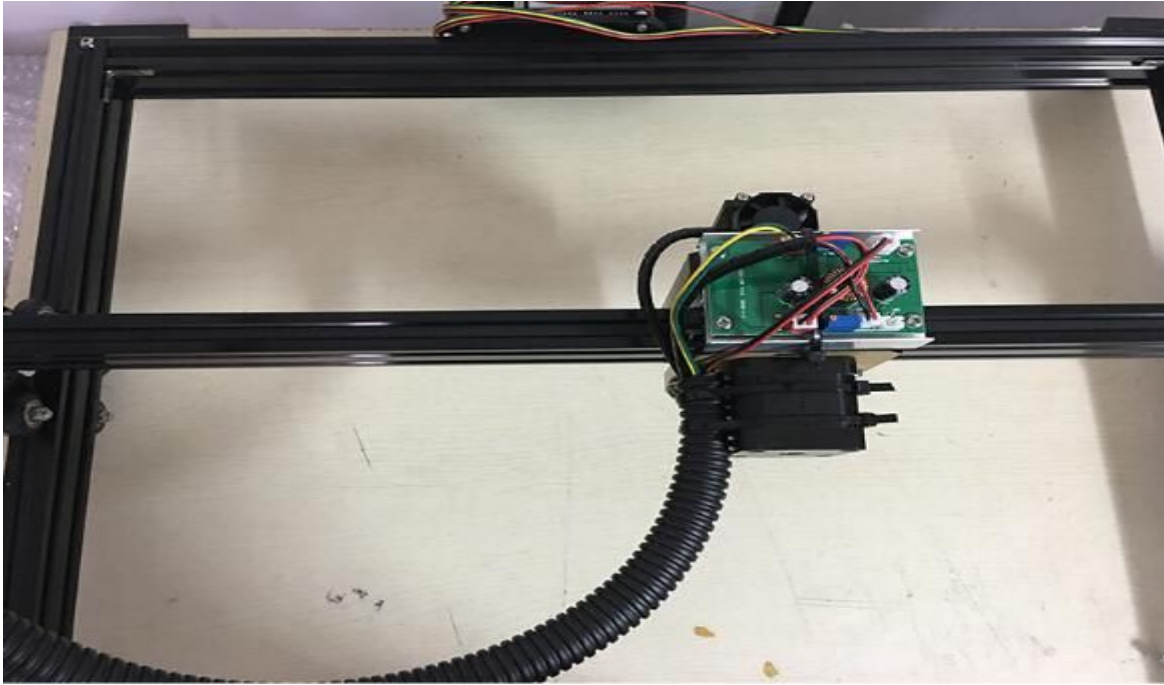


5.1.-

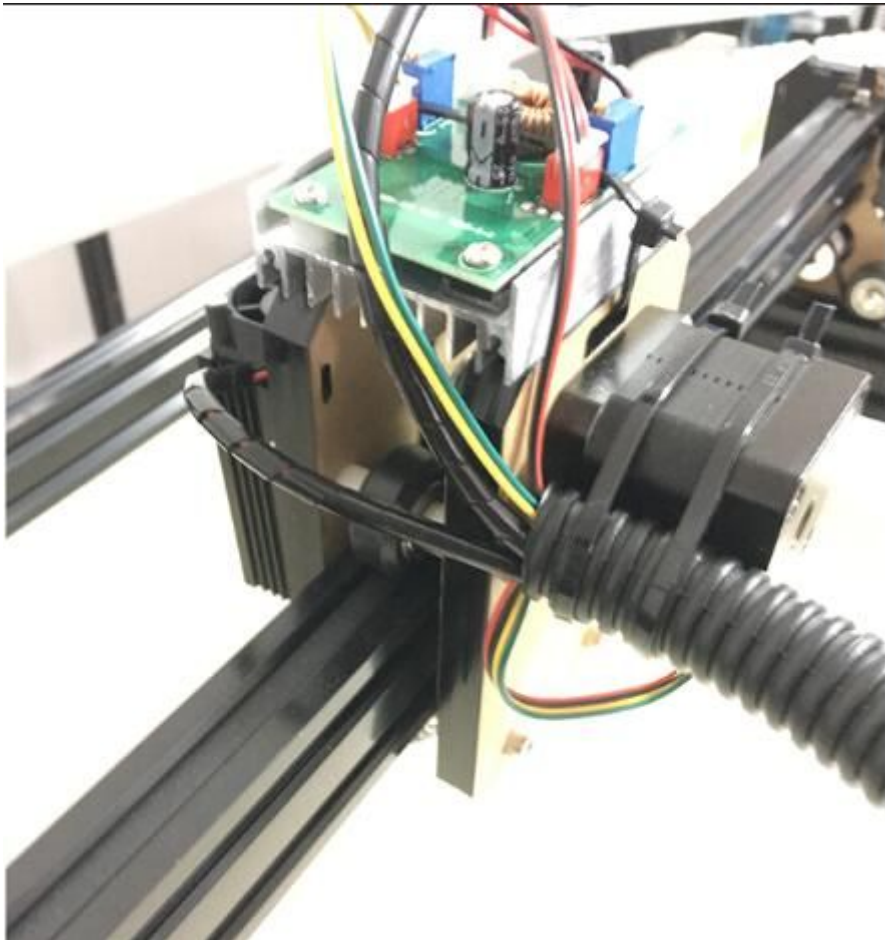


Sagaon

5.1.1

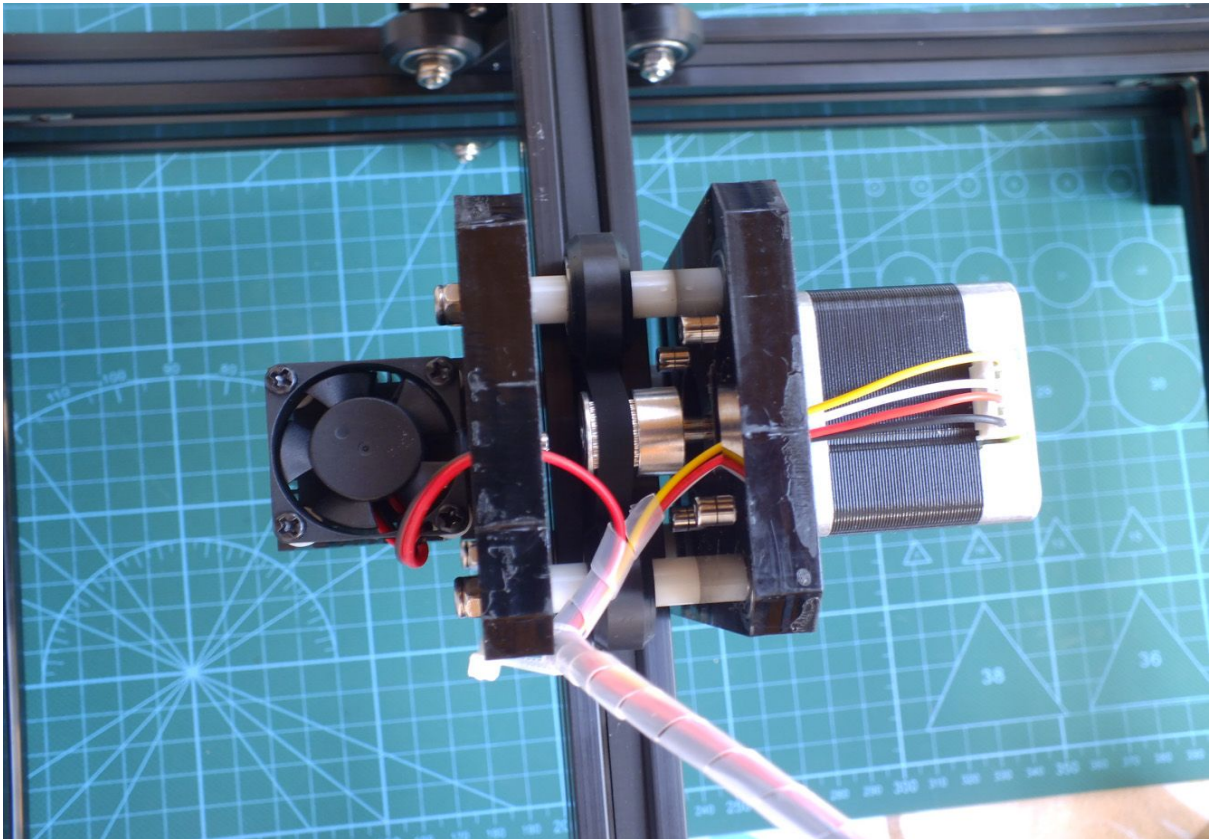


6.-

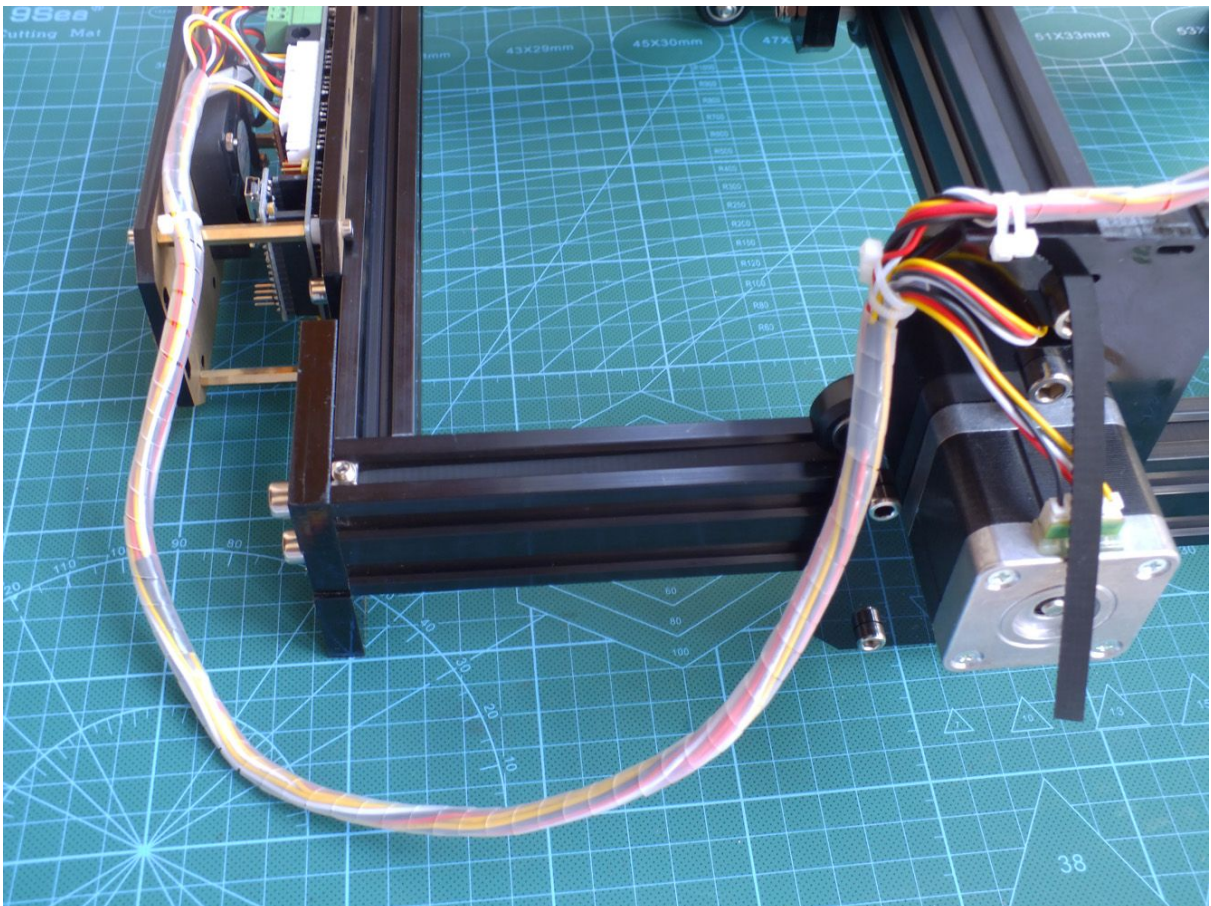


Sagaon

7.-

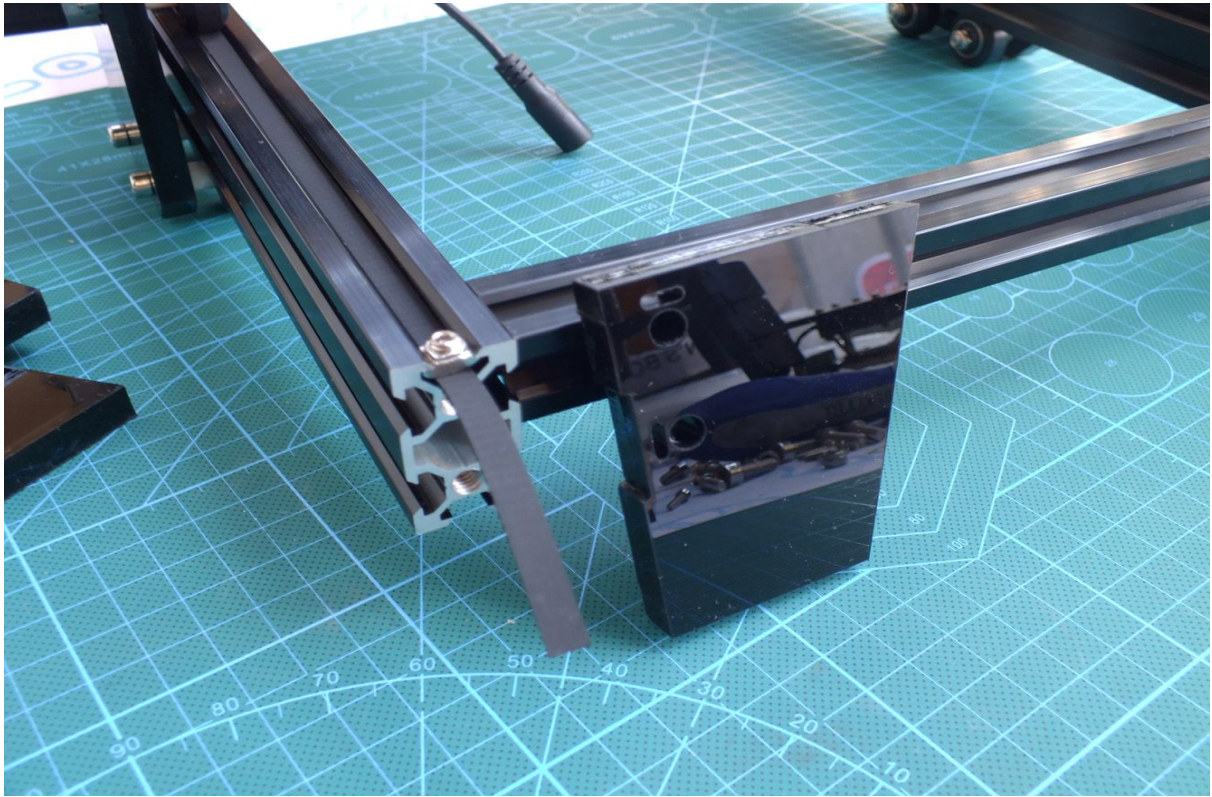


8.-

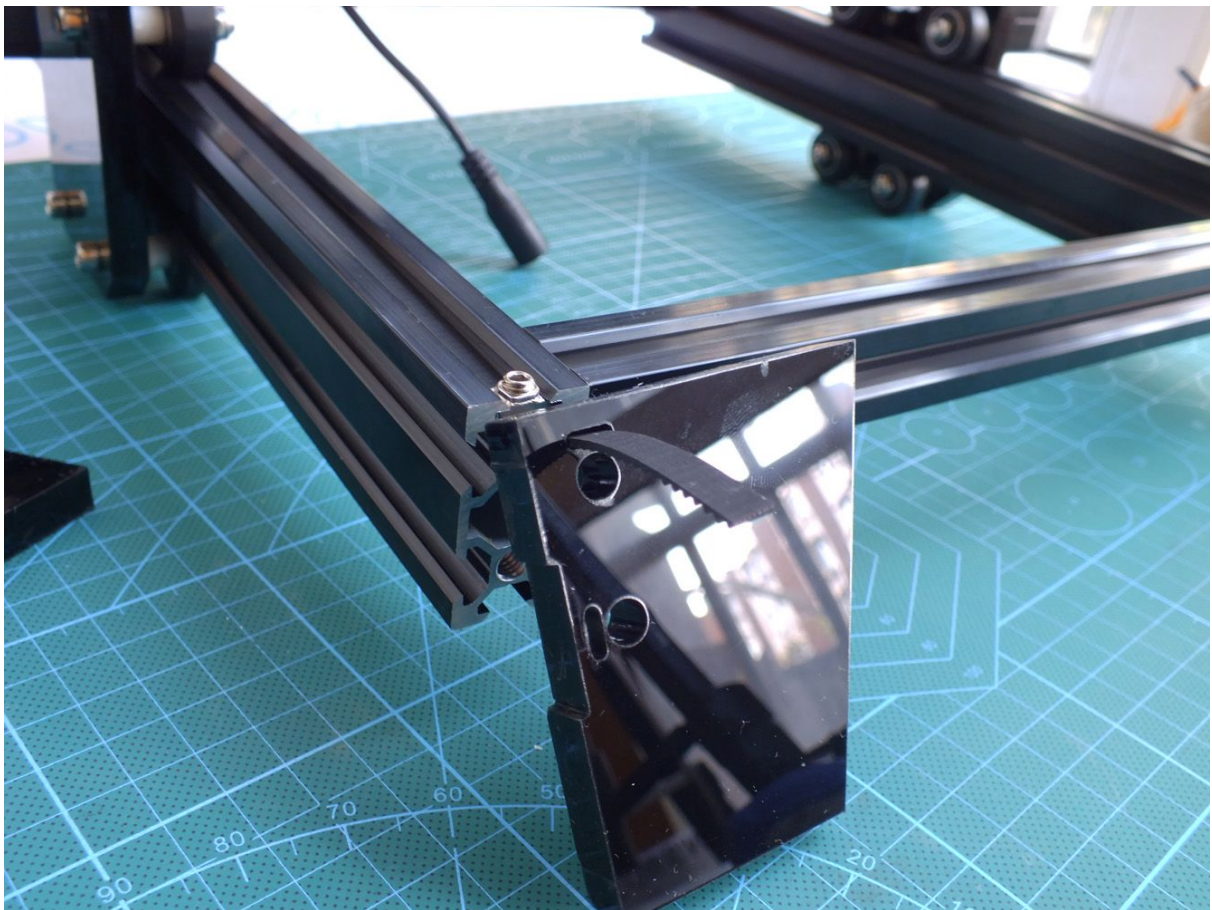


Sagaon

9.-

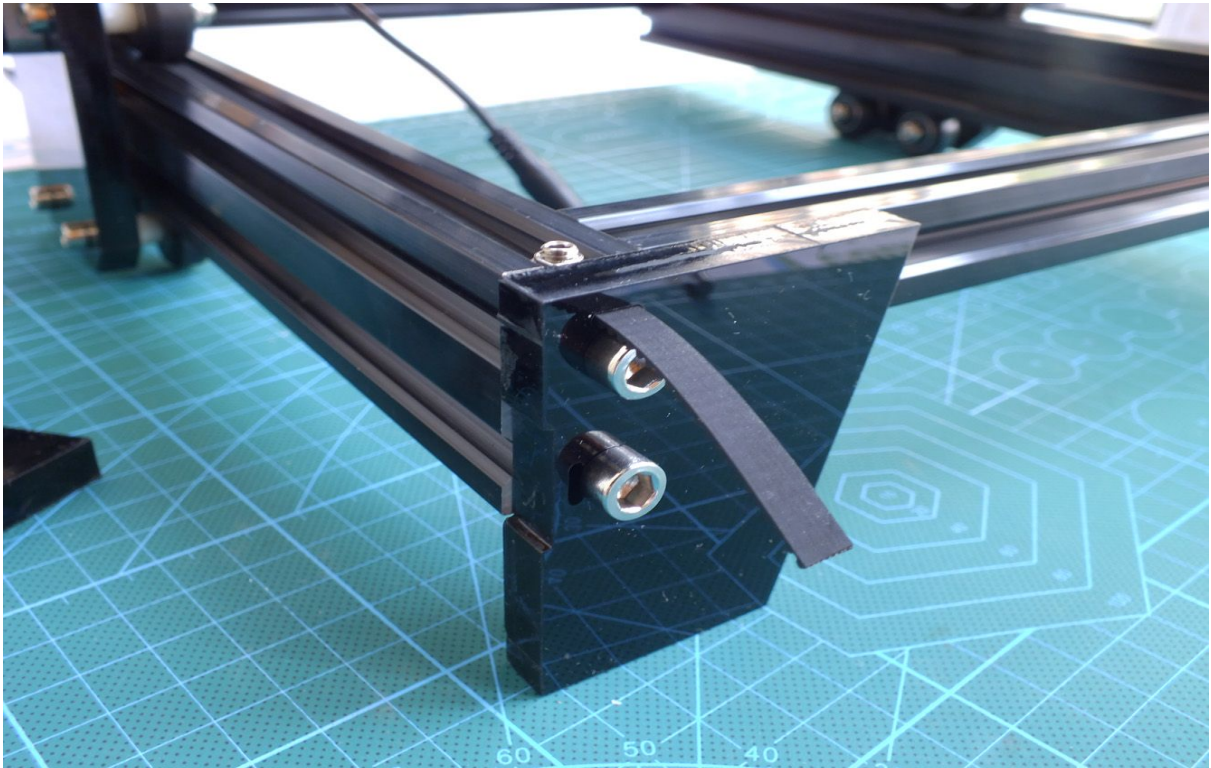


10.-

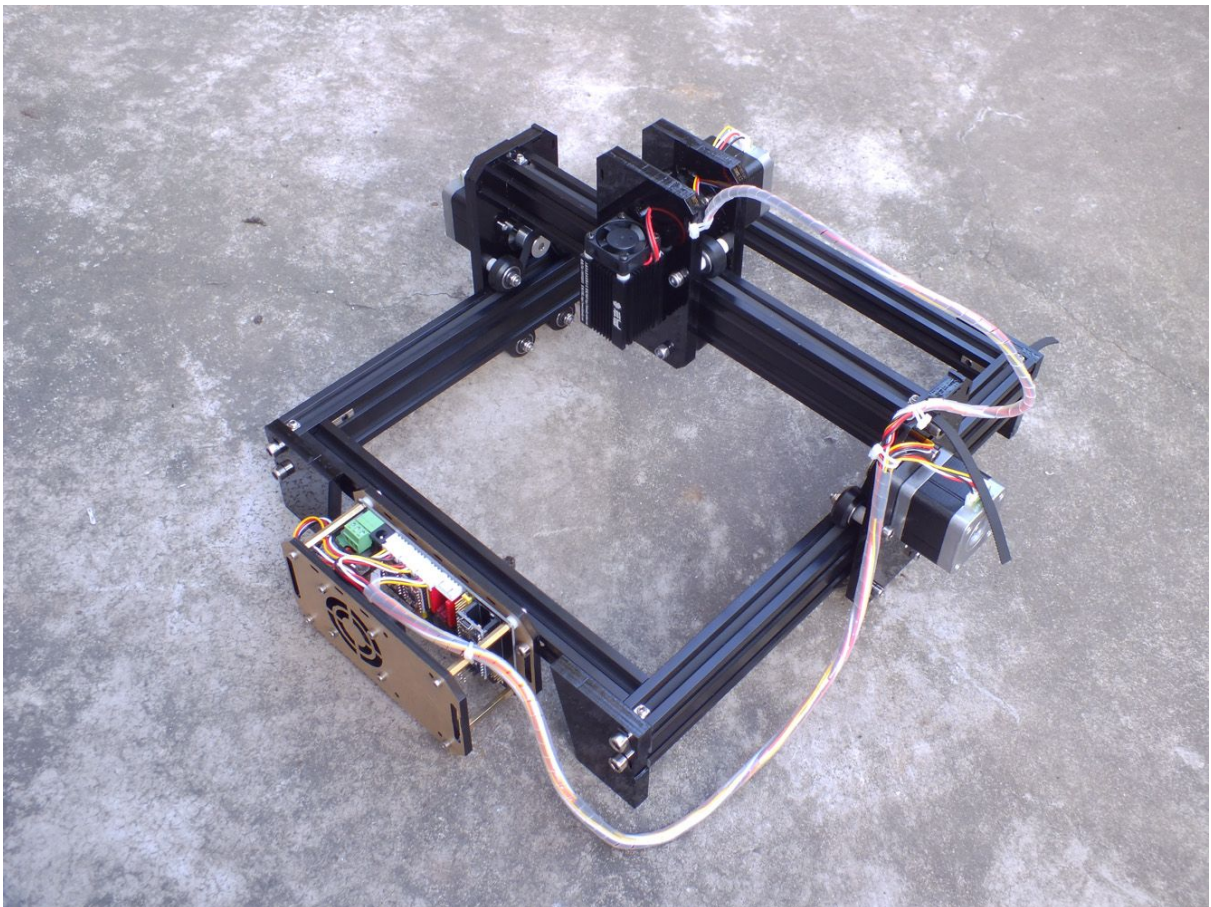


Paso 7: Conexión de Láser

1.- Laser 7w

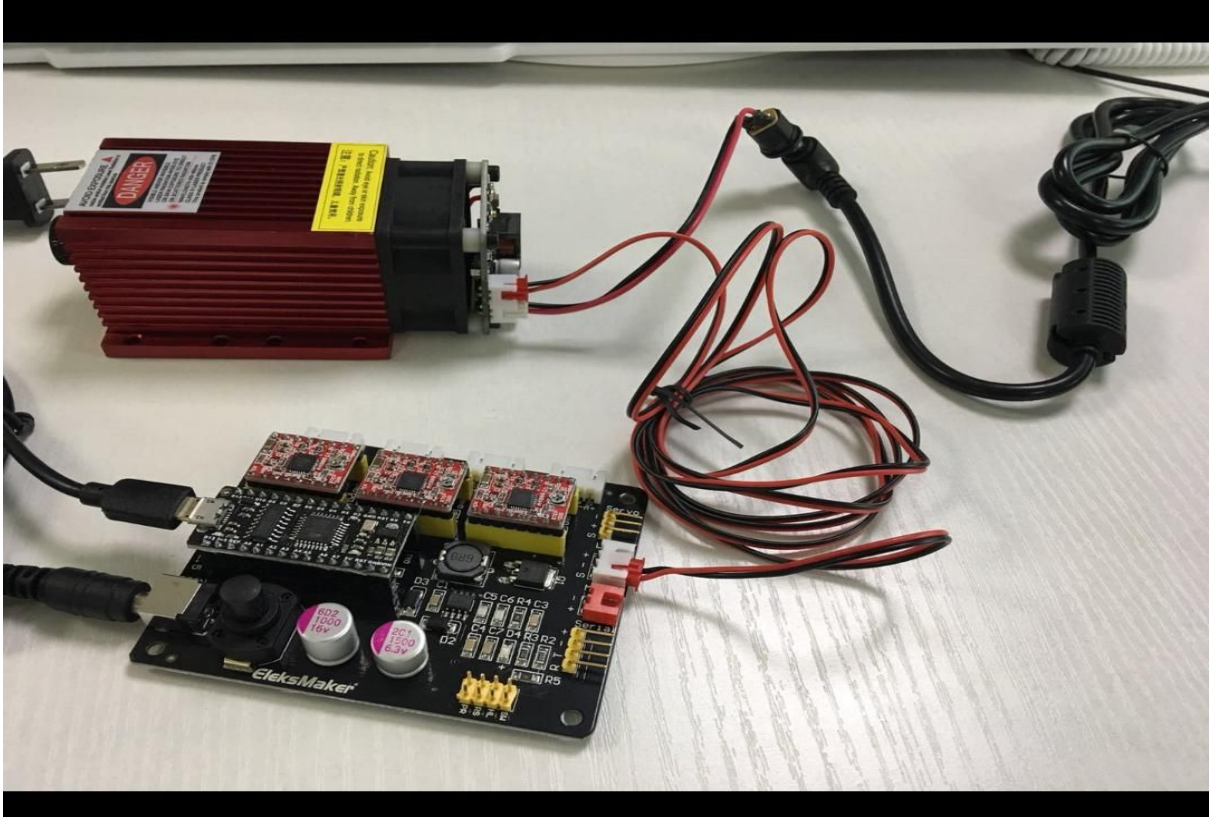

2.- Laser 15w

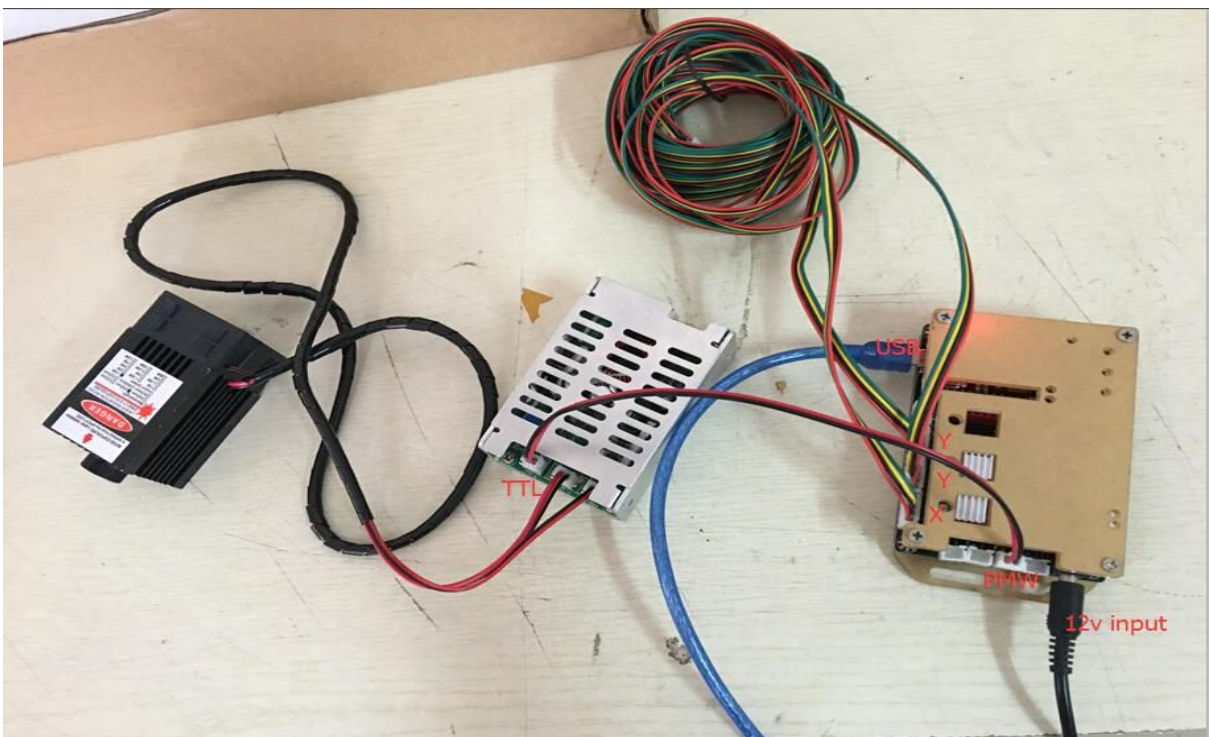

Sagaon

3.-Laser 5.5w

