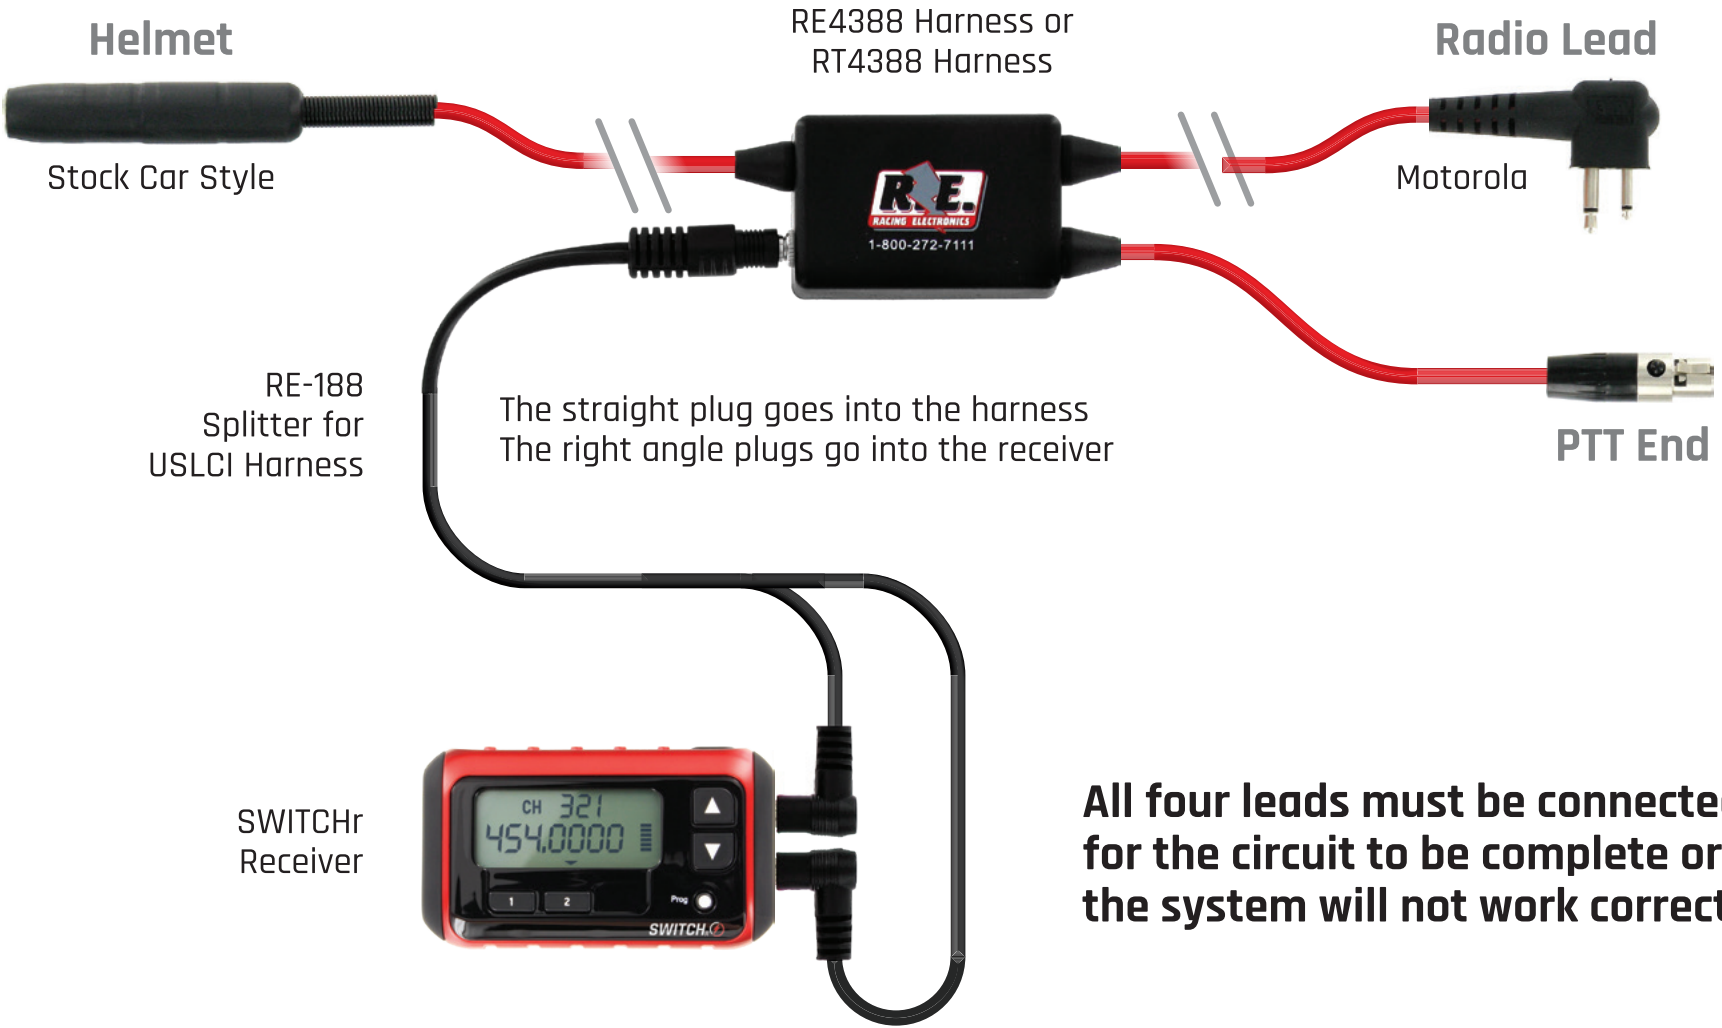

All four leads must be connected for the circuit to be complete or the system will not work correctly

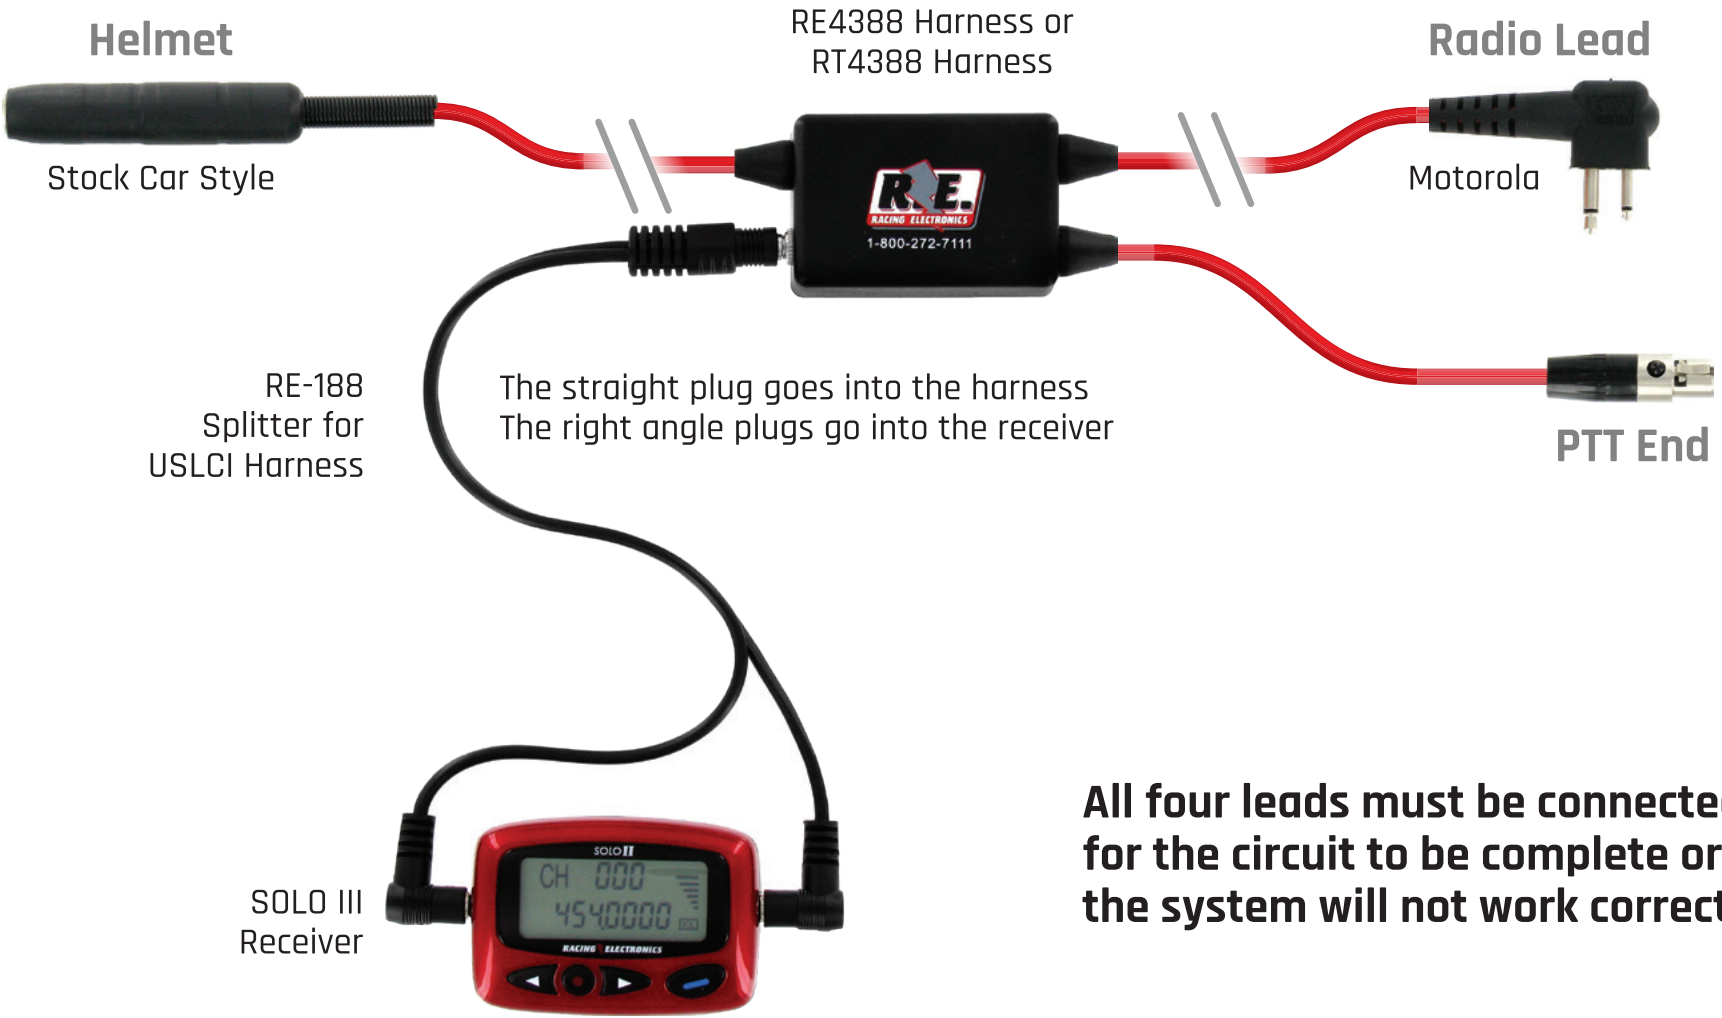

All four leads must be connected for the circuit to be complete or the system will not work correctly