

PAGE	Etape: ENRACHIDIA - OUARZAZATE	KM TOTAL : 674,67
1	Sélectif - DEPART SS 4-ARRIVE SS 4	KM SECTEUR : 404,99
0,00		DSS
0,00		C 200°
0,44		180°
0,88		TD
0,44		BALISE TO MARK
1,20		2 X
0,32		C 190°200°
4,34		TD
3,14		C 235°

ex: Dakar

PAGE	Etape : Nador - Bouarfa	km liaison : 0
1		km Sélectif : 461,75
18,02		TD direction Oujda
5,45		
12,57		LANE
3,70		NADOR
8,87		RLT
5,98		40 NADOR
2,89		TD direction NADOR
2,89		Total et Mobil
0,00		Sortie Port AD et ... direction NADOR
0,00		CD




ex: Amitié, Touareg

PLEASE NOTE


Our RB730 and RB750 Rally roadbook holders are designed to handle both regular and reverse roadbooks. No modifications are required.

The modifications suggested in this document are intent to make use easier and enhance RB730 and RB750 Rally performance with reverse roadbooks


A. Switch motor polarity to regular remote operation : reverse roadbook move forward (down) when pushing the switch forward

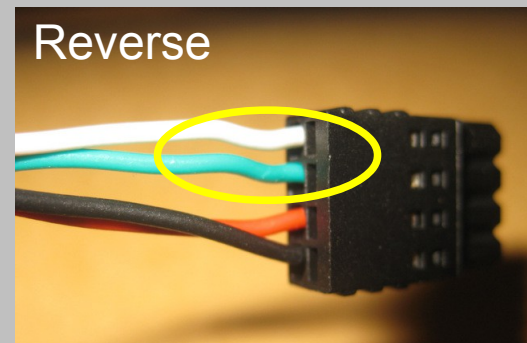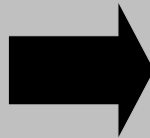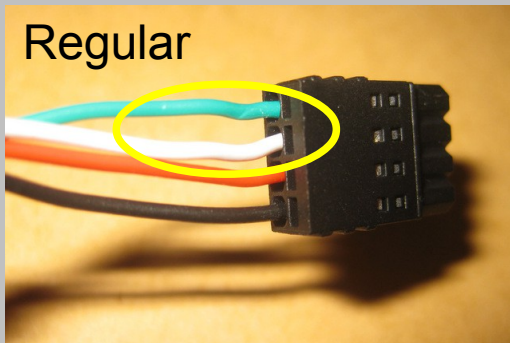


a. Unplug the switch plug from the electric board

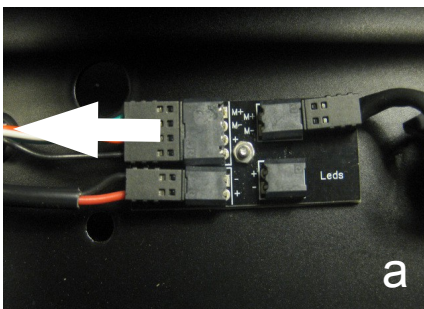


b. Insert a screwdriver (<=2mm) in the small square hole above each wire and pull the wire from the plug

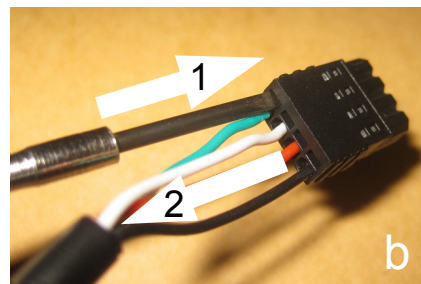


c. Switch the wire positions and insert each wire simply pushing it into the plug

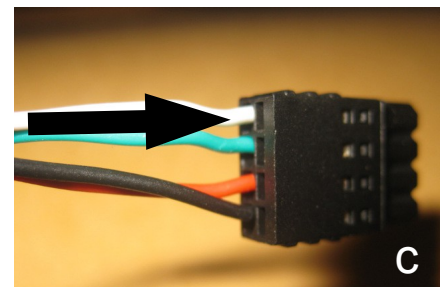

d. Plug it again into the electric board

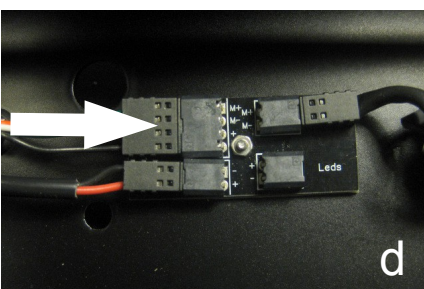


for RB730 version A (before Nov. 2012)
Switch blue and white wire position in the internal electric

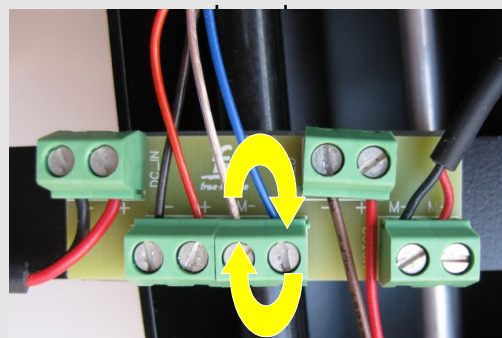


B. Switch driving belts to apply more pulling force to the (lower) pulling axle

Regular

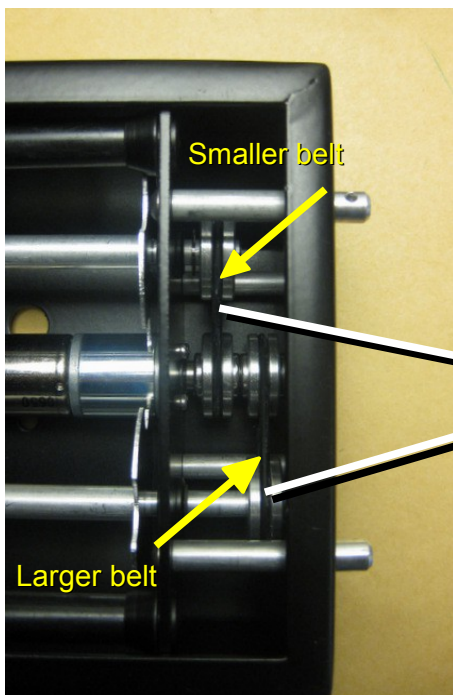

Reverse

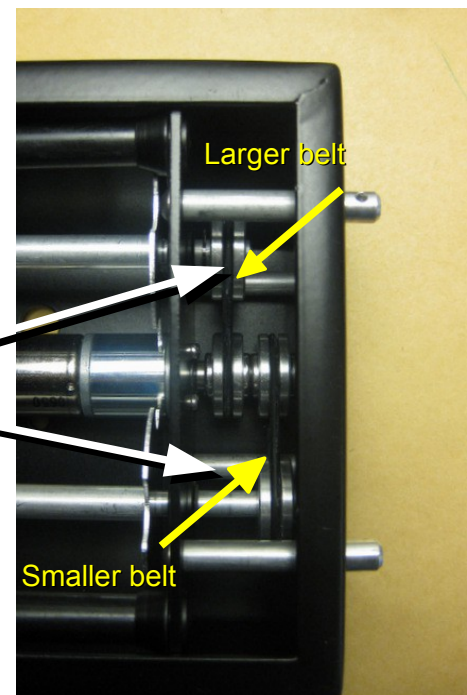

(on RB750 Rally, switch both belts)

NOTICE

- Don't use sharpen tools because they may damage belts
- Motor shaft may have some oil. In case of belt contamination, use a clean and dry fabric to clean it (belt contamination cause it to slip and lost driving force)