


Surface Mount

1. Decide mounting location.
2. Use mounting foam pad as guideline and drill holes.
3. Secure lighthouse with supplied screws.

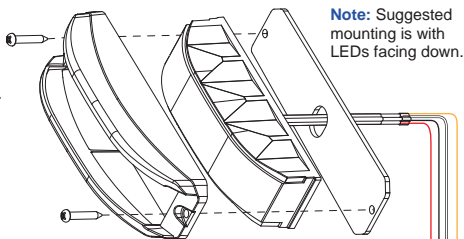

Note: Suggested mounting is with LEDs facing down.

OPERATIONS

To +VDC (fuse @ 2A).....**RED**

To Chassis Ground.....**BLACK**

For Simultaneous or Alternating Flash.....**WHITE**

- Group1 Heads: (Wiring-**WHITE** connected to **RED**) will flash together
- Group2 Heads: (Wiring-**WHITE** not connected to **RED**) will flash together
- *Group1 Heads will alternate with Group2 Heads*

For Synchronization & Flash Patterns.....**YELLOW**

- Connect **YELLOW** wires of all heads together for synchronization
- *All heads must be set at the same pattern

Momentarily apply + VDC to **YELLOW** wire:

- once for next pattern
- quickly three times for FP#1

Note: This unit may not be factory set at pattern 1.

FP#	Flash Patterns		
1	Single (2Hz)	9	Double
2	Double (R65)	10	Triple
3	Triple (2Hz)	11	Quad
4	Quad (2Hz)	12	Quint
5	Random	13	8 Flash
6	Steady	14	Single-Quad
7	Single	15	Single H/L
8	Mega	16	Single-Triple-Quint