


DRAWING NO.
10051633

BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	CABLE SIZE	WELD METAL	HANDLE CLAMPS
B-1215	10048878	#6	90	B-106
B-1216	10048879	#4	90	B-106
B-1217	10048880	#3	--	B-106
B-1218	10048881	#2	115	B-106
B-1219	10048882	#1	115	B-106
B-1220	10048883	1/0	200	B-106
B-1221	10048884	2/0	200	B-106
B-1222	10048885	3/0	250	B-106
B-1223	10048886	4/0	250	B-106
B-1224	10048887	250 kcmil	250	B-106
B-1225-H	10048888	300 kcmil	500	B-107
B-1226-H	10048889	350 kcmil	3-200	B-107
B-1228-H	10048890	500 kcmil	3-250	B-107

REV.	DATE	DESCRIPTION	ECO	BY	C*K'D.
B	12/03/12	DRAWING LOGO CHANGED.	29615	YM	MB

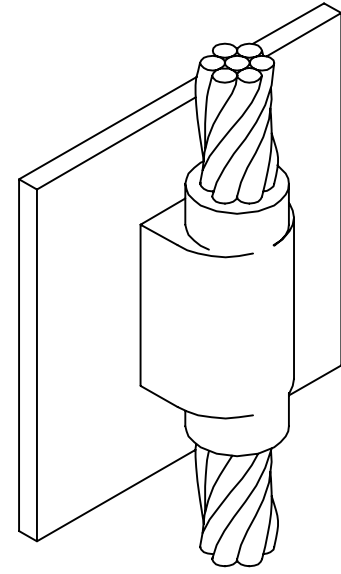

(CABLE IS OFF THE SURFACE)

NOTES:

- BCS-4 TYPE MOLDS ARE USED TO JOIN A VERTICAL THROUGH COPPER CABLE TO A VERTICAL STEEL SURFACE. NOTE THAT THE CABLE IS 'OFF' THE SURFACE. FOR MOLDS WITH THE CABLE ON THE SURFACE, CONTACT BURNDY® PRODUCTS.
- SIZE RANGE IS #6 THROUGH 500 kcmil SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX '-S' TO MOLD NUMBER FOR SOLID CONDUCTORS. FOR HEAVY DUTY MOLDS, ADD SUFFIX 'H' TO MOLD NUMBER.
- REQUIRED TOOLS:
HANDLE CLAMPS (SEE CHART FOR CORRECT HANDLES). FOR HANDLES SEE DRAWING 10051615.
B38-0309-00: FLINT IGNITOR (DRAWING 10051616).
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616
B38-3922-00: MOLD CLEANING BRUSH
B38-0135-00: CABLE CLEANING BRUSH
B38-0101-00: RASP

<p>TO ORDER BURNDY® PRODUCTS CALL</p> <p>UNITED STATES: 1-800-346-4175 (LONDONDERRY, NH)</p> <p>CANADA: 1-800-361-6975 (QUEBEC) 1-800-387-6487 (ALL OTHER PROVINCES)</p> <p>FOR PRODUCT INFO: http://www.burndy.com</p>		BURNDYweld™ VERTICAL THRU CABLE TO VERTICAL STEEL SURFACE	
		ITEM NO: N/A	
		CAT NO: BCS-4 SERIES	
		SCALE: N/A	
		DRAWN BY: P LAPONIUS 12/8/04	
		CHECKER: D SHIBILIA 1/3/05	
		DSN APPVL: D SHIBILIA 1/13/05	
		MFG APPVL: ---	
		QC APPVL: J BRODEUR 1/14/05	
		MKT APPVL: R ROBICHEAU 1/18/05	
		PROD FAM: ---	DRAWING NO
		PROJECT #: ---	10051633
		DOCUMENT TYPE: Sales	REV
		REL LEVEL: AutoCAD	B
		SIZE: D	SHEET 1 OF 1