

Pellet Feeder- Direct Drive

Models Affected:


- Accentra Insert** - beginning serial number: 008240096
- P38** - beginning serial number: 008080620
- P61/P61A** - beginning serial number: 008085092
- P68** - beginning serial number: 008280309
- PF100** - beginning serial number: 008350087

Change :

New Ultra Feeder

Reason for Change :

Compact Size. Service Friendly(increased internal visibility). Internal Airflow Built In.

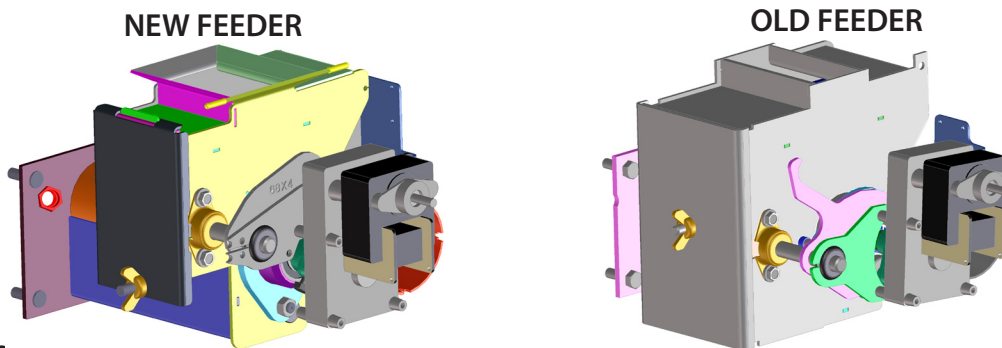

Key Points :

The Ultra Feeder is a more compact design.

We've Increased the P68 feed motor to 6rpm with the Ultra Feeder. (4rpm motor originally)

The Ultra Feeder is sealed at the hopper throat with a replaceable gasket. No need for cutting silicone.

The Original feeder body cannot be replaced with an Ultra Feeder. Replacements for old feeders will remain available. Part# 1-10-677150.

Feed motor removal involves loosening one set-screw bolt(7/16" wrench), and slide the motor out of the auger. If the motor is stopped in a un-reachable position, loosen the auger retainer bolts(1/2" wrench) and slide the auger out of the feeder, to access the motor set-screw.

Notes For Ordering Replacement Parts:

	Ultra Feeder	Old Feeder
6 RPM Auger Motor	#3-20-09302	#3-20-09302
4 RPM Auger Motor	#3-20-60906	#3-20-60906
Auger	#3-50-00565	#3-50-00365
Motor Mount	#2-00-247406	#2-00-01534
Slide Plate	#1-10-677121	#1-10-08037
Accentra Insert Pusher Arm	#1-10-677187	#1-10-08535
P38 Pusher Arm	#1-10-677187	#1-10-08048
P61/61A Pusher Arm	#1-10-677188	#1-10-06691
P68 Pusher Arm	#1-10-677187	#1-10-06719
PF100 Pusher Arm	#1-10-677130	#1-10-08104

*Find all Service Updates online at the Harman Dealer Corner under Service Updates.
Questions? Call 800.433.7261*