

## Pellet Feeder - Indirect Drive

Models Affected:

**Accentra**- beginning serial number: 008400001

**Advance**- beginning serial number: 0083600001


**XXV**- serial number: 12871 thru 12939 and from 008200001 onward

### Change :


New Ultra Feeder

### Reason for Change :

Compact Size. Service Friendly(increased internal visibility). Internal airflow built in.

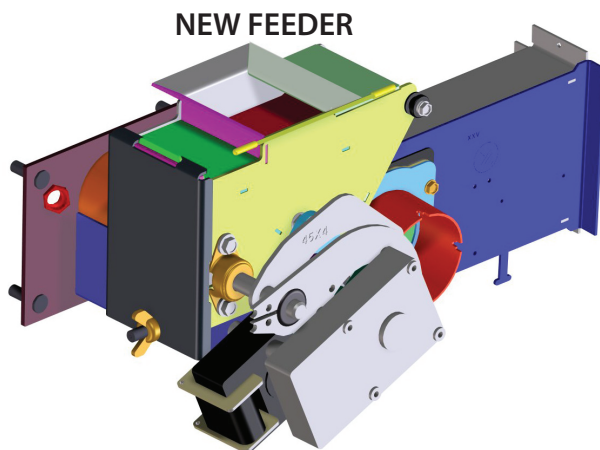

Motor # 3-20-00677

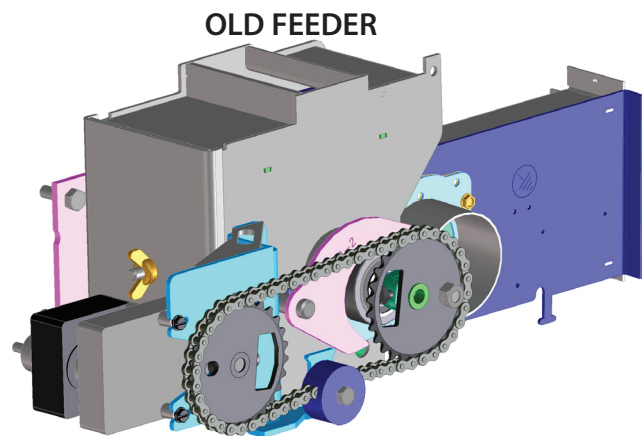

Motor # 3-20-08730

### Key Points :

The Ultra Feeder is a more compact design, *no chain drive system needed.*

The Ultra Feeder is sealed at the hopper throat with a replaceable gasket. No need for cutting silicone.

The original feeder body cannot be replaced with an Ultra Feeder. Replacements for old feeders will remain available, part# 1-10-677150.

Feed motor removal involves loosening one set-screw bolt(7/16" wrench), and slide the motor out of the auger. If the motor is stopped in a un-reachable position, loosen the auger retainer bolts(1/2" wrench) and slide the auger out of the feeder, to access the motor set-screw.

### Notes For Ordering Replacement Parts:

|                     | Ultra Feeder | Old Feeder   |
|---------------------|--------------|--------------|
| Auger Motor         | #3-20-00677  | #3-20-08730  |
| Auger               | #3-50-00565  | #3-50-00365  |
| Motor Mount         | #2-00-247406 | #1-10-06603  |
| Slide Plate         | #1-10-677121 | #1-10-08037  |
| Accentra Pusher Arm | #1-10-677187 | #1-10-247220 |
| Advance Pusher Arm  | #1-10-677131 | #1-10-01530  |
| XXV Pusher Arm      | #1-10-677131 | #1-10-01530  |

Find all Service Updates online at the Harman Dealer Corner under Service Updates.

Questions? Call 800.433.7261