# **BRICK\_8** Ford Generation 2 Upgrade Kit for vehicles with Sync and Sirius Satellite Radio

## For 2011-2012 F250-F550

## **Requires:**

1. Pre-programmed BC3T-18K931 (CC3T for 2012) navigation radio

#### **Kit includes:**

- 1. Right-hand steering wheel control (BC3Z-9C888-BA / DC3Z-9C888-BA)
- 2. Antenna splitter (9T4Z-10E928-A)
- 3. Amplifier harness (4S7T-14489-YRA-3)
- 4. Amplifier (9L1T-18T806-A)
- 5. Procedure 2 harness (XP2HARNESS)

## Dealer will need to perform the following modifications:

#### For detailed installation instructions see attached Procedure

- 1. Unplug satellite antenna from DLP and plug antenna lead into splitter (9T4Z-10E928-A). DLP is no longer needed, unplug and remove (Sirius is now integrated into Generation 2 navigation radios).
- 2. Replace right-hand steering wheel with factory steering wheel control for vehicles with Sync and Navigation from factory (BC3Z-9C888-BA / DC3Z-9C888-BA).
- 3. Only perform the procedure below if Sync cannot hear your voice (see Procedure 2):
  - a. Plug provided XP2HARNESS into radio and vehicle harness.
  - b. Run and pin red & blue wire into sync module (blue to 13 & red to 12).
- 4. After installation and microphone wiring has been completed, **if** the steering wheel control is inoperative; please contact your supplier of this part for technical support.


#### **Notes:**

1. If customer has backup camera running to rear-view mirror, installing the navigation radio will NOT automatically re-route the video to the navigation radio. A physical re-wire modification will need to take place. If the dealership chooses to do this modification or add a backup camera, they MUST have the navigation radio programmed to accept Backup Camera Video (Camera On). If needed, a rear camera radio input plug is available to assist in the wiring modifications or addition of a backup camera (FRD09-BC1).

# Procedure #2 Microphone Wiring Instructions

# Only perform this procedure if Sync cannot hear your voice

- 1.) Plug XP2HARNESS into radio and vehicle harness
- 2.) Run and pin red & blue wire into sync module (blue to 13 & red to 12)

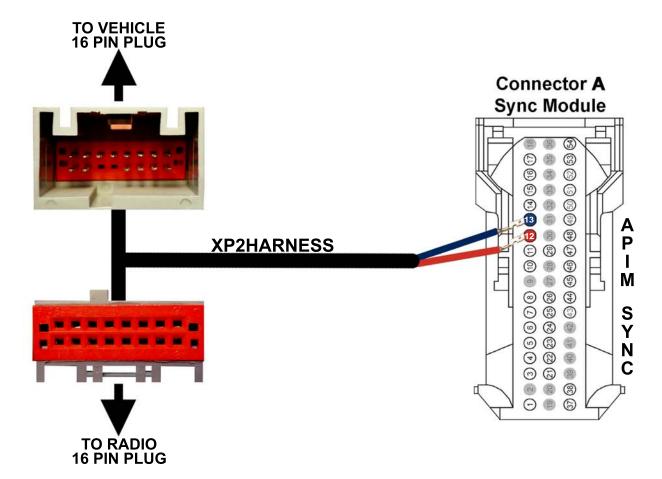

Year	Vehicle	Connector A	Connector A
		Location	Sync Module
2009-12	Econoline	In dash below radio	C2383
2009-10	Edge	Rear of center console	C3342
2009-12	Escape	Center console	C3338
2009-12	Expedition	Bottom of center console	C3342
2009-10	Explorer	Center console	C3342
2009-12	F150	Top center of dash	C2383
2009-12	F250	Above passenger kick	C2298
2009-12	Flex	Middle of center console	C3342
2009-12	Fusion	Rear of center console	C3338
2009-11	Mariner	Center console	C3338
2009-11	Milan	Rear of center console	C3338
2009-12	MKS	Rear of center console	C3342
2009-12	MKT	Center console	C3342
2009-10	MKX	Rear of center console	C3342
2009-12	MKZ	Rear of center console	C3338
2009-10	Mountaineer	Center console	C3342
2009-10	Mustang	Behind radio	C2383
2009-12	Navigator	Bottom of center console	C3342
2008-10	Sable	Rear of center console	C3342
2009-10	Sport Trac	Center console	C3342
2008-12	Taurus/TaurusX	Rear of center console	C3342