Preparation unit——Accessories

Click to shop online @ www.trimantec.com or call 336-767-1379

GZ Series safe on-off valve




Symbol



Product feature

- 1. It is module design and can be used with G series F.R.L. combination by bracket.
- 2. This valve can be used as manual 3/2 way valve.
- 3. Visual indication marked EXH/SUP.
- 4. This valve meets the standard on installation conducted by operator specified by OSHA (Occupational Safety & Health Administration). When the machinery is maintained and serviced, the purge valve (Safe on-off valve) for remaining pressure shall be



used to eliminate the remaining pressure when the air source is cut off. Valve must be locked to prevent accidental operation by a third party during maintenance. This prevents accidental system pressurization & cylinder actuation which can result in injuries to the machine operator.


Specification

Model	GZ200-06	GZ200-08	GZ300-08	GZ300-10	GZ300-15	GZ400-10	GZ400-15		
Fluid	Air								
Port size	1/8"	1/4"	1/4"	3/8"	1/2"	3/8"	1/2"		
Exhaust port size	1/4"			3/8"		1/2"			
Acting type	Manual								
Valve type	3 port 2 way								
Pressure range	0~0.9MPa(0~130psi)								
Proof pressure	1.5MPa(215psi)								
Temperature range	-20~70°C								
Operation angle	90°								
Suitable F.R.L type	GC200-06	GC200-08	GC300-08	GC300-10	GC300-15	GC400-10	GC400-15		




1) PT thread, G thread and NPT thread are available.

Ordering code

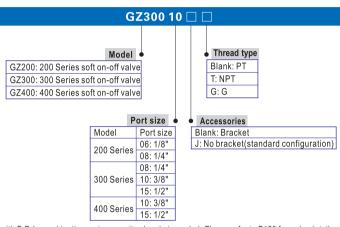


 $Note: When \ it \ is \ used \ with \ F.R.L. \ combination, \ extra \ mounting \ bracket \ needed. \ Please \ refer \ to \ P150 \ for \ order \ detail.$

Inner structure

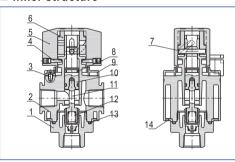

Item	No.	Item
Valve cap	8	O-ring
Body	9	Cover
Screw	10	Spool
Operating screw	11	Plug
Adjusting screw	12	Spring
Special screw	13	O-ring
Fixing plate	14	Cover
	Valve cap Body Screw Operating screw Adjusting screw Special screw	Valve cap 8 Body 9 Screw 10 Operating screw 11 Adjusting screw 12 Special screw 13

Dimensions

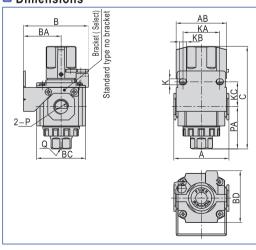

14 \ \ \ \ 1 - 1	GZ200		GZ300			GZ400	
Item\Model	06	08	08	10	15	10	15
Α	47		60		75		
AB	42		55			65	
В	52.6		70.7			83.9	
BA	30		41			50	
ВС	40		53.5		64		
BD	42.5		56.5		66		
С	89		112.5			134	
K	5.5		6.5			8.5	
KA	27		40			55	
KB	8.5		8			11	
KC	23		27			33.5	
P	1/8"	1/4"	1/4"	3/8"	1/2"	3/8"	1/2'
PA	36.5		46		58.5		
Q	1/4"		3/8"			1/2"	