

General Warning for Z33 6-spd Close Gear Kit installation

Thank you for purchasing the OS Giken 6-spd close-ratio gear kit for Z33. Please read this document carefully before installation. Regarding transmission disassembly, please refer to the factory service manual for instructions.





The 4th main gear has "F" laser marked; this indicates front side installation.

Pic 2. Check Ball Spring of Shift Rod



Please remove 3x OEM springs indicated by the RED circles and replace with included SPRINGS.

Please remove 1x OEM spring and check ball indicated by the BLUE circle and replace with included PIN and SPRING (pic 3)


Please pay attention to the PIN install direction; it should be fitted to the shaft groove. (pic 3-2)





General Warning for Z33 6-spd Close Gear Kit installation

Pic 4. Striking lever modification

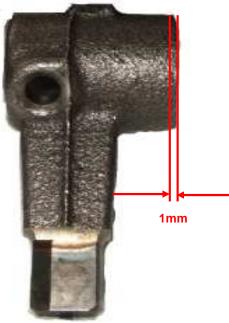

Please shave striking lever by 1mm as shown in pic 4.

Pic 5. Counter Shaft Front Bearing



OEM bearing is NOT compatible. Please insert included SPACER first and install included BEARING.





Complete Installation view (pic 6).