

Dodge Charger Bumper Removal Guide

INSTALLATION TOOLS

PREPARE THESE TOOLS FOR INSTALLATION



Metal
Panel
Popper



Flat
Screwdriver



Power Tool



Wrench



1/4 Ratchet



1/4 Extension

7mm
8mm
10mm



Socket

NOTE: Whenever using a power tool, please make sure do not overtighten the bolts.



STEP 1. DISCONNECTING THE NEGATIVE BATTERY TERMINAL

Whenever working on your vehicle, always start by disconnecting the negative battery terminal.





STEP 2. REMOVE THE FRONT BUMPER


Begin by extracting the push-in pins from the radiator support cover.

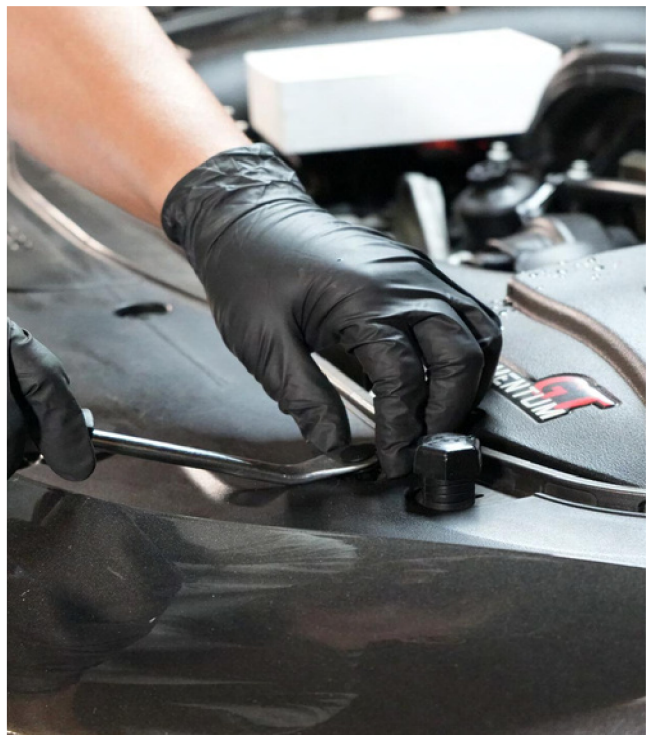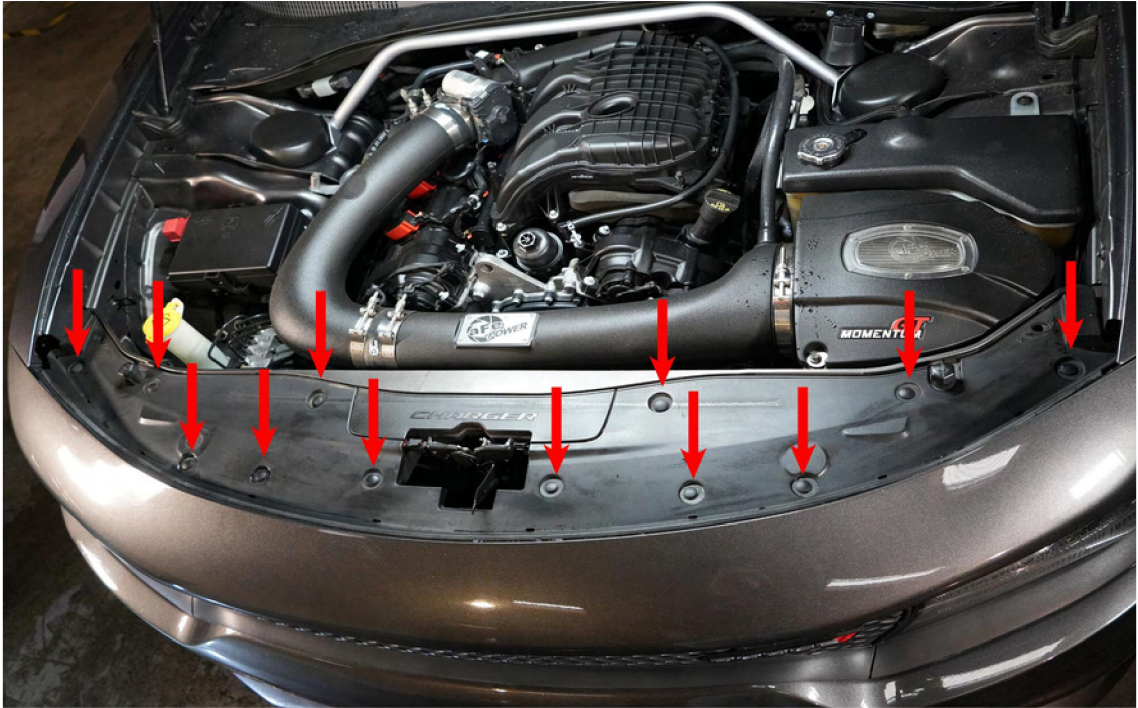


Remove the two 10mm bolts, located individually on either side of the upper bumper corner.

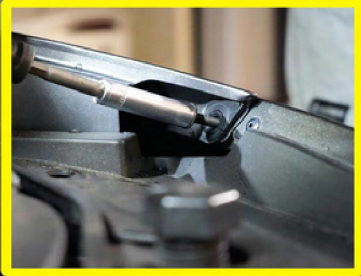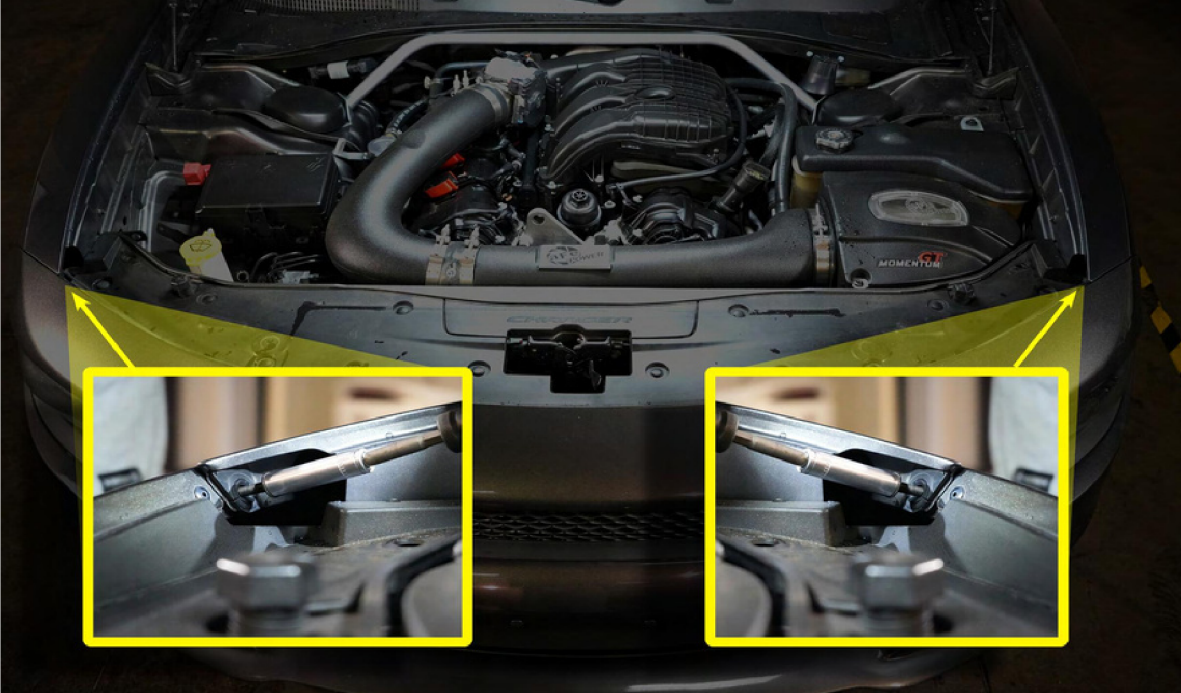

Extract the four push-in pins from both sides of the wheel fender.

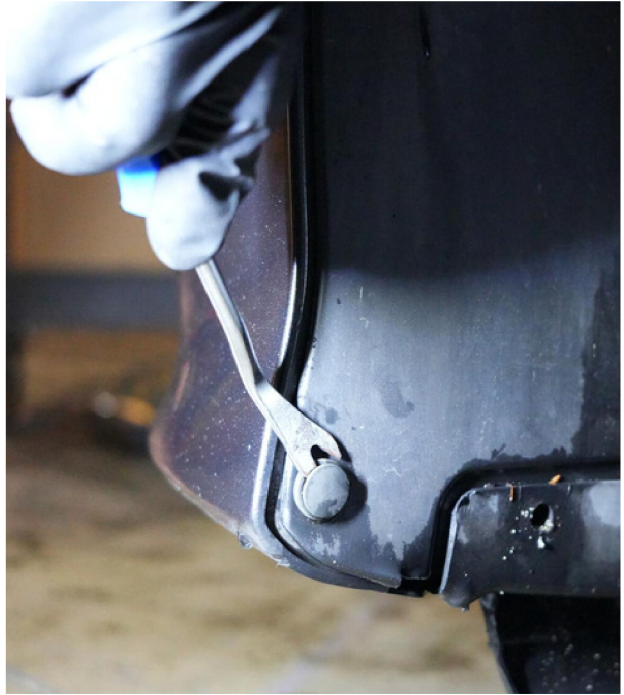

Subsequently, spread open the fender liner widely and use the wrench to disengage the two 10mm bolts securing the front bumper.

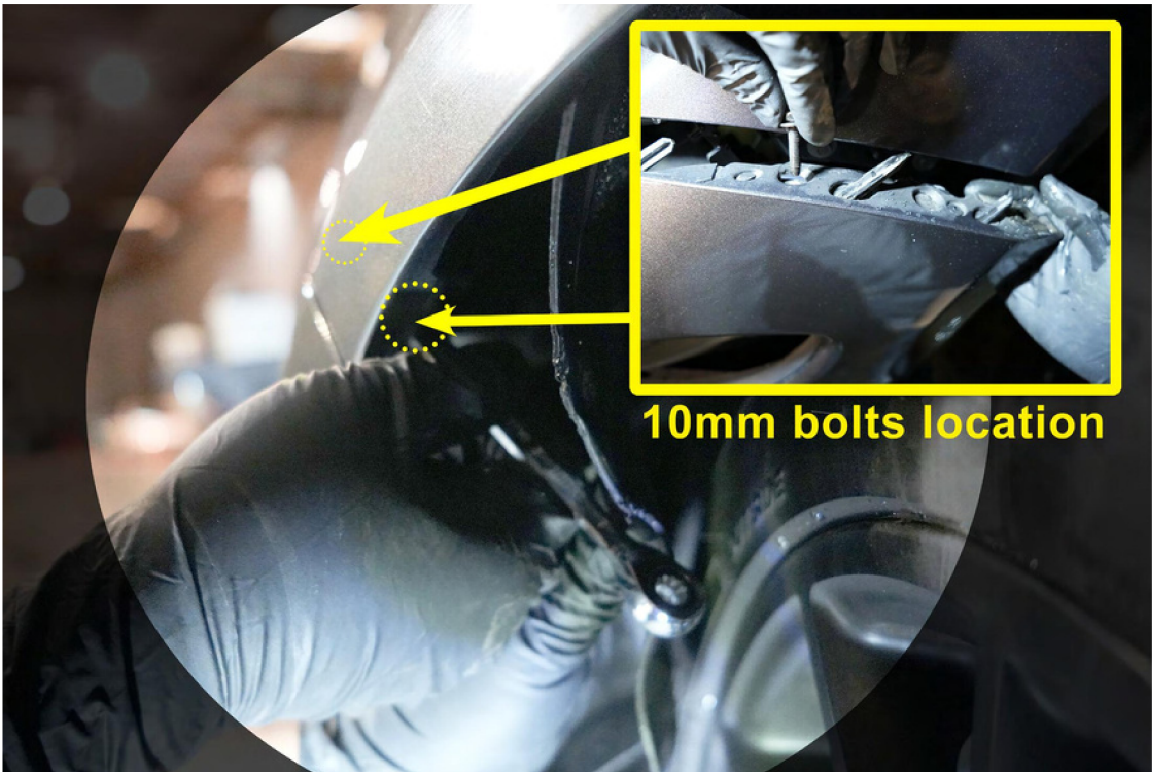

Repeat the identical steps on the opposite side of the wheel fender. Open the fender liner widely and remove the two 10mm bolts securing the front bumper.



Take out the eight 7mm bolts located underneath the front bumper.



Gently detach the front bumper by pulling outward from each side, disengaging it from the mounting clips.



Disconnect the fog light connectors and side marker connectors, then proceed to remove the front bumper entirely. Set it aside for later reinstallation.



STEP 3. REMOVE THE HEADLIGHT BOLTS


Remove the 4 X 8mm bolts from the headlight assembly.
Follow the same steps for the other side.





STEP 4. REMOVE THE HEADLIGHTS

Gently pull the headlight assembly outward to disengage.
Unplug the headlight's sockets to complete the headlight's removal.

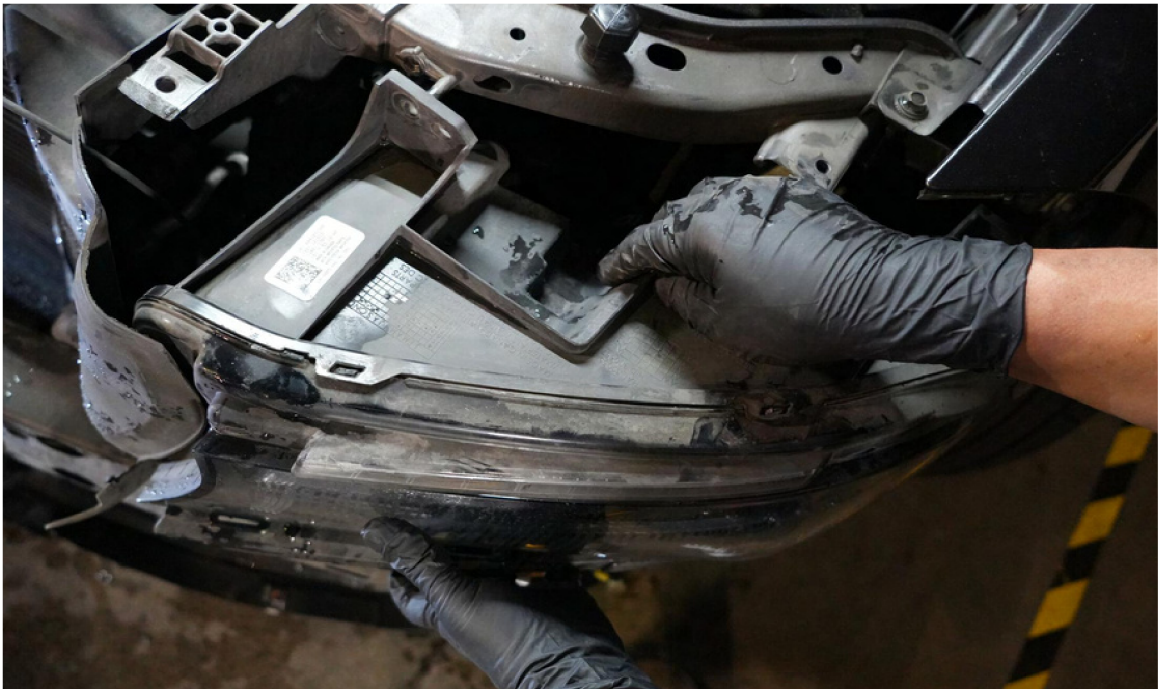



Follow the same steps to remove the other side of the headlight.

