

TALON

Compatible with all Bluetooth® enabled Talons.

REMOTE ASSEMBLY REPLACEMENT KIT FOR BT TALON 2884150

Item	Part #	Description	Qty.
1	2994150	TRANSMITTER ASSEMBLY, TALON 3 (BT)	1

NOTICE: Remote may not pair to Talon(s) with older software. To update software you will need an iOS or Android Device with the Talon App Installed on it.



⚠ ATTENTION

It may be necessary to update the Talon Software, the included remote will not pair to Talons with some older software versions. For information on the Talon app and pairing your Talon to an iOS or Android Device consult the Talon Owner's Manual at www.minnkotamotors.com

Videos regarding remote pairing and updating Talon Software available at minnkotamotors.com. Please reference these videos.



PAIRING


- Verify the Talon is retracted by pressing the up button on the indicator panel on the Talon. No depth indication LEDs will be lit when the Talon is retracted.
- Put the remote into Pair Mode by pressing and holding both the "UP" and the "DWN" buttons on the remote control for 3 seconds. The Left, Mode, and Right LEDs at the top of the remote control will blink in sequence. Release the "UP" and "DWN" buttons.
- Put the Talon into Pair Mode by pressing and holding both the up arrow and the down arrow buttons on the Talon Indicator Panel for 3 seconds. When the Talon is in Pair Mode the Depth Indication LEDs will Blink in a pattern starting with the middle light and progressing outward. Release the up arrow and down arrow buttons.

NOTICE: Once in Pair Mode the Talon and the Remote Control will remain in Pair Mode for 30 seconds. Both the Talon and the Remote Control must be in Pair Mode at the same time to Pair.

- Three quick beeps from the Talon will indicate successful pairing. If the Talon times out without successfully pairing an error tone will be emitted, this tone is a series of very rapid beeps creating a raspy tone. If Pairing is unsuccessful try repeating steps b and c again.

NOTICE: 4 Remotes can be paired to 1 Talon. If 4 remotes have previously been paired the memory on the Talon will need to be cleared to pair this remote. The Talon App or a connected Humminbird can be used to review all the devices on the Talon Bluetooth Network.

- If shortly after successfully pairing the LEDs on the Remote Control begin blinking in sequence again the remote is updating software, this may take several minutes. Once the software update is complete the lights will stop blinking, at this point it will be necessary to pair the remote to the Talon again, repeat steps b and c.

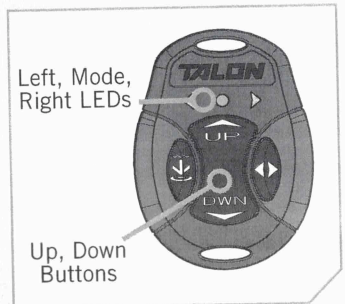

minnkotamotors.com



Part #2384955

Minn Kota Consumer & Technical Service
Johnson Outdoors Marine Electronics, Inc.
PO Box 8129
Mankato, MN 56001

121 Power Drive
Mankato, MN 56001
Phone (800) 227-6433
Fax (800) 527-4464



©2017 Johnson Outdoors Marine Electronics, Inc.
All rights reserved.

ECN 40060

Rev A

06/19