
LIFT ASSEMBLY REPLACEMENTS FOR: 4739B6801 (LEFT FRONT/RIGHT REAR) 4733E5801 (LEFT REAR/RIGHT FRONT)

Fleetwood Folding Trailers has introduced two replacement lift arm assemblies, part numbers 4716A0011 (roadside rear/curbside front) and 4716A0021 (roadside front/curbside rear) which will start appearing on your billing invoices. These lift arm assemblies are the current substitutions for the original lift arms manufactured on all series folding trailers produced after model year 1971 inclusive.

1990 - 1995 Destiny series trailers only: 1996 Destiny series Taos, Laredo, and Sedona models only:

Replacement of a Destiny series lift arm assembly requires removal of the painted lift cover plate, riveted to the stationary section of the original lift arm prior to removal of the lift arm assembly (refer to figure below). See removal and installation instructions below.

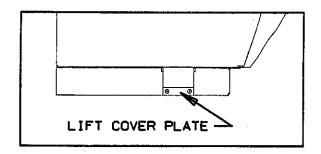

INSTRUCTIONS

Removal - Prior to removing original lift arm assembly from the trailer body, drill out the rivets securing the lift cover plate to the stationary lift section using a No. 8 drill bit.

NOTE: Removal of the identical rivets on the replacement lift arm assembly will be necessary as well to re-attach painted lift cover plate.

Installation - Once installation of the replacement lift assembly is completed, use a rivet gun & re-attach lift cover plate to the stationary section of the replacement lift arm assembly using 1203-8641 rivets or equivalent (not supplied).

Individual top, center, bottom and stationary lift sections are "only" interchangeable on 1990 models and newer due to design changes of the internal cable attachment points. Sales stock inventory will not carry individual lift sections, only the complete lift assemblies. Individual lift sections for replacement can be acquired by removing old sections from discarded or replaced lift assemblies.