
ADAPTOR DATASHEET



1.0MM(MALE)-G3PO(MALE)

1.0/G3PO-JJ

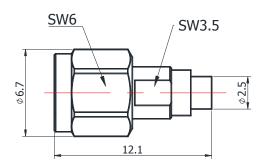

*Dimensions are in mm

Configuration	
Connector 1 Type	1.0mm Male
Connector 1 Impedance	50 Ohms
Connector 1 Polarity	Standard
Connector 2 Type	G3PO(SMPS) Male
Connector 2 Impedance	50 Ohms
Connector 2 Polarity	Standard
Connector Mount Method	None
Adapter Body Style	Straight
Frequency Insertion Loss (dP)	DC to 100 GHz
Frequency	DC to 100 GHz
Insertion Loss (dB)	\leq 0.05 xSqt.(f_GHz)
VSWR /Return Loss	1.50 to 100 GHz
Materials Information	1
Materials Information Center Contact	CuBe Gold Plated
	-
Center Contact	CuBe Gold Plated
Center Contact Outer Contact	CuBe Gold Plated Stainless Steel
Center Contact Outer Contact Body Dielectric	CuBe Gold Plated Stainless Steel Stainless Steel
Outer Contact Body	CuBe Gold Plated Stainless Steel Stainless Steel

While the information has been carefully compiled to the best of our knowledge, nothing is intended as representation or warranty on our part and no statement herein shall be construed as recommendation to infringe existing patents. In the effort to improve our products, we reserve the right to make changes judged to be necessary.

Gwave Technology, Inc. 12630 H Westminster Ave., Santa Ana, CA 92706	Tel.: +1(888)251-2240 Fax: +1(714)988-4223	Page
www.gwavetech.com	Email:sales@gwavetech.com	1 / 1