

# Chandelier Installation Instructions

A41

## For Large Hanging Chandeliers

**CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician.**

This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.\*

**Caution:** Do not exceed maximum wattage noted on fixture. Use only recommended bulbs with fixture.

Please refer to assembly instructions before installation.

### Component Parts


A	Crossbar	D	Lock Nut	G	Loop Collar
B	Lag Screws (2)	E	Canopy	H	Chain
C	Threaded Nipple	F	Threaded Loop		

### To Install

**Caution: Be sure power is off at the main breaker box prior to installation.**

**Caution:** This fixture must be supported independently of an outlet box. Crossbar is designed to fit in the bottom of a standard metal 4" octagonal outlet box.

1. Drill two holes through the back of the outlet box and using two lag screws (B) attach cross bar (A) to a structural member in the ceiling, centering the crossbar in the outlet box. We've supplied lag screws with your fixture; however, different materials and/or construction methods may require different fasteners. If in doubt, contact a qualified electrician.
2. Thread the nipple (C) into the crossbar.
3. Thread locknut (D) and threaded loop (F) onto nipple, then place canopy (E) over threaded loop and adjust nipple length to ensure a snug canopy fit. Once the length is determined, set the canopy aside and lock nipple position by tightening the locknut against the crossbar.
4. Attach one end of the chain (H) to the fixture and thread the other end through the loop collar (G) and the canopy (E).
5. Attach the other end of the chain to the threaded loop (F) and thread the fixture wires through every other link of the chain and up through the threaded loop and nipple into the outlet box.
6. Using suitable wire connectors (not provided), connect fixture wires to supply wires (white or ribbed side of fixture cord to white supply, black or smooth side of fixture cord to black supply, and bare copper to bare copper or green supply). Push wires back into outlet box.  
**Caution:** Make sure wire connectors are twisted on securely, and no bare wire is exposed.
7. Slide the canopy up the chain and over the threaded loop, securing with loop collar. Make sure no wires are pinched between the canopy and the ceiling or crossbar.
8. Install light bulbs.
9. Restore electricity at main breaker.

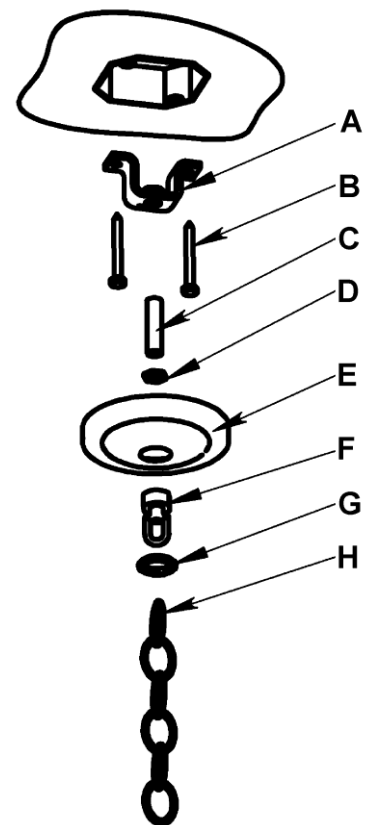

*This illustration represents a typical fixture and may not match every style.*

*If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!*

\* Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.