
# 991 Thrust Transmitter

Bently Nevada\* Asset Condition Monitoring

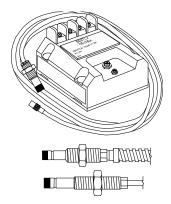

### Description

The 991 Thrust Transmitter is intended primarily for the original equipment manufacturers (OEMs) of centrifugal air compressors or small pumps, motors, or fans who prefer to provide a simple 4 to 20 mA proportional axial displacement (thrust) signal as the input to their machinery control system. The transmitter is a 2-wire, loop-powered device that accepts input from our 3300 NSv\* proximity probe and its matching extension cable (available in 5 m and 7 m system length options). The transmitter conditions the signal into appropriate engineering units proportional to the shaft's axial position<sup>1</sup>, and provides it as a 4 to 20 mA industry-standard signal for input to the control system where machinery protection alarming and logic occurs<sup>2</sup>.

The 991 transmitter provides the following notable features:

- Integrated Proximitor\* Sensor requires no external unit
- Non-isolated "PROX OUT" and "COM" terminals plus a coaxial connector provide a dynamic vibration and gap voltage signal output for diagnostics<sup>3</sup>.
- Non-interacting zero and span potentiometers under the Transmitter label supports loop adjustment.
- Test Input pin allows quick verification of loop signal output, using a variable DC voltage source as the input.
- A Power-up Inhibit circuit eliminates signal errors due to line voltage
- A Not OK/Signal Defeat circuit prevents high outputs or false alarms due to a faulty proximity probe or loose connection.
- Choice of DIN-rail clips or bulkhead mounting screws as standard options simplifies mounting.
- Potted construction for high humidity (up to 100% condensing) environments.
- Compatibility with 3300 NSv proximity probe allows transducer installation in small areas with minimal clearance, typical of centrifugal air compressors.

#### Notes:

- Probe adjustment and range are critical in thrust position measurements. Incorrect probe gap settings may prevent the transmitter from reaching full-scale in either the normal or counter directions (no machinery monitoring). For proper adjustment, follow the instructions in the manual.
- Thrust transmitters have many limitations when compared to a continuous monitoring system. They are a practical solution in some applications for measuring rotor axial position and are a valuable tool for trending thrust readings. While the transmitter is capable of alarming on thrust position and non-OK checking, monitor functions such as Timed OK channel defeat, Danger Bypass, and Trip Multiply cannot be used. In addition, PLCs attached to the thrust transmitter are not suitable for plant-wide diagnostic systems such as System 1 or Rule Paks.
- The 991 Vibration Transmitter's "Prox Out" coaxial connector provides a non-isolated dynamic transducer signal for machinery diagnostics. You can connect this signal directly to battery-powered or isolated test equipment to diagnose machinery problems. However, since the "PROX OUT" signal is not isolated from the 4 to 20 mA loop signal, an interface is available (and strongly recommended) for signal isolation. The 990/991 Test Adapter conditions the 990 Transmitter's "PROX OUT" signal for use with ac-powered test equipment.









The adapter also inverts and isolates the 990's transducer signal. making it suitable for equipment such as oscilloscopes and analyzers, and preserving industry-standard conventions for signal polarity. We strongly recommend that you use this test adapter for all applications to maintain isolation between test equipment and the loop signal, and to maintain machinery protection integrity.

### **Specifications**

Unless otherwise noted, the following specifications apply at  $+22 \,^{\circ}\text{C}$  ( $+72 \,^{\circ}\text{F}$ ) using a 3300 NSv Probe and Extension Cable, and an AISI 4140 steel target.

### Electrical

Input

Accepts 1 non-contacting 3300 NSv Proximity Probe and extension cable.

**Power** 

Requires +12 to +35 Vdc input at the transmitter terminal.

4 to 20 mA Signal Output

> 4 to 20 mAdc over specified full-scale range in 2-wire configuration.

4 to 20 mA Loop **Accuracy** 

> Within ±1.5% over specified full scale range (typical). Accuracy is rated from the TEST signal input to the voltage measured across a 250  $\Omega$ loop resistance.

**Maximum Loop** Resistance

1,000  $\Omega$  including cable at 35 Vdc.

**Current Limiting** 

23 mA typical.

Zero and Span

Non-interacting external

adjustments.

Not OK/Signal Defeat

> Signal output will go to less than 3.6 mA within 100 µs after a Not OK condition occurs. Signal output is restored within 0.1 seconds after the Not OK condition is removed.

### **Proximitor Sensor** Output

Compatible with ungrounded, portable test equipment. When using grounded, ac-powered test equipment, use the 122115-01 Test Adapter for signal isolation.

#### **Output Impedance**

Prox Out has a 10 k $\Omega$  output impedance calibrated for a 10  $M\Omega$ load.

#### Linear Range

0.25 to 1.65 mm (10 to 65 mils) for Prox Out. Suitable for 0.6-0-0.6 mm or 25-0-25 mils current loop linear ranges.

Prox Out Incremental Scale **Factor** 

> $7.87 \text{ mV/}\mu\text{m} (200 \text{ mV/mil}) \pm 6.5\%$ typical including interchangeability errors when measured in increments of 0.25 mm (10 mils) over the linear range using a flat 30 mm (1.2 inch) target.

### Temperature Stability

Incremental scale factor remains within ±10% of 7.87 mV/µm (200 mV/mil) from 0 °C to +70 °C (+32 °F to +158 °F).

Minimum target size

9.5 mm (0.375 in) diameter.

#### Leadwire Length

Proximitor\* Sensor Output (BNC connector), maximum cable distance is 3 metres (10 feet).

Non-Hazardous, Zone 2 or Div 2 Hazardous area locations

> 13 km (8 miles) maximum between transmitter and receiving device for signal output.

Intrinsically Safe Hazardous area locations

68 metres (225 ft.) maximum between transmitter and receiving device for signal output.

Electrical Classification

> General Purpose Approval by Canadian Standards Association (CSA/NRTL/C) in North America and by VDE in Europe. The 991 has the CE mark for Europe.

Hazardous Area Approvals
CSA/NRTL/C

Class I, Div 2 Groups A, B, C, D T5 @ Ta = 85 °C, Type 4 Per Drawing 128838

**ATEX** 

Ex ia IIC T4

T4 @ -35°C ≤ Ta ≤ +85°C

Ex nA IIC T4

T4 @ -35°C ≤ Ta ≤ +85°C

**Maritime Approvals** 

American Bureau of Shipping (ABS) Type
Approval

Certification Number

06-HS177078-PDA

**Environmental Limits** 

Transmitter Temperature

Operating Temperature

-35 °C to +85 °C (-31 °F to +185 °F)

Storage Temperature

-51 °C to +100 °C (-60 °F to +212 °F).

**Probe Temperature** 

Operating Temperature

-35 °C to +177 °C (-31 °F to +350 °F).

Storage Temperature

-51 °C to +177 °C (-60 °F to +350 °F).

**Relative Humidity** 

100% condensing, non-submerged, with protection of coaxial connectors.

Mechanical

Transducer Tip Material

Polyphenylene sulfide (PPS).

Transducer Case Material

AISI 303 or 304 Stainless Steel (SST).

**Probe Cable** 

 $75\Omega$  coaxial, fluoroethylene propylene (FEP) insulated.

Cable Armor (optional)

Flexible AISI 302 SST with optional

FEP outer jacket.

**Tensile Strength** 

222 N (50 lbf) probe case to probe

lead, maximum.

**Transmitter Weight** 

0.43 kg (0.9 lbm).

Total System Weight

0.82 kg (1.8 lbm) typical.

Ordering Information

991-AXX-BXX-CXX-DXX

**A:** Full-scale Option

**0 6** 0.6 -0- 0.6 mm **2 5** 25-0-25 mils

3: System Length Option

5.0 metres (16.4 feet) 7.0 metres (23.0 feet)

C: Mounting Option

0 0 0 0 0 D: Agency Approval ( 0 0 0 0	2 Bulkhead screws 3 DIN clips and screws Option 0 Not required 1 CSA Division 2 5 CSA Division 2, ATEX Zone 0, ATEX Zone 2 and includes ABS maritime approval	<b>E:</b> Agency Approval	<ul> <li>Miniature coaxial ClickLoc connector, standard cable</li> <li>Miniature coaxial ClickLoc connector with connector protector, FluidLoc* cable</li> <li>Miniature coaxial ClickLoc connector attached, FluidLoc cable</li> <li>Option</li> <li>Not required</li> <li>Multiple Approvals (CSA NRTL/C and BASEEFA/CENELEC, which includes CSA Division 2)</li> </ul>
	300 NSv Probe, 1/4-28 UNF thread, rithout armor.	<b>3300 NSv Probes, N</b> 330903	1etric
w	300 NSv Probe, 1/4-28 UNF thread, ith armor.	330904	3300 NSv Probe, M8 x 1 thread, without armor.
	300 NSv Probe, 3/8-24 UNF thread, vithout armor.	330905	3300 NSv Probe, M8 x 1 thread, with armor.
	300 NSv Probe, 3/8-24 UNF thread, ith armor.	330910	3300 NSv Probe, M10 x 1 thread, without armor.
Part Number-AXX-BXX-	-CXX-DXX-EXX		3300 NSv Probe, M10 x 1 thread,
Option Descriptions	(0-	<i>'</i> )	with armor.
<u>in</u> Oi Le	Option  ote: Unthreaded length must be at least 0.7 less than the case length. rder in increments of 0.1 in ength configurations: inimum length: 0 in	Part Number-AXX-E Option Descriptions A: Unthreaded Len	3
M Ex B: Case Length Option	rder in increments of 0.1 in areaded length configurations:		Order in increments of 10 mm Untreaded length configurations: Minimum length: 0 mm Maximum length: 230 mm Example: 06 = 60 mm
M M	linimum length: 0.8 in aximum length: 9.9 in kample: 3 5 = 3.5 in	<b>B</b> : Case Length Opt	
0 1 5 7	<ul> <li>5 0.5 metre (1.67 feet)</li> <li>0 1.0 metre (3.25 feet)</li> <li>0 5.0 metres (16.4 feet)</li> </ul>	C: Total Length Opt	<b>Example:</b> 25 = 250 mm
D: Connector Option 0	Miniature coaxial ClickLoc*     connector with connector protector,     standard cable	D: Connector Optio	0 1 Miniature coaxial ClickLoc connector with connector protector, standard cable  Specifications and Ordering Information

02	Miniature coaxial ClickLoc connector,
	standard cable

- 11 Miniature coaxial ClickLoc connector with connector protector, FluidLoc cable
- 12 Miniature coaxial ClickLoc connector attached, FluidLoc cable

E: Agency Approval Option

00 Not required

0 5 Multiple Approvals (CSA NRTL/C and BASEEFA/CENELEC, which includes CSA Division 2)

#### 3300 NSv Reverse Mount Probe

330906-02-12-CXX-DXX-EXX, 3/8-24 UNF threads

330907-05-30-CXX-DXX-EXX, M10 x 1 UNF threads

**Option Descriptions** 

C: Total Length Option

**0.5** metre (1.67 feet)

**10** 1.0 metre (3.25 feet)

**5 0** 5.0 metres (16.4 feet)

**7.0** metres (23 feet)

D: Connector Option

- **02** Miniature coaxial ClickLoc connector, standard cable
- 12 Miniature coaxial ClickLoc connector attached, FluidLoc cable

**E:** Agency Approval Option

00 Not required

0 5 Multiple Approvals (CSA NRTL/C and BASEEFA/CENELEC, which includes CSA Division 2)

#### **Extension Cable**

#### 330930-AXXX-BXX-CXX

A: Cable Length Option

**040** 4.0 metres (13.1 feet)

**0 4 5** 4.5 metres (14.8 feet)

**060** 6.0 metres (19.7 feet)

**0 6 5** 6.5 metres (21.3 feet)

B: Armor Option

**00** Without stainless steel armor

**01** With FEP covered stainless steel

**02** With stainless steel armor

**0 3** Without stainless steel armor, with connector protector

**0 4** With FEP covered stainless steel armor and connector protector

**0 5** With stainless steel armor and connector protector

C: Agency Approval Option

**00** Not required

0 5 Multiple Approvals (CSA NRTL/C and BASEEFA/CENELEC (which includes CSA Division 2)

### **Accessories**

#### 122115-01

**990/991 Test Adapter.** Package includes: 990/991 Test Adapter, 9V battery, Universal ac Adapter, Power Cord (North American), User Guide and Soft Carrying Case.

The 990/991 Test Adapter inverts and isolates the PROX OUT signal from the 991 Transmitter so you can connect 991 Transmitters to acpowered diagnostic equipment. The Adapter modifies the PROX OUT signal so that it matches our Proximitor Sensor signals by performing these functions:

- Shifts the phase of the PROX OUT signal by 180° by changing the voltage from positive to negative
- Isolates the transmitter from diagnostic equipment so that equipment with different grounds will not affect the transmitter's 4-20 mA loop signal
- Reduces noise in the surrounding area from affecting the PROX OUT signal

The 990/991 Test Adapter provides the following benefits:

- Small size and weight for portable operation
- Battery or ac adapter power options
- Automatic shutoff circuit that powers down the unit when the battery is low
- 2 channels, so that you can display an orbit for XY probe configurations.

990/991 Test Adapter Accessories

connector installation instructions. Supplied with carrying case.

123266-01

Coaxial Cable Kit. Includes 4 cables

with length of 1.5 metres (5 feet) each.

2

02211505

Single coaxial cable with length of

1.5 metres (5 feet).

990/991 Test Adapter Spare Parts

01810700

Battery (9 volt alkaline).

02270056

Ac adapter. Has universal ac input to 9 volts dc output. Input is 108 to 132 Vac with 120 Vac nominal, or 207 to 253 Vac with 240 Vac

nominal.

02198937

Power cord (for North American ac

power outlet).

123133-01

User Guide.

**Probe and Transmitter Accessories** 

02173006

Bulk Cable (specify length in feet).

1.0 mm<sup>2</sup> (18 AWG), 2-conductor, twisted, shielded cable used for the 4 to 20 mA loop. Also used for the PROX OUT signal on the 991 Transmitter's

terminal strip.

123655-01

Manual.

330153-05

Cable Connector Kit. Package Includes 1 set of 75  $\Omega$  miniature male and female connectors, shrink tubing and 3300 Isolator Seal for protection

of coaxial connectors.

163356

Connector Crimp Tool Kit. Includes one set of 75  $\Omega$  ClickLoc inserts and

330951-01

991 Mounting Screws (spares).

Contains 4 screws.


284726

**DIN rail mounting kit.** Installed on the 990 Transmitter to allow mounting on 35 mm DIN rail.

Specifications and Ordering Information Part Number 141618-01 Rev. D (08/09)


## **Dimensional drawings**

Note: All dimensions shown in millimetres (inches) unless noted otherwise.

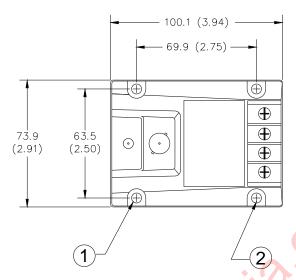


- 1. Mounting holes, 5.8 mm (0.23 in) diameter, 4 places
- 2. Bulkhead mount holes, 4 each. 6-32 x 1.326 screws provided when mounting option specified

Figure 1: 991 Thrust Transmitter Dimensions (Top View)

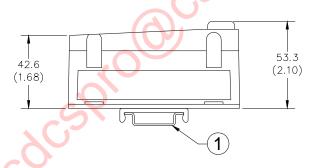

1. 35mm DIN rail DIN mount clips (when DIN rail mounting is specified)

Figure 2: 991 Thrust Transmitter Dimensions (Side View)

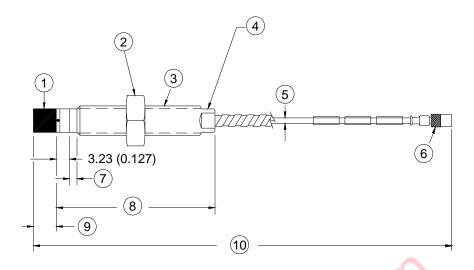

- 1. Probe tip, 5.26 mm (0.207 in) maximum diameter
- 2. Hexagonal nut
- 3. Case Thread
- 4. Wrench flats
- 5.  $75\Omega$  cable, 2.8 mm (0.11 in ) maximum outside diameter, 7.6 mm (0.30 in) maximum outside diameter of armor
- 6. Miniature male coaxial connector, 7.23 mm (0.285 in) maximum outside diameter "D"
- 7. Unthreaded length "A"
- 8. Case length "B"
- 9. 2.92 mm (0.115 in) maximum
- 10. Total length "C", +30%, -0%

### Figure 3: 3300 NSv Proximity probes, Standard Mount

330901, 1/4-28 UNF-2A, without armor

330902, 1/4-28 UNF-2A, with armor

330903, M8x1 thread, without armor

330904, M8x1 thread, with armor

330905, M10x1 thread, without armor


330908, 3/8-24 UNF-2A, without armor

330909, 3/8-24 UNF-2A, with armor

330910, M10x1 thread, with armor


#### Notes:

Standard mount 1/4-28 UNF thread probes are supplied with a 7/16 inch lock nut and 7/32 inch wrench flats. Standard mount M8x1 thread probes are supplied with a 13 mm lock nut and 7 mm wrench flats. Standard mount 3/8-28 UNF thread probes are supplied with a 9/16 inch lock nut and 5/16 inch wrench flats. Standard mount M10x1 thread probes are supplied with a 17 mm lock nut and 8 mm wrench flats.



- 1. 12 mm (0.49 in) maximum diameter
- 2. 36.3 mm (1.43 in) maximum
- 3. 51.1 mm (2.01 in) maximum
- 4. Connector protector (fluorosilicone material)

**Figure 4: Installed Connector Protectors** 

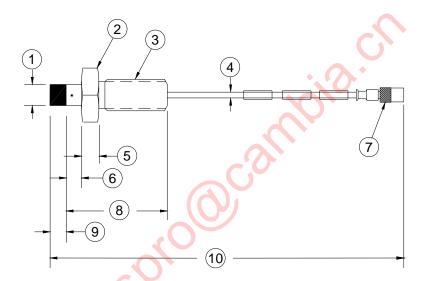


- 1. Probe tip, 5.26 mm (0.207 in) maximum diameter
- 2. Hexagonal nut
- 3. Case thread
- 4.  $75\Omega$  cable, 2.8 mm (0.11 in) outside diameter
- 5. Miniature male coaxial connector, 7.23 mm (0.285 in) maximum outside diameter "D"
- 6. 5.08 mm (0.20 in)
- 7. Unthreaded case length "A", 5.08 mm (0.20 in)
- 8. Case length "B", 30.48 mm (1.20 in)
- 9. 2.92 mm (0.115 in) maximum
- 10. Total length "C", +30%, -0%

Figure 5: 3300 NSv Proximity Probes, Reverse Mount

330906, 3/8-24 UNF-2A 330907, M10x1 thread


#### Notes:

Reverse mount probes are not available with armor or connector protector options.

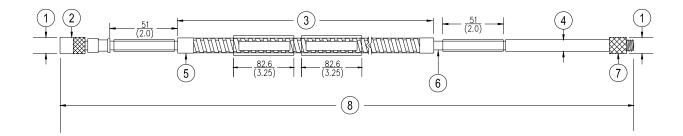

- 1. 7.2 mm (0.285 in) maximum diameter
- 2. Miniature male coaxial connector
- 3. FEP-coated or uncoated armor, armor length is 300 mm (11.8 in) less than cable length
- 4.  $75\Omega$  cable, 2.80 mm (0.11 in) maximum outside diameter, 7.6 mm (0.30 in) maximum outside diameter of armor, 7.0 mm (0.275 in) maximum outside diameter of uncoated armor
- 5. Stainless steel ferrules, 8.4 mm (0.33 in) diameter
- 6. FEP-insulated coaxial cable
- 7. Miniature female coaxial connector
- 8. Cable length +20%, -0%

Figure 6: 3300 NSv Extension Cable

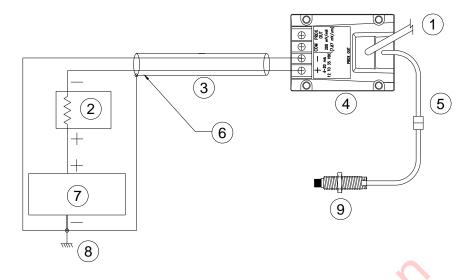


- 1. To test adapter 122115-01
- 2. Receiver
- 3. Cable shield
- 4. Transmitter
- 5. Extension cable
- 6. Recommended wiring is shielded, twisted-pair, 1.0 mm (18 AWG) (part number 02173006). Maximum length is 13 km (8 miles).
- 7. Power supply,  $V_{PS} = 17$  to 35 Vdc
- 8. Common (ground)
- 9. Probe

Figure 7: 991 Thrust Transmitter loop wiring connections

### **Application Advisory**

The phase of the PROX OUT signal is inverted from the standard for Bently Nevada™ products. Also, connecting grounded acpowered equipment to PROX OUT may result in a false alarm. Use test adapter 122115-01 to connect ac equipment to the transmitter. Note that the 122115-01 also inverts the PROX OUT signal.

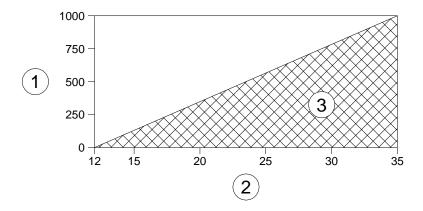

- 1. Maximum loop resistance in ohms (R<sub>LOOP</sub>)
- 2. Power supply voltage (V<sub>PS</sub>)
- 3. Operating region

Figure 8: 991 Thrust Transmitter maximum loop resistance

#### Note:

 $R_{LOOP} = 43.5 \times (V_{ps} - 12) \Omega$  maximum. If the maximum loop resistance is exceeded, then the full scale current will not reach 20 mA.

\* denotes trademarks of Bently Nevada, LLC, a wholly owned subsidiary of General Electric Company.

© 2006 – 2009 Bently Nevada LLC. All rights reserved.

1631 Bently Parkway South, Minden, Nevada USA 89423 Phone: 775.782.3611 Fax: 775.215.2873 www.ge-energy.com/bently