



# COBRA-MII-FT

VERSION 140729


NOTE:  
LEFT (DRIVER'S) SIDE SHOWN.  
RIGHT SIDE IS A MIRROR INSTALLATION

**CAUTION :** THE FILLET WELD ON THE MOUNTINGTAB COULD INTERFEREWITH THE UPPER PORTION OF THE SPINDLE CASTING AND KEEP THE BRACKET FROM FITTING COMPLETELY FLUSH ONTHE MOUNTING SURFACE.

IF IT DOES INTERFERE, IT WILL BE NECESSARY TO LIGHTLY GRIND THE SPINDLE CASTING IN THIS AREA FOR CLEARANCE AND ONLY ENOUGH FOR THE WELD TO CLEAR AND THE MOUNTING PLATE TO FIT FLUSH.  
**DO NOT** GRIND THE WELD.

THE D SHAPED WASHER MUST BE PLACED ON THE UPPER PLATE MOUNT AND ORIENTED TOWARDS THE MOUNTING TAB AS SHOWN

THE CHAMFER ON THE BRACKET MUST BE ORIENTED TOWARDS THE MOUNTING TAB AS SHOWN

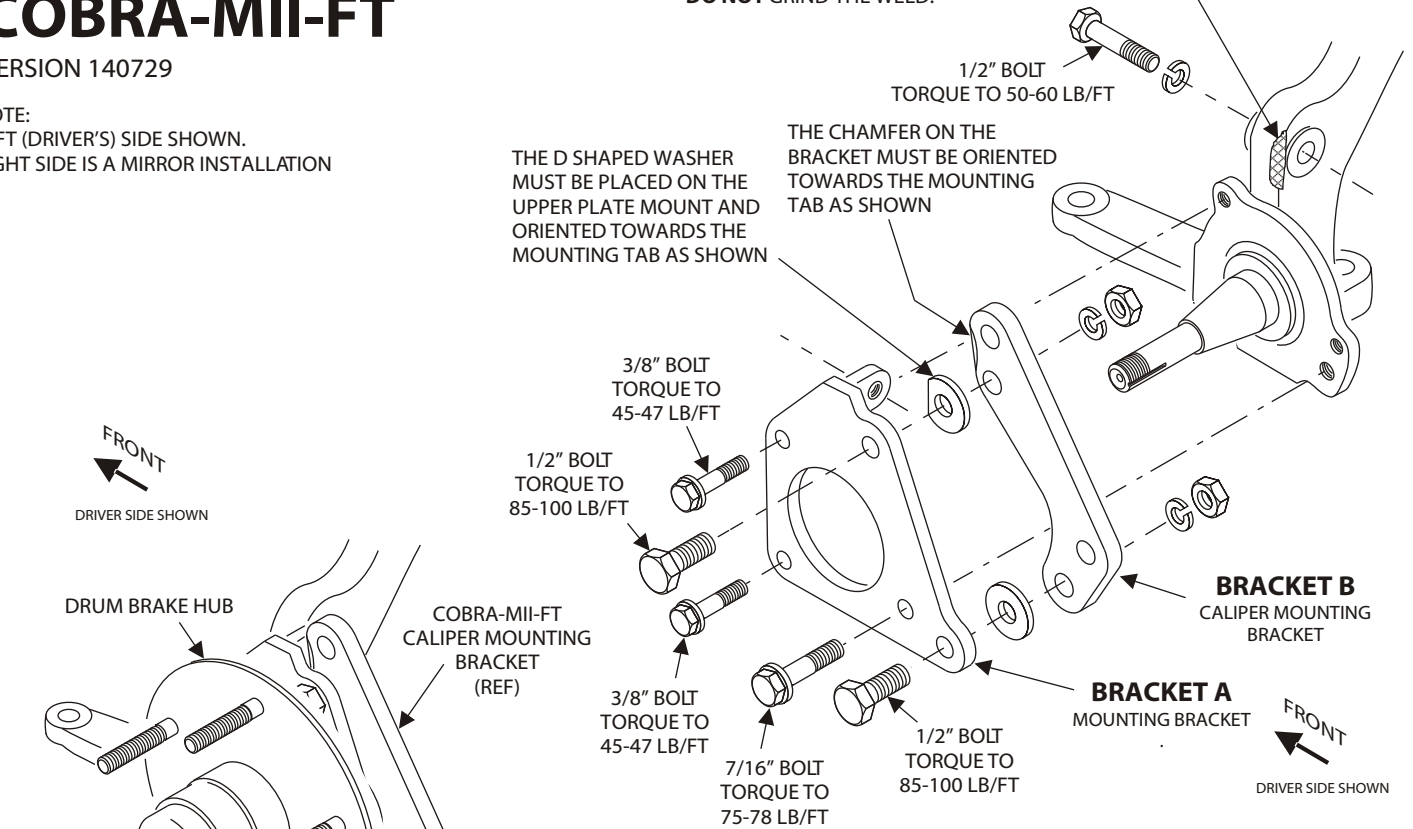

THE DIAMETER ON SOME HUB FLANGES MAY NEED TO BE REDUCED SLIGHTLY TO FIT INTO THE BACK OF THE DISC ROTOR. MACHINE, GRIND, FILE, ETC. **ONLY ENOUGH** SO THE FACE OF THE HUB SITS FLAT INSIDE THE ROTOR. REFER TO INSTRUCTIONS STEP #5.

