### **Platinum Building Chemicals Limited**

Unit 10 Colvilles Park Kelvin Industrial Estate East Kilbride Lanarkshire G75 OGZ

Tel: 01355 222777 Fax: 01355 222715

e-mail: sales@platinumchemicals.co.uk website: www.platinumchemicals.co.uk



Agrément Certificate
10/4781
Product Sheet 1

### PLATINUM BUILDING CHEMICALS LIMITED DAMP-PROOFING SYSTEMS

### **DAMPSOLVE**

This Agrément Certificate Product Sheet<sup>(1)</sup> relates to DampSolve, a silane-based emulsion cream for forming a damp-proof course (dpc) in existing walls.

(1) Hereinafter referred to as 'Certificate'.

### **CERTIFICATION INCLUDES:**

- factors relating to compliance with Building Regulations where applicable
- factors relating to additional non-regulatory information where applicable
- independently verified technical specification
- assessment criteria and technical investigations
- design considerations
- installation guidance
- regular surveillance of production
- formal three-yearly review.

# 

### **KEY FACTORS ASSESSED**

**Effectiveness against rising damp** — when installed into suitable substrates in accordance with BS 6576: 2005, the product forms an effective barrier against rising damp in existing walls (see section 6).

**Drying time** — after treatment, a 230 mm solid brick wall previously affected by rising damp should normally dry out in 6 to 12 months (see section 7).

**Durability** — the product will remain effective against rising damp for at least 20 years (see section 9).

The BBA has awarded this Certificate to the company named above for the product described herein. This product has been assessed by the BBA as being fit for its intended use provided it is installed, used and maintained as set out in this Certificate.

On behalf of the British Board of Agrément

Date of Second issue: 6 November 2015

Originally certificated on 25 November 2010

 ${\sf John\ Albon\ -\ Head\ of\ Approvals}$ 

Construction Products

Claire Curtis-Thomas Chief Executive

The BBA is a UKAS accredited certification body — Number 113. The schedule of the current scope of accreditation for product certification is available in pdf format via the UKAS link on the BBA website at www.bbacerts.co.uk

Readers are advised to check the validity and latest issue number of this Agrément Certificate by either referring to the BBA website or contacting the BBA direct.

British Board of Agrément Bucknalls Lane Watford Herts WD25 9BA tel: 01923 665300 fax: 01923 665301 clientservices@bba.star.co.uk www.bbacerts.co.uk

# Regulations

### The Building Regulations 2010 (England and Wales) (as amended)



In the opinion of the BBA, the use of DampSolve in an existing building is not subject to these Regulations, but action to satisfy Requirement C2(a) and Regulation 7 may be necessary for a 'Material change of use' as defined in Regulation 5(a) (the presence of a UK map indicates that the subject is related to the Building Regulations in the region or regions of the UK depicted):

Requirement: C2(a) Resistance to moisture

The product satisfies the BBA rising damp test and adequately resists the passage of moisture. See Comment:

section 6 of this Certificate.

Regulation: Materials and workmanship

The product is acceptable. See section 9 and the Installation part of this Certificate.

### The Building (Scotland) Regulations 2004 (as amended)



In the opinion of the BBA, the use of DampSolve in an existing building is not subject to these Regulations, but action to satisfy the Regulations and related Mandatory Standards below may be necessary for a 'Conversion' as defined in Regulation 4 (the presence of a UK map indicates that the subject is related to the Building Regulations in the region or regions of the UK depicted):

Durability, workmanship and fitness of materials Regulation:

The product can contribute to a construction satisfying this Regulation. See section 9 and the *Installation* Comment:

part of this Certificate

9 Building standards applicable to construction Regulation:

Standard: 3.3 Flooding and ground water 3.4 Moisture from the ground Standard:

The product satisfies the BBA rising damp test and adequately resists the passage of moisture and can Comment:

contribute to satisfying these Standards, with reference to clauses 3.3.1(1)(2), 3.4.1(1)(2) and 3.4.5(1)(2). See

section 6 of this Certificate.

Standard: 7.1(a) Statement of sustainability

The product can contribute to meeting the relevant requirements of Regulation 9, Standards 1 to 6 Comment:

and therefore will contribute to a construction meeting a bronze level of sustainability as defined in this

Standard.

Regulation: 12 Building standards applicable to conversions

All comments given for this product under Regulation 9 Standards 1 to 6 also apply to this Regulation, with Comment:

reference to clause 0.12.1(1)(2) and Schedule 6(1)(2).

(1) Technical Handbook (Domestic). (2) Technical Handbook (Non-Domestic).

### The Building Regulations (Northern Ireland) 2012 (as amended)



In the opinion of the BBA, the use of DampSolve in an existing building is not controlled by these Regulations, 🛬 but action to satisfy Regulations 23(a)(i)(ii)(iii)(iv) and 28(a) may be necessary for a 'Material change of use' but action to satisty Regulations 23(a)(1)(1)(1)(1)(1)(1) and 23(a) may be under Regulation 8 (the presence of a UK map indicates that the subject is related to the Building Regulations in the region or regions of the UK depicted):

Regulation: 23(a)(b)(i) Fitness of materials and workmanship

The product is acceptable. See section 9 and the Installation part of this Certificate. Comment:

Regulation: 28(a) Resistance to moisture and weather

Comment: The product satisfies the BBA rising damp test and adequately resists the passage of moisture. See

section 6 of this Certificate.

### Construction (Design and Management) Regulations 2015

### Construction (Design and Management) Regulations (Northern Ireland) 2007

Information in this Certificate may assist the client, Principal Designer/CDM co-ordinator, designer and contractors to address their obligations under these Regulations.

3 Delivery and site handling (3.1 and 3.3) and 11 Precautions of this Certificate.

# Additional Information

### NHBC Standards 2014

NHBC accepts the use of DampSolve, provided it is installed, used and maintained in accordance with this Certificate, in relation to NHBC Standards, Chapter 5.1 Substructure and ground floors.

# **Technical Specification**

### 1 Description

DampSolve is a ready-to-use silane-based emulsion cream, used to form a barrier against rising damp where there is no dpc, or where the existing dpc has failed.

### 2 Manufacture

- 2.1 The product is manufactured in a controlled batch blending process.
- 2.2 As part of the assessment and ongoing surveillance of product quality, the BBA has:
- agreed with the manufacturer the quality control procedures and product testing to be undertaken
- assessed and agreed the quality control operated over batches of incoming materials
- monitored the production process and verified that it is in accordance with the documented process
- evaluated the process for management of nonconformities
- checked that equipment has been properly tested and calibrated
- undertaken to carry out the above measures on a regular basis through a surveillance process, to verify that the specifications and quality control operated by the manufacturer are being maintained.

# 3 Delivery and site handling

- 3.1 The product is supplied in 8 litre boxes, 5 litre buckets, and 380 ml and 1 litre cartridges.
- 3.2 The product should be stored in a cool, dry place and protected from frost.
- 3.3 The Certificate holder has taken the responsibility of classifying and labelling the product under the CLP Regulation (EC) No 1272/2008 on the classification, labelling and packaging of substances and mixtures. Users must refer to the relevant Safety Data Sheet(s).

# Assessment and Technical Investigations

The following is a summary of the assessment and technical investigations carried out on DampSolve.

# **Design Considerations**

### 4 Use

- 4.1 DampSolve is used in accordance with BS 6576: 2005 and the Property Care Association Code of Practice for Installation of Remedial Damp-proof Courses in Masonry Walls in existing:
- solid walls of brickwork, blockwork or natural stone (including flint), up to 600 mm thick
- conventional cavity walls
- walls of rubble-filled construction of any thickness.
- 4.2 The installation process involves delivering a set amount of the product into a series of holes drilled into the mortar course, and the subsequent replastering.
- 4.3 Replastering is necessary to retain salts in the body of the wall to prevent damage to subsequent redecoration. This must be carried out in accordance with the Platinum Building Chemicals Replastering Specifications (see Appendix).

# 5 Practicability of installation

The product should be installed by contractors with experience in the treatment of rising damp using the methods described in this Certificate.

# 6 Effectiveness against rising damp



When installed in the wall types defined in section 4.1, in accordance with BS 6576 : 2005, the product forms an effective barrier against rising damp.

# 7 Drying time

After treatment, a 230 mm thick solid brick wall previously affected by rising damp should normally dry in 6 to 12 months provided normal heating is used during the winter months. A thicker wall may take longer. Where hygroscopic salts are present, the wall may not dry completely but the replastering system will prevent damage to internal decorations.

### 8 Maintenance

The product does not require maintenance.

### 9 Durability



Excluding use in new repair work (where highly-alkaline mortars are present), the process will remain effective for at least 20 years.

# Installation

### 10 General


- 10.1 Installation of DampSolve must be carried out in accordance with BS 6576 : 2005 and the Property Care Association Code of Practice for Installation of Remedial Damp-proof Courses in Masonry Walls.
- 10.2 Replastering is necessary to prevent damage to subsequent redecoration. To avoid split responsibility, this should be conducted by the damp-proofing contractor or its agent.
- 10.3 The original survey may have identified other possible causes of dampness, and measures to rectify these must be taken as necessary.

### 11 Precautions

DampSolve is water-based and presents no flammability hazards.


# 12 Timber floor — inspection, preparation and repair

12.1 Where a suspended timber floor is independently supported on sleeper walls, with an effective dpc and showing no signs of dampness, these need not be treated (see Figure 1).

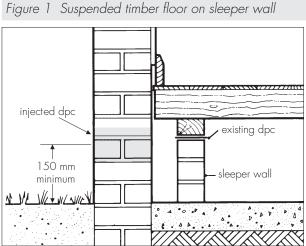

12.2 Where a suspended timber floor is supported on joists and/or a wall plate bearing on or embedded in the wall, there is a possibility of decay, particularly where concealed timbers are in contact with the damp wall. The


condition of these timbers should be ascertained and remedial action taken if necessary (see Figure 2).

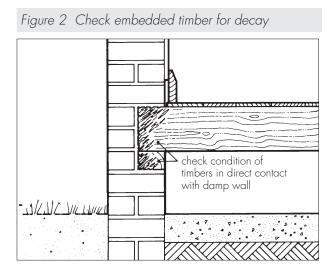

Page 4 of 9

12.3 If damage is limited to the joist ends, the floors may be re-formed, using sleeper walls or joist-hangers, to isolate the timbers from the damp wall (see Figure 3).

Figure 3 Isolation of timber joists from damp wall

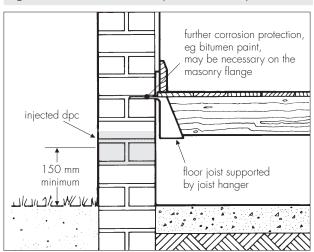

12.4 If the timbers are sound, the existing floor may be retained provided the dpc is formed below the timber joists and/or wall plate (see Figure 4).

injected dpc

injected dpc

inject dpc below sound timbers in direct contact with damp wall

Walling by Market and the second of the second of

## 13 Preparation

- 13.1 The course to be injected is chosen so that the position of the horizontal dpc complies, as far as is practicable, with the recommendations of BS 6576 : 2005, clause 8.3 (see section 12.4 of this Certificate).
- 13.2 Internal walls on solid floors are treated as close to the floor as possible.
- 13.3 Complementary vertical dpc's are positioned, where necessary, to isolate treated walls from the effects of rising damp in adjoining walls or to maintain continuity between horizontal dpc's at different levels.
- 13.4 Internal plastering which may be affected by hygroscopic salts is removed from the area to be treated to a height of 300 mm above the maximum level of the rising damp. Internal skirtings and flooring are also removed, as necessary, to expose the area for treatment. Externally, the proposed dpc line is exposed, where necessary, by removing any facing material.

### 14 Procedure

- 14.1 Untreated walls are isolated by the installation of a vertical dpc throughout the thickness of the wall.
- 14.2 Particular care is taken to avoid bridging the dpc, either internally or externally. Where external rendering has been removed, it is restored, ending in a bellcasting above the injected dpc.
- 14.3 Holes 12 mm in diameter are drilled at intervals of 120 mm or less along the selected mortar course, to depths for various wall thicknesses as shown in Table 1.

Table 1 Depth of hole required/application rate				
	Wall thickness (mm) <sup>(1)</sup>			
	115	230	345	460
Drill hole depth (mm)	100	210	320	430
Application rate per 10 m of wall length (litres) <sup>[2]</sup>	0.9	1.9	2.9	3.9

- (1) For thicker walls the depth of hole should be to within 40 mm of the opposite face.
- (2) Application rates for rubble, porous or highly-absorbent masonry may vary.
- 14.4 Solid walls of brick or stone should be drilled/treated from one side only in a single operation. The selected mortar course is drilled at the prescribed centres to the appropriate depth (see Table 1). Where this is not possible advice should be sought from the Certificate holder.
- 14.5 For preference, cavity walls should be treated from both sides but, if the thickness of the individual leaves permits, may be treated from one side. When undertaking treatment from one side, the drill must pass completely through the selected mortar course, then across the cavity and to a depth of 100 mm in the other leaf. The cavity must be clear before treatment.
- 14.6 If possible, in random stone and rubble infill walls, the mortar course is followed at the appropriate selected level, or drillings may be made into porous stone. Where the variable thickness of stone walls and the possibility of rubble infill dropping and blocking injection holes causes difficulties, it may be necessary to drill to 50% of the wall thickness, from both sides at a corresponding height. Alternatively, additional holes are drilled adjacent to obstructed holes to ensure that an adequate volume of the product is introduced to the wall.
- 14.7 The installation process consists of loading the product into the applicator gun or low-pressure pump and inserting the gun delivery tube into the full length of the predrilled hole. Each hole is backfilled fully with the product to within 10 mm of the surface by slowly squeezing the gun trigger whilst slowly withdrawing the delivery tube. When treating cavity walls from one side it is essential that the holes in each leaf are filled.
- 14.8 The treated walls are left for a period of at least 14 days to allow initial drying out. Internal plastering is applied in accordance with the details given in the Appendix.
- 14.9 Particular care must be taken to avoid bridging the dpc either internally or externally. Where external rendering has been removed, it must be restored, ending in a bellcasting above the injected dpc.
- 14.10 Holes in the external wall surfaces are plugged with sand/cement mortar coloured to match the existing wall surface, or with plastic plugs.

# Technical Investigations

### 15 Tests

Tests were carried out on DampSolve and the results assessed to determine:

- effectiveness against rising damp
- total and active solids content
- specific gravity
- substantivity
- storage stability.

### 16 Investigations

- 16.1 The manufacturing process was evaluated, including the methods adopted for quality control, and details were obtained of the quality and composition of the materials used.
- 16.2 Existing data on the effectiveness and durability of similar materials used as external surface water repellents were evaluated and an assessment was made of the durability of the installed product.
- 16.3 A visit was made to a site in progress to assess the practicability of installation.
- 16.4 A user survey of owners of treated sites was carried out to assess the product's performance in use.
- 16.5 An assessment was made of the presence of odour and the materials available for replastering.

# Bibliography

BS 6576 : 2005 Code of practice for diagnosis of rising damp in walls of buildings and installation of chemical damp-proof courses

BS 8481 : 2006 Design, preparation and application of internal gypsum, cement, cement and lime plastering systems — Specification

BS EN 13914-2 : 2005 Design, preparation and application of external rendering and internal plastering — Design considerations and essential principles for internal plastering

Property Care Association COP09/09 Code of Practice for Installation of Remedial Damp-proof Courses in Masonry Walls

# Conditions of Certification

### 17 Conditions

17.1 This Certificate:

- relates only to the product/system that is named and described on the front page
- is issued only to the company, firm, organisation or person named on the front page no other company, firm, organisation or person may hold or claim that this Certificate has been issued to them
- is valid only within the UK
- has to be read, considered and used as a whole document it may be misleading and will be incomplete to be selective
- is copyright of the BBA
- is subject to English Law.
- 17.2 Publications, documents, specifications, legislation, regulations, standards and the like referenced in this Certificate are those that were current and/or deemed relevant by the BBA at the date of issue or reissue of this Certificate.
- 17.3 This Certificate will remain valid for an unlimited period provided that the product/system and its manufacture and/or fabrication, including all related and relevant parts and processes thereof:
- are maintained at or above the levels which have been assessed and found to be satisfactory by the BBA
- continue to be checked as and when deemed appropriate by the BBA under arrangements that it will determine
- are reviewed by the BBA as and when it considers appropriate.
- 17.4 The BBA has used due skill, care and diligence in preparing this Certificate, but no warranty is provided.
- 17.5 In issuing this Certificate, the BBA is not responsible and is excluded from any liability to any company, firm, organisation or person, for any matters arising directly or indirectly from:
- the presence or absence of any patent, intellectual property or similar rights subsisting in the product/system or any other product/system
- the right of the Certificate holder to manufacture, supply, install, maintain or market the product/system
- actual installations of the product/system, including their nature, design, methods, performance, workmanship and maintenance
- any works and constructions in which the product/system is installed, including their nature, design, methods, performance, workmanship and maintenance
- any loss or damage, including personal injury, howsoever caused by the product/system, including its manufacture, supply, installation, use, maintenance and removal
- any claims by the manufacturer relating to CE marking.
- 17.6 Any information relating to the manufacture, supply, installation, use, maintenance and removal of this product/system which is contained or referred to in this Certificate is the minimum required to be met when the product/system is manufactured, supplied, installed, used, maintained and removed. It does not purport in any way to restate the requirements of the Health and Safety at Work etc. Act 1974, or of any other statutory, common law or other duty which may exist at the date of issue or reissue of this Certificate; nor is conformity with such information to be taken as satisfying the requirements of the 1974 Act or of any statutory, common law or other duty of care.

# **Appendix**

# Platinum Building Chemicals Ltd's Replastering Specification

### **A1** Preparation

- A1.1 Platinum Replastering Specifications are carried out in accordance with BS 6576: 2005, and the Property Care Association Code of Practice for Installation of Remedial Damp-proof Courses in Masonry Walls.
- A1.2 Plaster affected by hygroscopic salts is removed as described in section 13.4.
- A1.3 Replastering can commence after a minimum period of 14 days from installation of the remedial dpc.
- A1.4 If the background is impermeable and offers little suction (eg where rising damp has occurred in the mortar joints), the joints are raked out to provide a mechanical key and/or SBR Latex bonding primer is applied to the surface and the wall is replastered immediately.

### **A2 Platinum Replastering Products**

Wykamol Renovating Plaster — a premixed cement-based lightweight plaster Renderproof— a salt-retardant additive for use in sand-cement mixes.

### A3 Procedure — Wykamol Renovating Plaster

- A3.1 The plaster is mixed with clean water in clean containers, by hand or mechanically, to a normal plastering consistency. Over-mixing is to be avoided and hand-mixing is preferably conducted in a trough using a hoe or plasterer's drag.
- A3.2 The plaster is applied, generally in accordance with BS 8481: 2006 and BS EN 13914-2: 2005, to achieve a thickness of between 10 mm and 15 mm, and the surface is lightly scratched. The plaster is applied no lower than the level of the dpc. If necessary, a batten is used to achieve this.
- A3.3 If the maximum thickness of the required backing coat is to exceed 15 mm, a scratch or dubbing-out coat is necessary to achieve a level surface. Each coat applied must not exceed 15 mm, be well scratched and allowed to dry before the application of the subsequent coat.
- A3.4 Normally, Wykamol Renovating Plaster sets in seven hours.

### A4 Procedure — Renderproof additive

A4.1 The rendering mix described below is based on:

- Portland cement to BS EN 197-1 : 2011
- aggregate clean, sharp, washed sand, free of salt and suitably graded for plastering to BS EN 13139: 2002
- water potable.
- A4.2 Renderproof is used in 3:1 sand/cement mixes using gauging water consisting of one part Renderproof to 24 parts water<sup>[1]</sup>.
- (1) This dosing rate is appropriate for dry sand and should be adjusted if the sand is wet.
- A4.3 The sand-cement-additive mix is applied at a thickness of 10 mm. After the first set of this mix is taken up, the surface must be combed or scratched to provide a mechanical key. Where necessary, a second undercoat of sand and cement is applied; the mix proportions and additive used at the same rate as for the first coat. This coat must also be combed or scratched to provide a key.

# **A5** Finishing coats

After allowing the back coat to set and dry for at least 24 hours, the finishing plaster<sup>(1)</sup> is applied at approximately 1.5 mm to 3 mm thickness. In very wet conditions the drying time can be longer and the finishing plaster must not be applied until it is dry.

(1) Covered by a valid Agrément Certificate.

### A6 General

The following general information should also be observed.

- A6.1 The amount of gauging water in the undercoats should be a minimum consistent with reasonable application.
- A6.2 Undercoats based on gypsum must never be used in this type of application.
- A6.3 It is recommended that the undercoats be scrape finished to minimise the risk of cracking.
- A6.4 A strong mix is never applied over a weak mix or backing.

A6.5 Where scratch coats are to be left as a finish, a high quality wood float finish may be used. However, it is preferred to scrape the finish to a textured surface.

A6.6 Finishing plaster is not recommended if the surface is to be tiled.

### A7 Dry-lining methods

A7.1 In certain circumstances replastering of walls following chemical dpc insertion is not feasible, eg extremely friable wall surfaces, uneven wall profiles. Where dry lining is to be carried out, this must be in accordance with the manufacturer's recommendations. Care should be taken to ensure that gypsum adhesives are not used in 'dot and dab' applications directly onto the wall surface. Timber used as battens must be pre-treated and all cut ends re-treated on site. Ventilation must be provided behind the system until the walls have dried out to reduce the possibility of condensation within the void.

A7.2 On walls which are persistently damp due to the presence of high concentrations of hygroscopic salts, normal dry-lining methods are unsuitable. However, in such cases reinstatement can proceed in conjunction with a BBA approved ventilated dry lining system, based on a high-density polyethylene (HDPE) membrane which provides a vapour impermeable surface suitable for conventional plastering and/or dry-lining techniques.