




## AUX-USB Plug Saver

Part #: AGA-A-U-PS

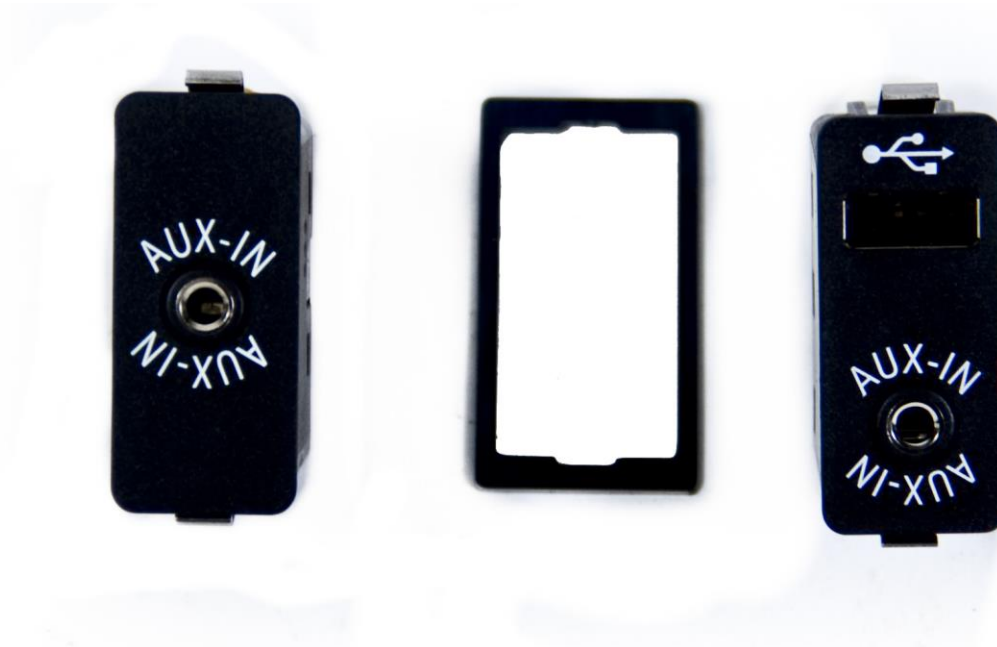

### Problem:

BMW E90 chassis, or any chassis with the same AUX-USB plug, has a broken aux connector in center console. This causes the USB and AUX connector to drop into the center console, making it impossible to plug in to the connector.

### Solution:

AGA's AUX-USB Plug Saver is manufactured from spring steel, heat treated and black oxide to match the interior color of the center console and AUX-USB switch.

### Benefit:

The AUX-USB Plug Saver helps save time and money by providing an alternative to replacing the center console.



## AUX-USB Plug Saver Instructions

Before installing we recommend watching AGA AUX-USB Plug Saver video on our website at [www.agatools.com](http://www.agatools.com)




### Step 1:

Start by fishing the AUX connector out of the hole it has fallen into. Align with a pick on the inside and use a screw driver from down below.



### Step 2:

Once the connector is out, make sure the wires don't fall back into the hole. Carefully push on the plastic tabs and disconnect the two connectors to the AUX-USB power.

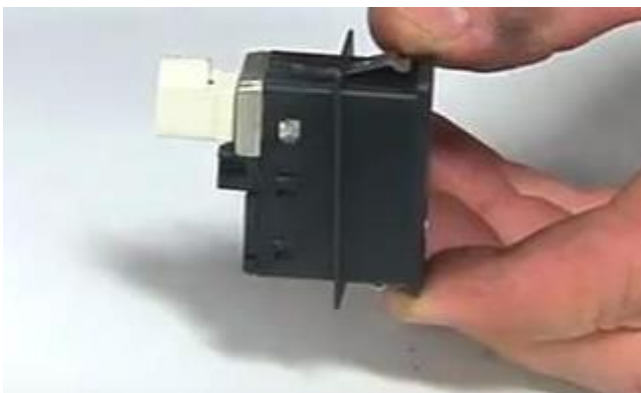

### Step 3:

To install the AUX-USB Plug Saver, slide it over the housing of the connector, until it clicks into place.

**NOTE: Push metal frame over the metal tabs at the same time to avoid bending the USB-AUX Plug Saver.**



### Step 4:

Connect the USB power then connect the AUX connector back to the back of the switch. Push the wires in and push the switch back down.

**NOTE: If area where metal tabs make contact is damaged, it may be necessary to clean up center console with exacto knife or similar. Carefully bending the metal tabs outward on USB-AUX Connector to increase tension may also be needed.**