Copyright 2020, Dinkar Ganti, All rights reserved.

ENHANCED AEROBIC BIOREMEDIATION OF CHLORINATED SOLVENTS AT A STRIP MALL IN YORK, PA

Prepared by Dinkar GANTI Developer, Contaminated Properties

April 30, 2020

Enhanced Bioremediation of Chlorinated Solvents at a Strip Mall in York, PA

Ganti, Dinkar dinkar.ganti@gmail.com

April 30, 2020

1 Enhanced Aerobic Bioremediation Report

Introduction

In this report, we present data collected on *aerobic* bioremediation of soil or soil-gas contaminated with Perchloroethene (PCE) and Trichloroethene (TCE), cis-1,2-Dichloroethene (cis12DCE) and Vinyl Chloride (VC) using VaporRemed.

VaporRemed is included in the (National Contingency Planning Product Schedule) NCP Product Schedule (Products Available for Use on Oil Spills) as a bioremediation agent.

Enhanced Bioremediation of Chlorinated Hydrocarbons

National Research Council. 1993. In Situ Bio-remediation: When Does it Work? [1] lists three forms of evidence for demonstrating that *in-situ bioremediation* is effective for a given project:

- 1. documented loss of contaminants from the site due to bioremediation,
- 2. laboratory assays showing that the microorganisms in site samples have the *potential* to transform the contaminants under expected site condition, and
- 3. one or more pieces of evidence showing that the bioremediation potential is *actually realized* in the field.

1.1 Enhanced Aerobic Bioremediation of Chlorinated Hydrocarbons using VaporRemed

1 - Documented loss of contaminants from the site

Aerobic Degradation - It has long been thought that TCE is resistant to degradation under aerobic conditions due to its already oxidized state. Recently, a number of monooxygenases produced under aerobic conditions have been shown to degrade TCE (Nelson et al., 1987; Harker and Young, 1990). This report corroborates our assertion that TCE can be degraded under aerobic conditions. Link

2 - Laboratory assays showing that microorganims in the site samples have the potential

The figure 1 displays a modified version of the Hazen table, link here, highlighting that the following compounds can be broken down by cometabolic bioremediation.

		Come	tabolic Bioremediatio	on Conditions	
	Aerobic	Aerobic	Aerobic	Anaerobic	Anaerobic
Contaminants	TCE DCE VC PAHs PCBs MTBE Creosote >300 other compounds	TCE DCE VC TNT	 TCE DCE VC 1,1-DCE 1,1,1-TCA MTBE 	PCE TCE DCE VC Hexachlorocyclohexane	 BTEX PCE PAHs Atrazine TNT
Substrates	Methane Methanol Propane Propylene	Ammonia Nitrate	Toluene Butane Phenol Citral Cumin Aldehyde Limonene	Methanol	Glucose Acetate Lactate Sulfate Pyruvate
Microoganism(s)	Methylosinus	Nitrosomonas Nitrobacter	 Rhodococcus Pseudomonas Arthrobacter 	 Pseudomonas Streptomyces Corynebacterium 	Dehalococcoides Methanogens Desulfovibrio Clostridium Geobacter Clavibacter
Enzyme(s) produced	Methane monooxygenase Methanol dehydrogenase Alkene mono- oxygenase Catechol dioxygenase	Ammonia monooxygenase	Toluene monooxygenase Toluene dioxygenase	Alcohol dehydrogenases	Dehalogenase AtzA Dichloromethane Dehalogenase

Modified from Hazen (2010)

Figure 1: Modified table from Hazen (2010)

VaporRemed is a bioremediation comprising of a consortium of bacteria listed here

- Pseudomonas alkaligenes
- Phenylobacterium immobile
- Stentrophomonas maltophilia
- Gluconobacte cerinus
- Agrobacter radiobacter

Most of the literature supports the hypothesis that *Pseudomonas* can remediate chlorinated hydrocarbons in anaerobic conditions, however, bio-remediation of chlorinated hydrocarbons under aerobic conditions has not been documented before.

3 - One or more pieces of evidence showing that the bioremediation potential is actually being realized at the site.

This section outlines the effectiveness of VaporRemed as an agent accomplishing enhanced aerobic bioremediation of chlorinated solvents by collecting data after adding VaporRemed to various locations at the site.

1. Soil-bore analysis

The table below shows the degradation observed after introducing AgroRemed to up to 10' bgs at SB 121 cluster of locations.

UTCTime	PCE	TCE	VC	cis12DCE
06/28/2017 10:10 09/11/2017 11:40		7400.00 150.00	$0.47 \\ 10700.00$	3700.00 83900.00

Table 1: Contamination levels at SB 121

Table 1 shows that in 70 days both PCE and TCE reduced by more than 90 % in soil. AgroRemed is commercially available to help reduce TPH levels in soil, groundwater by 90 % for over a decade. However, this is the *first* project where AgroRemed is being applied to reduction of PCE/TCE levels in soil.

This reduction is significant and also provides the first clear evidence of aerobic bioremediation of PCE/TCE at the site. Further, a significant increase in the values of cis-1,2-Dichloroethene (cis12DCE) and Vinyl Chloride (VC) by 2167 % and 2127 % respectively confirms the evidence of active aerobic bioremediation as reported in the literature. The significant reduction in the values of PCE and TCE supports our hypothesis that remediation of both these contaminants is being accomplished under aerobic conditions.

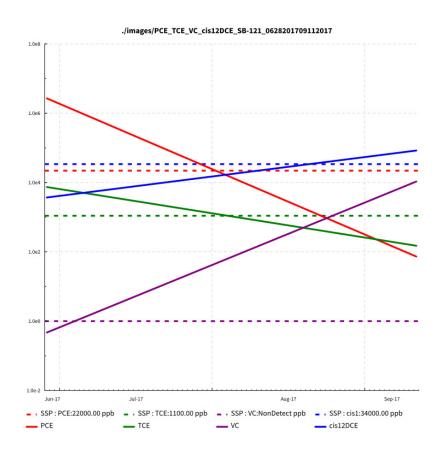


Figure 2: Contamination levels at SB 121, results in ppb*

First-order decay formula used throughout the report Definition : A quantity is subject to exponential decay if it de-

creases at a rate proportional to its current value. In this report and the attached source code, the following formula is being used.

 $rate = oneDay * (\ln r2 - \ln r1)/timeInSeconds$

where

$$oneDay = 24 * 3600$$

seconds

where *timeInSeconds* is difference in time in seconds, r1 is the contamination level at time T1, r2 is the contamination level at time T2.

Further, as one is dealing with decay rates of PCE + TCE, the model accounts for the PCE decay by accumulating the decreased amount completely into the concentrations of TCE. The current model is not ideal because it doesn't account for "daughter" compounds such as cis12DCE and *trans* Trichloroethene. Further, the model is as approximation as the ppb values are being used instead gram molar concentrations.

Computed first order decay for SB-121

- PCE = -14.00 %
- TCE = -0.005 %

Some more notes about the plot

Assuming a first order decay of PCE in the plot above, one can estimate the PCE levels at any point between 6/28 and 9/11. For example, it can be seen that the site specific levels for PCE were reached at the site in the first week of August, 2017.

2. Sub-slab Soil Gas Analysis

Historical data at VP 3 located in the mechanical room/pump room has shown high concentrations of the chemicals of concerns. Therefore, the effectiveness of VaporRemed was tested by introducing VaporRemed directly into VP-003 and monitoring the results over a period of 2 hours. 1 2

UTCTime	PCE	TCE	VC	cis12DCE
02/21/2018 09:00	107000.00	7710.00	143.00	23300.00
04/06/2018 09:24	587.00	326.00	0.47	1990.00
06/21/2018 09:00	32000.00	15500.00	11300.00	434000.00
07/25/2018 09:00	55600.00	21900.00	3440.00	86900.00
07/25/2018 11:00	28400.00	11600.00	3700.00	47800.00
08/28/2018 09:00	15500.00	11500.00	29100.00	147000.00
09/26/2018 10:26	92.20	99.20	30.50	280.00
05/22/2019 09:00	568.00	212.00	200.00	754.00
$05/22/2019 \ 11:00$	543.00	82.20	713.00	4620.00
05/23/2019 09:00	445.00	203.00	329.00	3590.00
07/01/2019 09:00	470.00	52.80	65.90	2930.00
07/01/2019 11:00	1470.00	155.00	30.30	496.00

Table 2: Contamination levels of COCs at VP-003.

Computed first order decay rate for PCE and TCE on 7/25/2018

- PCE = -800 %
- TCE = -762 %

For example, based on the above rates, one can estimate that it will take about 6 to 8 hours to bring 55,000 ppm to close to site-specific limits. What this implies is that a project can establish tighter controls over various locations and measure for exceedances.

In order to confirm whether VP 3 is the primary source of vapor intrusion, another sub-slab soil gas sampling location, identified as EPS 1 was selected just below the dock in the basement. The contaminations recorded in EPS 1 were not significant as shown below.

 $^{^1\}mathrm{VaporRemed}$ was not injected under pressure; this is important as injection increases project costs.

 $^{^2 \}rm Same$ day measurements were taken 2 hours after adding VaporRemed to the location. For example on 7/25/2018 VaporRemed was added at 9:00 am.

Table 3: Contamination levels measured at EPS-1

Date	PCE	TCE
2/21/2018	876	107
5/17/2018	412	84.6
8/28/2018	585	833

Bacterial counts in VP-003 between Mar $23 \mathrm{rd}$ and Mar $25 \mathrm{th}~2020$

Bacterial counts are an important parameter for measuring the effectiveness of bioremediation. The fact that the bacterial population is continuing and growing indicates that the conditions in the sub-slab soil-gas location are *not* anaerobic.

- : Bacterial count after 2 hours was 14,800,000
- : Bacterial count after 72 hours was 15,300,000

The sustained population count indicates that PCE and TCE contamination levels at VP-003 are not toxic to the bacteria in Vapor-Remed.

3. Monitoring Indoor Air Quality

A total of 12 Indoor Air sampling locations were selected for monitoring indoor air quality. However, *focal point* was the sampling station IA 001 which is just outside the sub-slab monitoring point VP 3. Data collected at each of the sampling locations is presented below. The sampling points IA 001, IA 002 and IA 003 are in the basement and closer to VP 3, the source of vapor intrusion. The higher concentrations of PCE and TCE in these rooms is a direct result of vapor intrusion from VP 003. Application of VaporRemed has shown to bring the values closer to their respective site-specific levels.

• IA 001: Basement: Just outside VP 3 sub-slab sampling point The location was measured at a greater frequency than the other locations as this location is closest to VP 3. It was observed that after summer of 2019 the results for Vinyl Chloride were non-detect. This degradation can be attributed to the bioremediation of Vinyl Chloride by VaporRemed. This confirms the results of an earlier project wherein biodegradation of poly vinyl chloride (PVC) was evaluated both under laboratory and semi-industrial scale and it was observed that the bacterial consortium in VaporRemed were effective in biodegradation of PVC.

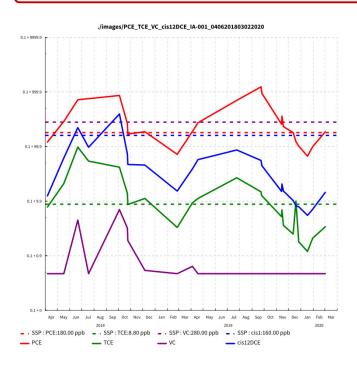


Figure 3: Values of PCE/TCE at IA-001

- $\bullet\,$ IA 002: Basement: the Middle room in the basement away from VP $_3$
- IA 003: Basement: Just below the warehouse and the loading dock
- IA 004: H Block closer to the rear parking lot away from VP 3
- IA 005: Restroom away from VP 3
- IA 006: A room identified as a Vault away from VP 3
- IA 007: Yoga room In the line of VP 3
- IA 008: WIS office in the line of VP 3
- IA 009: Ambient air on top of the warehouse away from VP 3

UTCTime	PCE	TCE	VC	cis12DCE
04/06/2018 08:35	121.00	7.80	0.47	12.50
05/17/2018 09:00	288.00	21.00	0.47	61.80
06/21/2018 09:00	719.00	97.80	4.50	222.00
07/18/2018 09:00	754.00	54.10	0.47	97.00
10/03/2018 16:15	861.00	41.90	7.00	395.00
10/23/2018 16:10	262.00	13.80	3.20	72.30
10/24/2018 16:00	169.00	8.70	1.90	47.00
12/06/2018 09:00	187.00	11.20	0.54	45.80
02/25/2019 09:00	72.00	3.30	0.47	15.30
04/04/2019 09:00	188.00	9.30	0.64	38.90
04/18/2019 09:00	273.00	11.20	0.47	57.60
07/24/2019 09:00	700.00	26.80	0.47	86.50
09/23/2019 09:00	1240.00	14.80	0.47	55.60
09/24/2019 09:00	1050.00	12.90	0.47	49.10
09/24/2019 17:00	1050.00	12.90	0.47	49.10
09/25/2019 09:00	939.00	12.50	0.47	44.40
09/25/2019 17:00	939.00	12.50	0.47	44.40
11/13/2019 16:30	257.00	5.20	0.47	15.10
11/14/2019 16:30	360.00	6.90	0.47	20.60
11/18/2019 08:30	232.00	3.60	0.47	15.30
12/12/2019 17:00	180.00	2.50	0.47	10.30
12/19/2019 17:00	123.00	10.00	0.47	8.20
12/26/2019 17:00	102.00	1.80	0.47	7.90
01/17/2020 16:15	66.70	1.20	0.47	5.50
01/30/2020 16:30	99.50	2.10	0.47	7.10
03/02/2020 05:15	186.00	3.40	0.47	14.50

Table 4: Documented reduction of TCE/PCE in IA-001

Table 5: Documented reduction of TCE/PCE in IA-002 $\,$

UTCTime	PCE	TCE	VC	cis12DCE
07/18/2018 09:00	244.00	24.30	0.47	43.50
02/26/2019 09:00	102.00	4.30	0.47	20.10
04/04/2019 09:00	190.00	9.00	0.47	38.00
07/24/2019 09:00	603.00	23.40	0.47	79.30
01/20/2020 16:15	86.40	1.60	0.47	5.80

- IA 010: Store in the front D Block: Jewelry store away from VP 3
- IA 011: Store in the front C block away from VP 3
- IA 012: Store in Front C block away from VP 3

Table 6: Documented reduction of TCE/PCE in IA-003

UTCTime	PCE	TCE	VC	cis12DCE
02/27/2019 09:00	132.00	6.40	0.52	25.40
04/04/2019 09:00	188.00	9.00	0.70	40.80
07/24/2019 09:00	739.00	27.90	0.47	92.80

Table 7: Documented reduction of TCE/PCE in IA-004 $\,$

UTCTime	PCE	TCE	VC	cis12DCE
02/28/2019 09:00	98.20	4.50	0.47	19.70
04/04/2019 09:00	160.00	7.80	0.55	34.60
07/24/2019 09:00	607.00	22.60	0.47	74.60
01/20/2020 16:00	101.00	2.30	0.47	6.90

Table 8: Documented reduction of TCE/PCE in IA-005

UTCTime	PCE	TCE	VC	cis12DCE
04/04/2019 09:00				
07/24/2019 09:00	818.00	18.90	0.47	61.00

Table 9: Documented reduction of TCE/PCE in IA-006

UTCTime	PCE	TCE	VC	cis12DCE
04/04/2019 09:00	117.00	5.70	0.47	23.30
07/24/2019 09:00	439.00	19.10	0.47	60.90

Table 10: Documented reduction of TCE/PCE in IA-007 $\,$

UTCTime	PCE	TCE	VC	cis12DCE
01/17/2020 16:15	62.40	1.00	0.47	5.50

Table 11: Documented reduction of TCE/PCE in IA-008 $\,$

UTCTime	PCE	TCE	VC	cis12DCE
$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	$ \begin{array}{r} 196.00 \\ 524.00 \\ 62.80 \end{array} $	8.30 22.80 1.10	0	38.80 76.70 5.70

UTCTime	PCE	TCE	VC	cis12DCE
04/18/2019 09:00	75.20	2.80	0.47	14.10
07/24/2019 09:00	1.10	0.98	0.47	1.60
01/20/2020 18:00	4.30	0.98	0.47	1.60

Table 12: Documented reduction of TCE/PCE in IA-009

Table 13: Documented reduction of TCE/PCE in IA-010

UTCTime	PCE	TCE	VC	cis12DCE
07/18/2018 09:00	32.10	0.00	0.47	4.80
12/06/2018 09:00 04/18/2019 09:00	34.30 7.70	$2.10 \\ 0.98$	$0.47 \\ 0.47$	$7.40 \\ 1.40$

Table 14: Documented reduction of TCE/PCE in IA-011 $\,$


UTCTime	PCE	TCE	VC	cis12DCE
01/20/2020 16:30	48.10	1.30	0.47	3.10

Table 15: Documented reduction of TCE/PCE in IA-012 $\,$

UTCTime	PCE	TCE	VC	cis12DCE
04/18/2019 09:00	31.50	1.60	0.47	6.80

4. Bioremediation of Soil Gas using VaporRemed

We decided to introduce VaporRemed at three new injection points drilled near SG 101 and SG 106. The holes at SG 101 were shallow less than 1' as standing water was recorded at this depth. At SG 106, these injection points were drilled to 6' below surface.

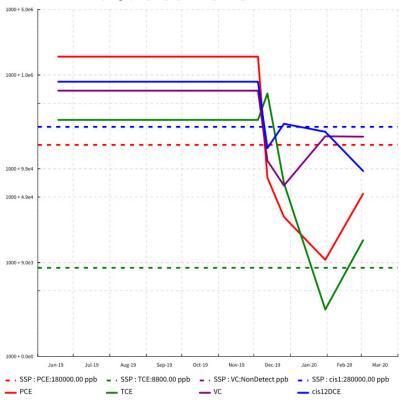

./images/PCE_TCE_VC_cis12DCE_SG-106_0618201903022020

Figure 4: Values of COCs between 2019 - 2020

Table	16.	Coil.	Car	Values	in	CC	106	
Table	10:	5011	(Tas	vanues	m	501	100	

UTCTime	PCE	TCE	VC	cis12DCE
06/18/2019 09:00	1570000.00	332000.00	681000.00	848000.00
12/04/2019 11:25	1570000.00	332000.00	681000.00	848000.00
12/12/2019 11:25	80400.00	636000.00	122000.00	166000.00
12/26/2019 11:03	30700.00	70400.00	66300.00	302000.00
01/30/2020 11:01	10700.00	3160.00	222000.00	248000.00
03/02/2020 11:50	54200.00	17300.00	220000.00	94700.00

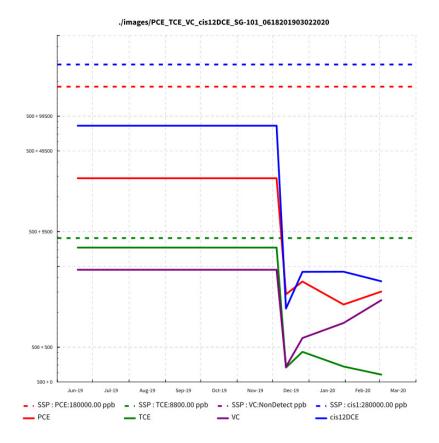


Figure 5: Values of COCs between 2019 - 2020 at SG-101

1000	11. 5011 0.8	is values li	100 101	
UTCTime	PCE	TCE	VC	cis12DCE
06/18/2019 09:00	29000.00	7280.00	4680.00	82700.00
12/04/2019 11:25	29000.00	7280.00	4680.00	82700.00
12/12/2019 11:08	2870.00	666.00	676.00	2160.00
12/26/2019 11:04	3700.00	911.00	1200.00	4490.00
$01/30/2020 \ 10:48$	2340.00	680.00	1620.00	4500.00
03/02/2020 11:22	3030.00	579.00	2550.00	3720.00

2 Conclusions

The study was carried out for almost two years. Based on the data collected and presented above, we enumerate the following observations:

- 1. Enhanced aerobic bio-remediation of chlorinated hydrocarbons is demonstrated at various soil matrices.
- 2. VP 3 is identified as a primary source of Vapor intrusion in the basement; VaporRemed was added to VP 3 to contaminant levels.
- 3. Sub-slab soil gas samples showed high-levels of PCE that were reduced due to enhanced bioremediation.
- 4. SB 121 cluster showed enhanced bioremediation in soil due to addition of VaporRemed.

3 Open Source Libraries and Software Used to Create this report

- Chart : A library for generating 2D charts and plots
- Haskell Programming Language
- Evaluating Vapor Intrusion Pathways
- Evualation of spatial and temporal variability in VOC concentrations at Vapor Intrusion Investigation Sites.

4 Source code and data

Source-code and collected data is committed on github.com and is available upon request.

5 Reviewers

- Steve Vedder svedder@epsofvermont.com
- Satya Ganti sales@sarvabioremed.com

6 Bibliography

 National Research Council. In Situ Bioremediation: When Does it Work? The National Academies Press, Washington, DC, 1993.

7 References

- TO-15
- DNR Guidance on Vapor Intrusion

Revision History

Revision	Date	$\mathbf{Author}(\mathbf{s})$	Description
1.0	04.12.2020	DG	created
1.1	04.12.2020	DG	modified, changed voice, added more
			rows to vp3
1.2	04.29.2020	DG	More edits