

## Toyota Tundra 2007-2011

## Toyota Sequoia 2008-2011

(Includes models with navigation)

PART NUMBER: IF-71-03-G3



## PLEASE READ COMPLETE INSTRUCTIONS BEFORE INSTALLING THIS VSM G3

All instructions assume a drivers seat vantage point. Caution is advised when removing and reassembling wood or plastic parts of a dash. Applying unnecessary force or pressure may cause a piece to crack or break.

## When properly installed, the metal between the ball and 2 small holes is all that is exposed. (Some exceptions apply).


TOOLS REQUIRED: Dash Trim Removal Tool (DTRT), 10mm socket driver and 6" extension arm, 5/64" drill bit and drill,

marking pen

PARTS INCLUDED: VSM G3, two (2) # 10 x 1/2" screws, A Plate, J Stem

LOCATION: Right of Radio

STEP 1. Place the DTRT between the instrument cluster bezel and the left side of the radio. With a twisting motion, release the clips around the entire right side of the instrument cluster bezel (you do not have to remove the entire bezel) in order to remove the air vent located directly to the left of the radio. Remove the four (4) clips securing the air vent to the instrument cluster bezel; removing this vent will provide access to the climate control and radio (see Photo 1).

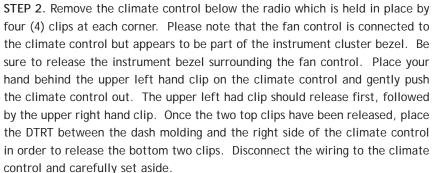



STEP 4. Place the VSM G3 in position as pictured in Photo 2. Using the G3 as a guide, mark the two pilot holes with a marking pen. Carefully drill out the marked areas using a 5/64" drill bit and drill. Place the VSM G3 over the pilot holes and secure it flush to the dash as pictured with the two #8 x 1/2" screws provided. Place the dash back together in the reverse order it was dismantled. You have successfully installed your VSM G3!


Note: See the Assembly Instructions for G3 Components for additional information.







Pro.Fit International, Inc.® may not be held liable for any damage to a vehicle before, during or after the installation or removal of this VSM G3<sup>TM</sup>. Pro.Fit International may not be held liable for any personal injury resulting from accident or improper installation. Pro.Fit International, Inc.® 1335 Eagandale Court, Eagan, MN 55121, Ph: 651.688.3588 or 800.388.0073 Fx: 651.688.9876



View Instruction & Updates
Online at
www.pro-fit-intl.com